

Vehicle Inspection Report

Date Inspected: 28/03/2025 13:16

Reg: NV08FPG

VIN: YV1MW214282421301

NAMA Grading



Grade

5

Appraised By: Eastbourne Car Auctions

General Details

Make	VOLVO	Body Type	Estate	Doors	5
Model	V50 S 16V - 1798cc	Fuel Type	Petrol	Colour	Blue
Mileage	176,365 miles	Transmission	Manual	Year of MFR	2008
		Gears	5	Date First Reg	19/04/2008

Miscellaneous

V5 Location	Here
MOT Location	Here
MOT Expiry	18/09/2025
No. Keys	2

Tyres & Wheels

OSF Depth	6 mm	Alloys	Yes
NSF Depth	5 mm	Alloys That Need Refurb	4
OSR Depth	6 mm	Tools	Yes
NSR Depth	6 mm	Spare	Space Saver

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Poor
Parcel Shelf	Yes
Odour	No
Comments	drivers seat torn


Service History

Service History	Yes
Stamps	

Extras

Metallic Paint	Yes	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	No	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	5	Parking Sensors	No
Phone Kit	No	Drv Airbag	Yes	Reversing Camera	No	EML	No

Damage Assessment

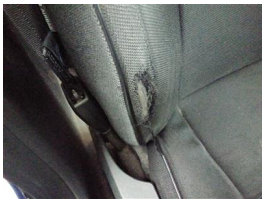

Seat Back Cover osf

Torn

Over 3mm

Replace




Seat Base Cover osf

Holed

UpTo 3mm

Smart Repair

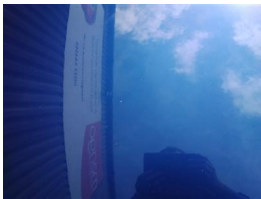

Bonnet

Chipped

Multiple Chips

Refinish



Bumper Front
Scratched
Over 100mm Thru Paint
Refinish



Wing nsf
Dented
With Paint Damage
Repair and Refinish



Screen Front
Chipped
UpTo 10mm
Smart Repair

Door Mirror Assy nsf
Scratched (Painted)
Over 25mm Thru Paint
Smart Repair



Door nsf
Chipped
1 To 5
Smart Repair



Door nsr
Dented
With Paint Damage
Repair and Refinish



Door Moulding nsr
Broken
Needs Replaced
Replace



Qtr Panel nsr
Dented
With Paint Damage
Repair and Refinish



Boot Lid
Chipped
1 To 5
Smart Repair



Bumper Rear
Dented
With Paint Damage
Repair and Refinish



Rear TowEye Cvr
Missing
Needs Replaced
Replace



Reflector osr
Broken
Needs Replaced
Replace



Qtr Panel osr
Scratched
Over 25mm Thru Paint
Refinish



Door osr
Dented
Over 30mm
Repair and Refinish



Door osf
Dented
Over 30mm
Repair and Refinish



Wing osf
Poor Previous Repair
Poor Paint
Refinish



Seat Base Cover osf
Torn
Over 3mm
Replace



**Bumper
Front
Grill**

Broken

Needs
Replaced

Replace



**Number
Plate
Front**

Broken


Needs
Replaced

Replace

Damage Lines

Component	Condition	Severity	Repair
Seat Back Cover osf	Torn	Over 3mm	Replace
Seat Base Cover osf	Holed	UpTo 3mm	Smart Repair
Bonnet	Chipped	Multiple Chips	Refinish
Bumper Front	Scratched	Over 100mm Thru Paint	Refinish
Wing nsf	Dented	With Paint Damage	Repair and Refinish
Screen Front	Chipped	UpTo 10mm	Smart Repair
Door Mirror Assy nsf	Scratched (Painted)	Over 25mm Thru Paint	Smart Repair
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Chipped	1 To 5	Smart Repair
Door nsr	Dented	With Paint Damage	Repair and Refinish
Door Moulding nsr	Broken	Replace	Replace
Qtr Panel nsr	Dented	With Paint Damage	Repair and Refinish
Boot Lid	Chipped	1 To 5	Smart Repair
Bumper Rear	Dented	With Paint Damage	Repair and Refinish
Rear TowEye Cvr	Missing	Replace	Replace
Reflector osr	Broken	Replace	Replace
Qtr Panel osr	Scratched	Over 25mm Thru Paint	Refinish
Door osr	Dented	Over 30mm	Repair and Refinish
Door osf	Dented	Over 30mm	Repair and Refinish
Wing osf	Poor Previous Repair	Poor Paint	Refinish
Seat Base Cover osf	Torn	Over 3mm	Replace
Bumper Front Grill	Broken	Replace	Replace
Number Plate Front	Broken	Replace	Replace

Vehicle Splat

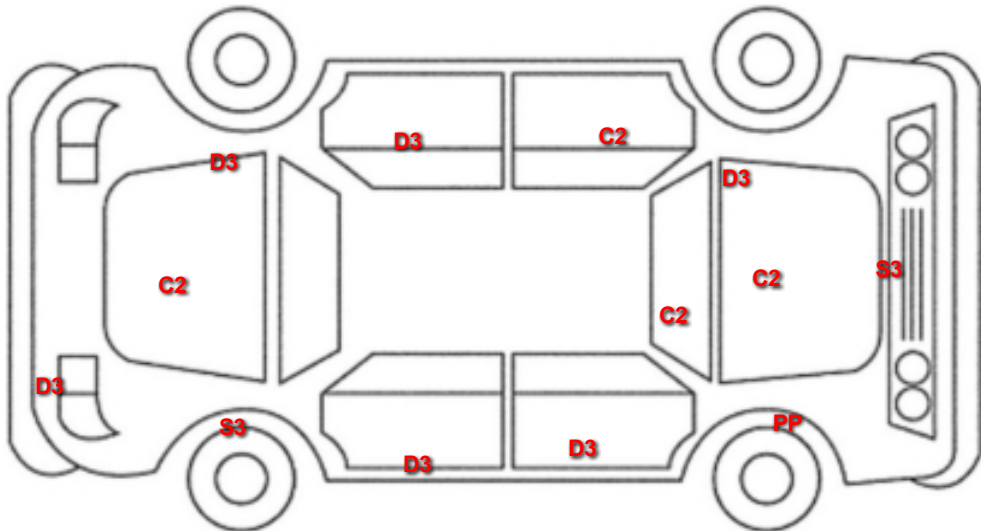

Splat Key

- S3**
Scratch/Paint defect 100m +
- D3**
Dent/damage 100mm +
- C2**
Multiple Chips
- PP**
Poor Previous

Comments

Last Service - 02/12/2014 at 64,425 miles (7 services (4 main dealer))

front bumper misaligned and noisy engine

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.