

Vehicle Inspection Report

Date Inspected: 31/03/2025 13:51

Reg: GU62NUH

VIN: TMBKC75L9C6086082

NAMA Grading



Grade

3

Appraised By: Eastbourne Car Auctions

General Details

Make	SKODA	Body Type	Hatchback	Doors	5
Model	YETI ELEGANCE TDI	Fuel Type	Diesel	Colour	Grey
	CR - 1968cc	Transmission	Manual	Year of MFR	2012
Mileage	183208 miles	Gears	5	Date First Reg	04/09/2012

Miscellaneous

V5 Location	
No. Keys	2

Tyres & Wheels

OSF Depth	6 mm	Alloys	Yes
NSF Depth	3 mm	Alloys That Need Refurb	4
OSR Depth	6 mm	Tools	No
NSR Depth	5 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	No
Odour	No

Service History

Service No
History
Stamps

Extras

Metallic Paint	Yes	Central Locking	Yes	Interior	Leather	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	Yes	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	5	Parking Sensors	Rear
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	No	EML	No

Damage Assessment



Wing osf

Chipped
1 To 5
Smart
Repair

Wing osf

Scratched
Over
25mm Not
Thru Paint
Machine
Polish

Door osf

Scratched
Over
25mm Not
Thru Paint
Machine
Polish

Door osr

Dented
Between
10mm +
30mm



Door osf
Chipped
Edge Chip
Smart
Repair



Door osf
Chipped
1 To 5
Smart
Repair

Smart
Repair

Door osr
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



**Qtr Panel
osr**
Dented
Between
10mm +
30mm
Smart
Repair

**Qtr Panel
osr**
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



Tailgate
Dented
Over
30mm
Repair
and
Refinish



**Badgedecal
Rear**
Missing
Needs
Replaced
Replace



**Qtr Panel
nsr**
Scratched
Over
25mm
Thru Paint
Refinish



Door nsr
Scratched
Over
25mm
Thru Paint
Refinish

Door nsf
Scratched
Over
25mm Not
Thru Paint
Machine
Polish

Door nsf
Chipped
1 To 5
Smart
Repair



Door nsf
Dented
2 Or Less
UpTo
10mm
Smart
Repair




Wing nsf
Chipped
1 To 5
Smart
Repair

Wing nsf
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



**Bumper
Front**
Scratched
25 to
100mm
Thru Paint
Smart
Repair

**Bumper
Front**
Scratched
Over
25mm Not
Thru Paint
Machine
Polish

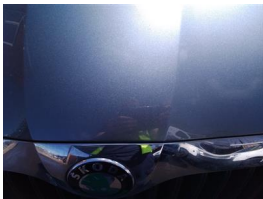


Bonnet
Chipped
1 To 5
Smart
Repair

Bonnet
Scratched
Over
25mm Not
Thru Paint
Machine
Polish

Damage Lines

Component	Condition	Severity	Repair
Wing osf	Chipped	1 To 5	Smart Repair
Wing osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osf	Chipped	Edge Chip	Smart Repair
Door osf	Chipped	1 To 5	Smart Repair
Door osr	Dented	Between 10mm + 30mm	Smart Repair
Door osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel osr	Dented	Between 10mm + 30mm	Smart Repair
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Tailgate	Dented	Over 30mm	Repair and Refinish
Badgedecal Rear	Missing	Replace	Replace
Qtr Panel nsr	Scratched	Over 25mm Thru Paint	Refinish
Door nsr	Scratched	Over 25mm Thru Paint	Refinish
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Chipped	1 To 5	Smart Repair
Door nsf	Dented	2 Or Less UpTo 10mm	Smart Repair
Wing nsf	Chipped	1 To 5	Smart Repair
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bonnet	Chipped	1 To 5	Smart Repair
Bonnet	Scratched	Over 25mm Not Thru Paint	Machine Polish

Vehicle Splat

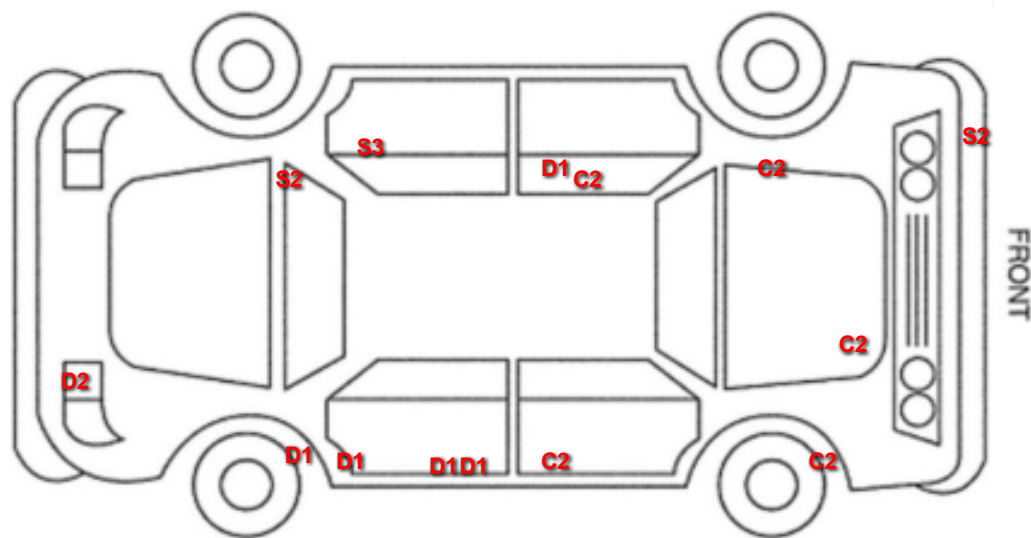

Splat Key

- S2**
Scratch/Paint defect 30-100mm
- S3**
Scratch/Paint defect 100mm +
- D1**
Dent/damage under 30mm
- D2**
Dent/damage 30-100mm
- C2**
Multiple Chips

Comments

£100 ADDITIONAL FEE.

low clutch,vibration when pulling away

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.