

Vehicle Inspection Report

Date Inspected: 04/04/2025 10:16

Reg: GP07VHR

VIN: WF05XXWPD57C59840



Appraised By: Eastbourne Car Auctions

Make FORD Model FOCUS CLIMAT Mileage 86,499	E - 1596cc	Body Type Fuel Type Transmission Gears	Hatchback Petrol Manual 5	Doors Colour Year of MFR Date First Reg	5 Silver 2007 29/06/2007	V5 Location No. Keys	2
yres & Wheels				Interior Condit	ion	Service History	
OSF Depth NSF Depth OSR Depth NSR Depth	3 mm 3 mm 4 mm 4 mm	Alloys Alloys That Need Refurb Tools Spare	Yes 4 No Space Saver	Carpets Upholstery Seats Parcel Shelf Odour	Average Average Average Yes No	Service No History Stamps	
Extras							
Metallic Paint Air Conditioning Stereo	Yes y Yes Radio	Central Locking Sun Roof Sat Nav	Yes No No	Interior Elec Windows Cruise	Cloth 2 No	Electric Seats Heated Seats Xenons	No No No

Damage Assessment

Keyless Entry

Phone Kit



Bonnet Chipped Multiple Chips

Towbar

Drv Airbag

No

Yes

Refinish



No

Yes

Number of Seats

Reversing Camera

Bumper Front Poor Previous Repair Paint Flake Refinish 5

No

Parking Sensors

EML

Wing osf

No

No

Scratched Over

25mm Not Thru Paint Machine

Polish

Door Mirror Assy osf

Scratched



Wing osf Chipped 1 To 5

Smart Repair

Door osf

Scratched

25mm Not

Thru Paint

Machine

Polish

Over





Chipped UpTo 10mm Smart Repair

Door osf

Chipped

1 To 5

Smart

Repair

(Painted)

Over 25mm Not Thru Paint

Machine Polish

Roof

and and the

Poor Previous Repair Poor Paint

Refinish

Qtr Panel osr

Scratched

25mm Not Thru Paint

Machine Polish

Over



D Post os Poor Previous Repair Poor Paint

Refinish



Door osr Scratched Over 25mm Thru Paint Refinish





With Paint Damage

Repair and Refinish



- Dented
- With Paint Damage

Repair and Refinish



Bumper Rear Scratched Over 100mm Thru Paint

Refinish

Door nsr

Dented

Damage

Repair

Refinish

and



Boot Lid Poor Previous Repair Poor Paint

Refinish





Dented With Paint Damage Repair and Refinish



With Paint





Door Mirror Assy nsf Broken Needs

Replaced

Replace

Door nsr

Damage Lines

Component
Bonnet
Bumper Front
Wing osf
Wing osf
Screen Front
Door Mirror Assy osf
Door osf
Door osf
Roof
D Post os
Door osr
Qtr Panel osr
Bumper Rear
Boot Lid
Qtr Panel nsr
Door nsr
Door nsr
Wing nsf
Door Mirror Assy nsf

Condition Poor Previous Repair Scratched Scratched (Painted) Scratched Poor Previous Repair

Chipped

Chipped

Chipped

Chipped

Scratched

Scratched

Scratched

Dented

Dented

Dented

Dented

Broken

Poor Previous Repair


Poor Previous Repair

Severity

Multiple Chips Paint Flake Over 25mm Not Thru Paint 1 To 5 UpTo 10mm Over 25mm Not Thru Paint Over 25mm Not Thru Paint 1 To 5 Poor Paint Poor Paint Over 25mm Thru Paint Over 25mm Not Thru Paint Over 100mm Thru Paint Poor Paint With Paint Damage With Paint Damage With Paint Damage With Paint Damage Replace

Repair

Refinish Refinish Machine Polish Smart Repair Smart Repair Machine Polish Machine Polish Smart Repair Refinish Refinish Refinish Machine Polish Refinish Refinish Repair and Refinish Repair and Refinish Repair and Refinish Repair and Refinish Replace

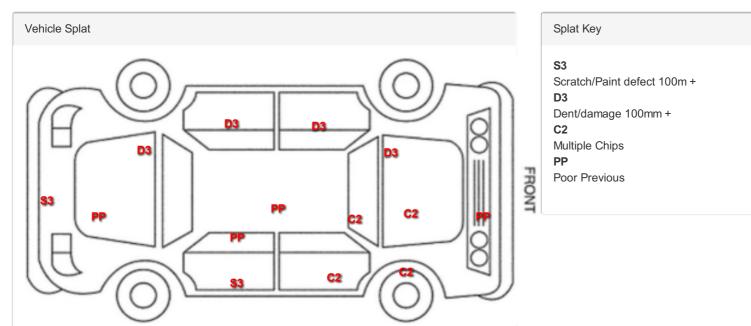

Comments

water leak in boot

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.