

Vehicle Inspection Report

Date Inspected: 08/04/2025 11:15

Reg: NJ60NCO

VIN: WF0JXXWPJJAM48579

NAMA Grading



Grade

5

Appraised By: Eastbourne Car Auctions

General Details

Make	FORD	Body Type	Hatchback	Doors	5
Model	FIESTA ZETEC - 1242cc	Fuel Type	Petrol	Colour	Red
Mileage	117483 miles	Transmission	Manual	Year of MFR	2010
		Gears	5	Date First Reg	23/09/2010

Miscellaneous

V5 Location	
No. Keys	2

Tyres & Wheels

OSF Depth	2 mm	Alloys	Yes
NSF Depth	3 mm	Alloys That Need Refurb	4
OSR Depth	2 mm	Tools	No
NSR Depth	4 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	Yes
Odour	No


Service History

Service No	
History	
Stamps	

Extras

Metallic Paint	No	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	2	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	No	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	5	Parking Sensors	No
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	No	EML	No

Damage Assessment

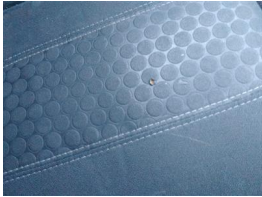

Seat Back Cover nsf
Holed
UpTo 3mm
Smart Repair



Wing osf
Rusted
Over 5mm
Refinish



Door Mirror Assy osf
Broken
Needs Replaced
Replace



Door osf
Dented
With Paint Damage
Repair and Refinish



Door osr
Dented
With Paint Damage
Repair and Refinish



Qtr Panel osr
Rusted
Over 5mm
Refinish



Sill os
Rusted
Over 5mm
Refinish



Bumper Rear
Scratched
25 to 100mm Thru Paint
Smart Repair

Tailgate
Scratched
Over 25mm Not Thru Paint
Machine Polish



Qtr Panel nsr
Rusted
Over 5mm
Refinish



Sill ns
Rusted
Over 5mm
Refinish

Door nsr
Scratched
Over 25mm Not Thru Paint
Machine Polish



Door nsf
Chipped
1 To 5
Smart Repair

Door nsf
Scratched
Over 25mm Not Thru Paint
Machine Polish



Door Mirror Assy nsf
Scratched (Painted)
Over 25mm Thru Paint
Smart Repair



Wing nsf
Chipped
1 To 5
Smart Repair

Wing nsf
Scratched
Over 25mm Not Thru Paint
Machine Polish

Bumper Front
Scratched
Over 25mm Not Thru Paint
Machine Polish

Bumper Front
Chipped
Multiple Chips
Smart Repair



Bonnet
Chipped
1 To 5
Smart Repair



Bonnet
Dented
2 Or Less UpTo 10mm
Smart Repair

Screen Front
Chipped



Roof

Chipped

1 To 5

Smart Repair

UpTo 10mm

Smart Repair



Seat Back Cover osf

Holed

Over 3mm

Replace



Seat Base Cover osf


Torn

Over 3mm

Replace

Damage Lines			
Component	Condition	Severity	Repair
Seat Back Cover nsf	Holed	UpTo 3mm	Smart Repair
Wing osf	Rusted	Over 5mm	Refinish
Door Mirror Assy osf	Broken	Replace	Replace
Door osf	Dented	With Paint Damage	Repair and Refinish
Door osr	Dented	With Paint Damage	Repair and Refinish
Qtr Panel osr	Rusted	Over 5mm	Refinish
Sill os	Rusted	Over 5mm	Refinish
Bumper Rear	Scratched	25 to 100mm Thru Paint	Smart Repair
Tailgate	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel nsr	Rusted	Over 5mm	Refinish
Sill ns	Rusted	Over 5mm	Refinish
Door nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Chipped	1 To 5	Smart Repair
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door Mirror Assy nsf	Scratched (Painted)	Over 25mm Thru Paint	Smart Repair
Wing nsf	Chipped	1 To 5	Smart Repair
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Front	Chipped	Multiple Chips	Smart Repair
Bonnet	Chipped	1 To 5	Smart Repair
Bonnet	Dented	2 Or Less UpTo 10mm	Smart Repair
Roof	Chipped	1 To 5	Smart Repair
Screen Front	Chipped	UpTo 10mm	Smart Repair
Seat Back Cover osf	Holed	Over 3mm	Replace
Seat Base Cover osf	Torn	Over 3mm	Replace

Vehicle Splat

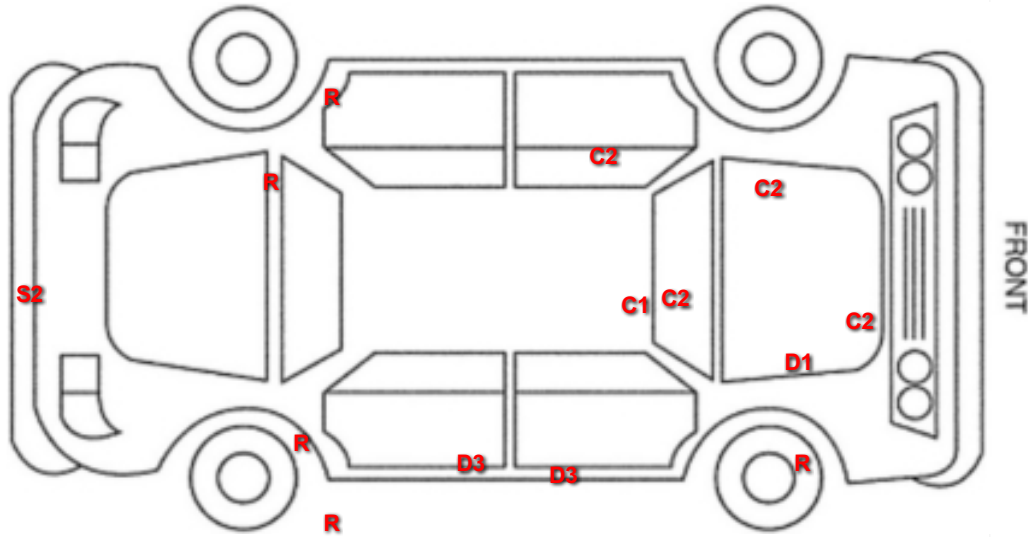

Splat Key

- S2**
Scratch/Paint defect 30-100mm
- D1**
Dent/damage under 30mm
- D3**
Dent/damage 100mm +
- C1**
Single Chip
- C2**
Multiple Chips
- R**
Rust

Comments

£65 ADDITIONAL FEE

exhaust blowing

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.