

Vehicle Inspection Report

Date Inspected: 14/04/2025 17:22

Reg: WN63NBE

VIN: VVWZZZAUZEW143076

NAMA Grading



Grade

4

Appraised By: Eastbourne Car Auctions

General Details

Make	VOLKSWAGEN	Body Type	Hatchback	Doors	5
Model	GOLF SE BLUEMOTION TECH T - 1598cc	Fuel Type	Diesel	Colour	Red
		Transmission	Manual	Year of MFR	2013
Mileage	120818 miles	Gears	5	Date First Reg	31/10/2013

Miscellaneous

V5 Location	
No. Keys	2

Tyres & Wheels

OSF Depth	4 mm	Alloys	Yes
NSF Depth	4 mm	Alloys That Need Refurb	4
OSR Depth	5 mm	Tools	Yes
NSR Depth	6 mm	Spare	Space Saver

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	Yes
Odour	No
Comments	SEATS HEAVILY STAINED

Service History

Service No	
History	
Stamps	

Extras

Metallic Paint	No	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	Yes	Xenons	No
Keyless Entry	No	Towbar	Yes	Number of Seats	5	Parking Sensors	Front & Rear
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	No	EML	Yes




Wing osf
Chipped
1 To 5
Smart
Repair

Door Mirror Assy osf
Scratched
(Painted)
UpTo
25mm Not
Thru Paint
Machine
Polish



Door osf
Chipped
1 To 5
Smart
Repair

Door osf
Chipped
Edge Chip
Smart
Repair

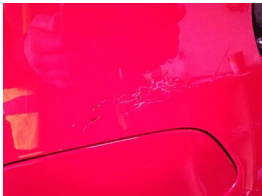

Qtr Panel osr
Scratched
Over
25mm
Thru Paint
Refinish



Bumper Rear
Scratched
Over
100mm
Thru Paint
Refinish



Door nsr
Chipped
1 To 5
Smart
Repair



Door nsf
Chipped
1 To 5
Smart
Repair



Door Mirror Assy nsf
Scratched
(Painted)
Over
25mm
Thru Paint
Smart
Repair



Headlamp ns
Broken
Needs
Replaced
Replace



Bumper Front
Scratched
25 to
100mm
Thru Paint
Smart
Repair



Bumper Front
Chipped
Multiple
Chips
Smart
Repair



Bonnet
Chipped
Multiple
Chips
Refinish

Screen Front
Chipped
UpTo
10mm
Smart
Repair



Roof
Dented
Over
30mm
Repair
and
Refinish

Damage Lines			
Component	Condition	Severity	Repair
Wing osf	Chipped	1 To 5	Smart Repair
Door Mirror Assy osf	Scratched (Painted)	UpTo 25mm Not Thru Paint	Machine Polish
Door osf	Chipped	1 To 5	Smart Repair
Door osf	Chipped	Edge Chip	Smart Repair
Qtr Panel osr	Scratched	Over 25mm Thru Paint	Refinish
Bumper Rear	Scratched	Over 100mm Thru Paint	Refinish
Door nsr	Chipped	1 To 5	Smart Repair
Door nsf	Chipped	1 To 5	Smart Repair
Door Mirror Assy nsf	Scratched (Painted)	Over 25mm Thru Paint	Smart Repair
Headlamp ns	Broken	Replace	Replace
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Bumper Front	Chipped	Multiple Chips	Smart Repair
Bonnet	Chipped	Multiple Chips	Refinish
Screen Front	Chipped	UpTo 10mm	Smart Repair
Roof	Dented	Over 30mm	Repair and Refinish

Vehicle Splat

The diagram shows a top-down view of a vehicle. The labels are as follows:

- S3**: Located on the left side of the vehicle.
- S2**: Located on the bottom left and bottom right of the vehicle.
- C2**: Located on the front, rear, and right side of the vehicle.
- D3**: Located on the front of the vehicle.
- X**: Located on the right side of the vehicle.

Splat Key

S2
Scratch/Paint defect 30-100mm

S3
Scratch/Paint defect 100m +

D3
Dent/damage 100mm +

C2
Multiple Chips

X
Req Replacement

Comments

£100 ADDITIONAL FEE

eml light on,airbag light is on,dual controls fitted

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.