

Vehicle Inspection Report

Date Inspected: 24/04/2025 17:25

Reg: LC170GA

VIN: 6FPPXXMJ2PHM54202



Appraised By: Eastbourne Car Auctions

General Details							Miscella	aneous
Make FORD Model RANGER TDCI - 219 Mileage 114178 m		Fuel Type Transmission Gears	Die Mai 6		4 Silver 2017 30/05/2	2017	V5 Loc No. Ke	
Tyres & Wheels				Interior Cond	dition		Service	History
OSF Depth NSF Depth OSR Depth NSR Depth	6 mm 6 mm 7 mm 7 mm	Alloys Alloys That Need Refurb Tools Spare	Ye 3 No Sp	Carpets Upholstery Seats Parcel She Odour	Aver	age	Serv Histo Starr	-
Extras								
Metallic Paint Air Conditioning Stereo Keyless Entry Phone Kit	Yes Yes Radio No Yes	Central Locking Sun Roof Sat Nav Towbar Drv Airbag	No No Yes	nterior Elec Windows Cruise lumber of Seats Reversing Camera	Leather 4 Yes 5 Yes	Electric Se Heated Se Xenons Parking Se EML	ats	Yes Yes No Front & Rear No

Wing osf

Scratched

Over 25mm Not Thru Paint

Machine Polish

Qtr Panel

Scratched

25mm Not

Thru Paint

Machine Polish

nsr

Over



Door osr

Scratched

UpTo 25mm Thru Paint

Smart Repair

Door nsr

Scratched Over

25mm Not

Thru Paint Machine Polish



Qtr Panel osr

Scratched

Over 25mm Not Thru Paint

Machine Polish

Door nsf

Chipped

Edge Chip Smart

Repair

Bonnet







Wing nsf Dented

Between 10mm + 30mm Smart

Repair

Bonnet Dented

2 Or Less UpTo 10mm

Smart Repair

osf Torn



Over 3mm Replace






Bumper Front Scratched Over

100mm

Thru Paint Refinish

Screen Front Chipped 10mm Repair



Chipped 1 To 5 Smart Repair



Roof UpTo 5mm Refinish

Rusted

UpTo Smart Damage Lines

Component

-
Wing osf
Door osr
Qtr Panel osr
Qtr Panel nsr
Door nsr
Door nsf
Wing nsf
Bumper Front
Bonnet
Bonnet
Screen Front
Roof
Seat Base Cover osf

Severity

Condition

Scratched

Scratched

Scratched

Scratched

Scratched

Chipped

Dented

Scratched

Chipped

Dented


Chipped

Rusted Torn

Over 25mm Not Thru Paint
UpTo 25mm Thru Paint
Over 25mm Not Thru Paint
Over 25mm Not Thru Paint
Over 25mm Not Thru Paint
Edge Chip
Between 10mm + 30mm
Over 100mm Thru Paint
1 To 5
2 Or Less UpTo 10mm
UpTo 10mm
UpTo 5mm
Over 3mm

Repair

Machine Polish Smart Repair Machine Polish Machine Polish Machine Polish Smart Repair Smart Repair Smart Repair Smart Repair Smart Repair Refinish Replace

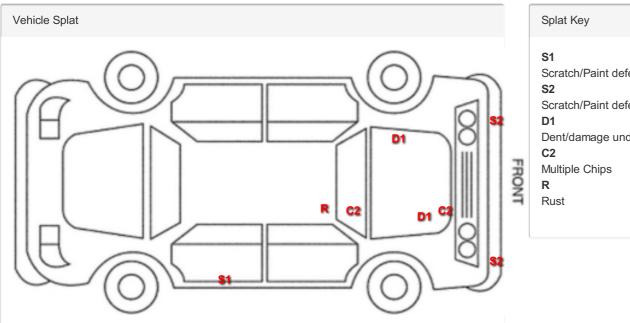

Scratch/Paint defect to 30mm
52
Scratch/Paint defect 30-100mm
01
Dent/damage under 30mm
C2
Multiple Chips
2

Comments

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.