

Vehicle Inspection Report

Date Inspected: 17/04/2025 08:21

Reg: WF68VWN

VIN: W0VZRHNS4KS020898

NAMA Grading



Grade

2

Appraised By: Eastbourne Car Auctions

General Details

Make	VAUXHALL	Body Type	Hatchback	Doors	5
Model	GRANDLAND X SPORT NAV TUR - 1199cc	Fuel Type	Petrol	Colour	Grey
		Transmission	Manual	Year of MFR	2018
Mileage	50,276 miles	Gears	6	Date First Reg	30/10/2018

Miscellaneous

V5 Location	Here
MOT Location	Here
MOT Expiry	14/08/2025
No. Keys	2

Tyres & Wheels

OSF Depth	5 mm	Alloys	Yes
NSF Depth	4 mm	Alloys That Need Refurb	4
OSR Depth	5 mm	Tools	No
NSR Depth	5 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	Yes
Odour	No

Service History

Service History
Stamps

Extras

Metallic Paint	Yes	Central Locking	Yes	Interior	Half Leather	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	Built In	Cruise	Yes	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	5	Parking Sensors	Front & Rear
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	No	EML	Yes

Damage Assessment



Bonnet

Chipped
1 To 5
Smart Repair

Bumper Front

Scratched
Over 25mm Not Thru Paint
Machine Polish

Wing nsf

Scratched
Over



Bumper Front

Scratched
25 to 100mm Thru Paint
Smart Repair



Bumper Front Moulding
Broken
Needs Replaced
Replace

25mm Not Thru Paint
Machine Polish



Screen Front
Chipped
UpTo 10mm
Smart Repair



Door nsf
Chipped
1 To 5
Smart Repair

Door nsr
Scratched
Over 25mm Not Thru Paint
Machine Polish



Door nsr
Chipped
1 To 5
Smart Repair



Qtr Panel nsr
Dented
2 Or Less UpTo 10mm
Smart Repair

Bumper Rear
Scratched
Over 25mm Not Thru Paint
Machine Polish



Bumper Rear
Chipped
Multiple Chips
Smart Repair



Qtr Panel Arch Extension os
Broken
Needs Replaced
Replace

Qtr Panel osr
Scratched
Over 25mm Not Thru Paint
Machine Polish




Door osr
Chipped
1 To 5
Smart Repair



Door osf
Chipped
1 To 5
Smart Repair

Damage Lines			
Component	Condition	Severity	Repair
Bonnet	Chipped	1 To 5	Smart Repair
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Bumper Front Moulding	Broken	Replace	Replace
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Screen Front	Chipped	UpTo 10mm	Smart Repair
Door nsf	Chipped	1 To 5	Smart Repair
Door nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsr	Chipped	1 To 5	Smart Repair
Qtr Panel nsr	Dented	2 Or Less UpTo 10mm	Smart Repair
Bumper Rear	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Rear	Chipped	Multiple Chips	Smart Repair
Qtr Panel Arch Extension os	Broken	Replace	Replace
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osr	Chipped	1 To 5	Smart Repair
Door osf	Chipped	1 To 5	Smart Repair

Vehicle Splat

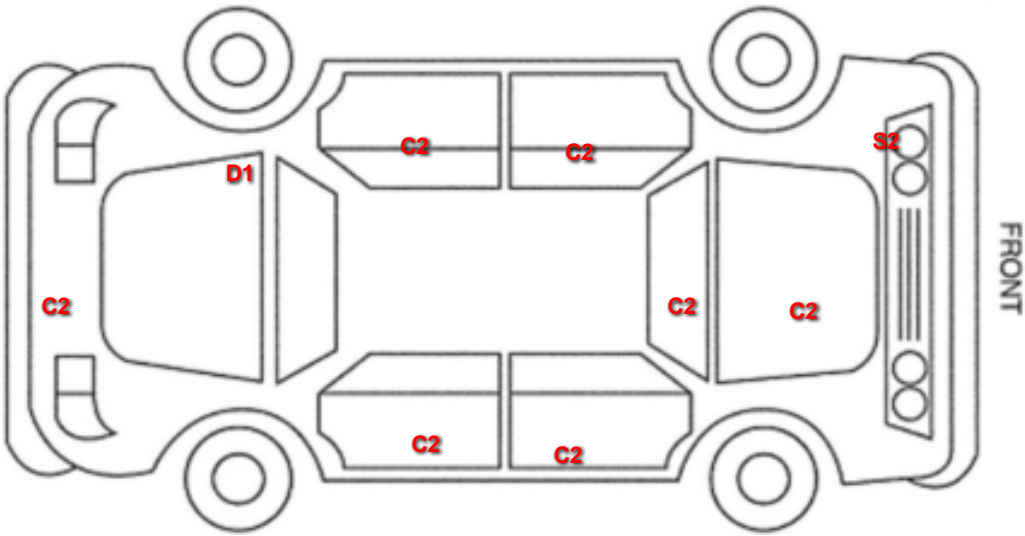

Splat Key

S2
Scratch/Paint defect 30-100mm

D1
Dent/damage under 30mm

C2
Multiple Chips

Comments

£65 ADDITIONAL FEE. Last Service - 04/08/2023 at 31,300 miles (5 services (4 main dealer))

engine fault on dash while starting and eml on

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.