

Vehicle Inspection Report

Date Inspected: 29/04/2025 17:06

Reg: GV18OWR
VIN: JSAAZC13S00200881

NAMA Grading



Grade
5

Appraised By: Eastbourne Car Auctions

General Details

Make	SUZUKI	Body Type	Hatchback	Doors	5
Model	SWIFT SZ5 BOOSTERJET AUTO - 998cc	Fuel Type	Petrol	Colour	Black
		Transmission	Auto	Year of MFR	2018
				Date First Reg	07/07/2018
Mileage	82,705 miles				

Miscellaneous

V5 Location Here
No. Keys 2

Tyres & Wheels

OSF Depth	2 mm	Alloys	Yes
NSF Depth	3 mm	Alloys That Need Refurb	4
OSR Depth	2 mm	Tools	No
NSR Depth	3 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	No
Odour	No

Service History

Service History
Yes
Stamps

Extras

Metallic Paint	No	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	Built In	Cruise	Yes	Xenons	No
Keyless Entry	Yes	Towbar	No	Number of Seats	5	Parking Sensors	No
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	Yes	EML	No

Damage Assessment



Bumper Rear
Cracked
Over 25mm
Replace

Bumper Rear
Scratched
Over 25mm Not Thru Paint
Machine Polish

Boot Lid
Chipped
1 To 5
Smart Repair



**Qtr Panel
nsr**

Chipped

Multiple
Chips

Refinish



Door nsr

Dented

With Paint
Damage

Repair
and
Refinish



Door nsf

Chipped

Multiple
Chips

Refinish



**Door
Mirror
Assy nsf**

Broken

Needs
Replaced

Replace



Wing nsf

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



Wing nsf

Scratched

UpTo
25mm
Thru Paint

Smart
Repair




**Screen
Front**

Chipped

UpTo
10mm

Smart
Repair

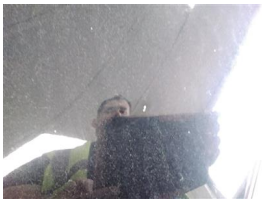

Bonnet

Chipped

Multiple
Chips

Refinish



**Bumper
Front**

Scratched

25 to
100mm
Thru Paint

Smart
Repair



Wing osf

Dented

Over
30mm

Repair
and
Refinish



Door osf

Dented

Over
30mm

Repair
and
Refinish



Door osr

Scratched

Over
25mm
Thru Paint

Refinish



**Qtr Panel
osr**

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



**Qtr Panel
osr**

Scratched

UpTo
25mm
Thru Paint

Smart
Repair

Roof

Scratched


Over
25mm Not
Thru Paint

Machine
Polish

Damage Lines

Component	Condition	Severity	Repair
Bumper Rear	Cracked	Over 25mm	Replace
Bumper Rear	Scratched	Over 25mm Not Thru Paint	Machine Polish
Boot Lid	Chipped	1 To 5	Smart Repair
Qtr Panel nsr	Chipped	Multiple Chips	Refinish
Door nsr	Dented	With Paint Damage	Repair and Refinish
Door nsf	Chipped	Multiple Chips	Refinish
Door Mirror Assy nsf	Broken	Replace	Replace
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing nsf	Scratched	UpTo 25mm Thru Paint	Smart Repair
Screen Front	Chipped	UpTo 10mm	Smart Repair
Bonnet	Chipped	Multiple Chips	Refinish
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing osf	Dented	Over 30mm	Repair and Refinish
Door osf	Dented	Over 30mm	Repair and Refinish
Door osr	Scratched	Over 25mm Thru Paint	Refinish
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel osr	Scratched	UpTo 25mm Thru Paint	Smart Repair
Roof	Scratched	Over 25mm Not Thru Paint	Machine Polish

Vehicle Splat

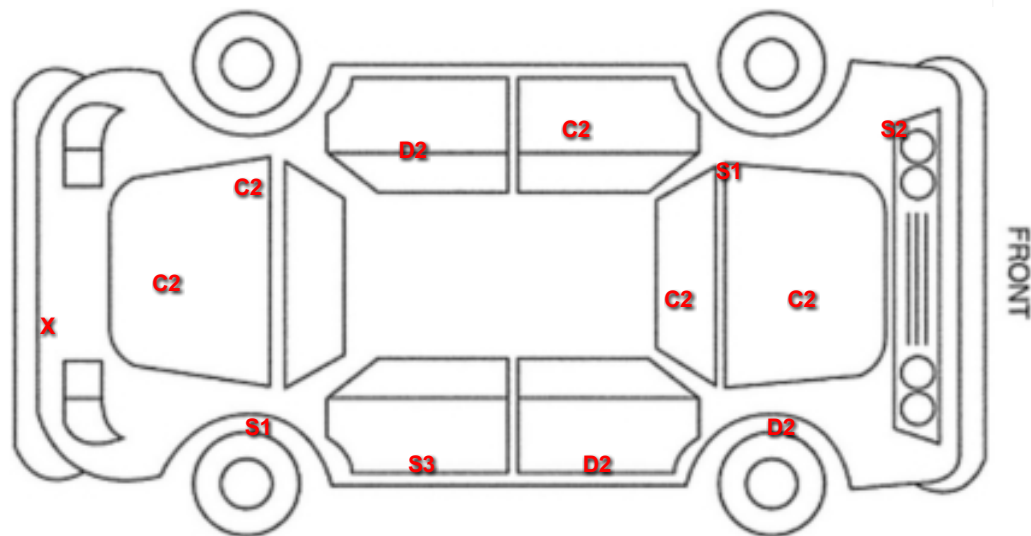

Splat Key

- S1**
Scratch/Paint defect to 30mm
- S2**
Scratch/Paint defect 30-100mm
- S3**
Scratch/Paint defect 100m +
- D2**
Dent/damage 30-100mm
- C2**
Multiple Chips
- X**
Req Replacement

Comments

Last Service - 29/03/2022 at 20,125 miles (4 MAIN DEALER SERVICES)

osr light broken and rear wiper broken. noisy engine and interior trims missing

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.