

Vehicle Inspection Report

Date Inspected: 29/04/2025 16:54

Reg: VN66VVM

VIN: SJNFEAJ11U1852674

NAMA Grading



Grade

4

Appraised By: Eastbourne Car Auctions

General Details

Make	NISSAN	Body Type	Hatchback	Doors	5
Model	QASHQAI N-CONNECTA DIG-T - 1197cc	Fuel Type	Petrol	Colour	Blue
Mileage	92,038 miles	Transmission	Manual	Year of MFR	2016
		Gears	6	Date First Reg	31/10/2016

Miscellaneous

V5 Location	Here
MOT Location	Here
MOT Expiry	10/11/2025
No. Keys	2

Tyres & Wheels

OSF Depth	2 mm	Alloys	Yes
NSF Depth	3 mm	Alloys That Need Refurb	4
OSR Depth	4 mm	Tools Spare	No
NSR Depth	4 mm		No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	Yes
Odour	No

Service History

Service History Stamps
Yes

Extras

Metallic Paint	Yes	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	Yes	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	Built In	Cruise	Yes	Xenons	No
Keyless Entry	Yes	Towbar	No	Number of Seats	5	Parking Sensors	Front & Rear
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	Yes	EML	No

Damage Assessment



Bumper Front

Scratched
25 to 100mm Thru Paint
Smart Repair

Wing osf

Scratched
Over

Bumper Front

Scratched
Over 25mm Not Thru Paint
Machine Polish




Bonnet

Chipped
1 To 5
Smart Repair

25mm Not
Thru Paint

Machine
Polish

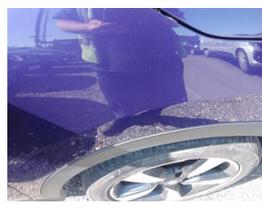

Wing osf

Chipped

1 To 5

Smart
Repair



**Screen
Front**

Chipped

UpTo
10mm

Smart
Repair



Door osf

Scratched

Over
25mm
Thru Paint

Refinish



Door osr

Chipped

Multiple
Chips

Refinish

**Qtr Panel
osr**

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



**Qtr Panel
osr**

Chipped

1 To 5

Smart
Repair



**Bumper
Rear**

Scratched

Over
100mm
Thru Paint

Refinish



Boot Lid

Dented

Over
30mm

Repair
and
Refinish

**Qtr Panel
nsr**

Scratched

Over
25mm Not
Thru Paint

Machine
Polish

Door nsr

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



Door nsr

Chipped

1 To 5

Smart
Repair



Door nsf

Chipped

Multiple
Chips

Refinish

Wing nsf

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



Wing nsf

Chipped


1 To 5

Smart
Repair

Damage Lines

Component	Condition	Severity	Repair
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bonnet	Chipped	1 To 5	Smart Repair
Wing osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing osf	Chipped	1 To 5	Smart Repair
Screen Front	Chipped	UpTo 10mm	Smart Repair
Door osf	Scratched	Over 25mm Thru Paint	Refinish
Door osr	Chipped	Multiple Chips	Refinish
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel osr	Chipped	1 To 5	Smart Repair
Bumper Rear	Scratched	Over 100mm Thru Paint	Refinish
Boot Lid	Dented	Over 30mm	Repair and Refinish
Qtr Panel nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsr	Chipped	1 To 5	Smart Repair
Door nsf	Chipped	Multiple Chips	Refinish
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing nsf	Chipped	1 To 5	Smart Repair

Vehicle Splat

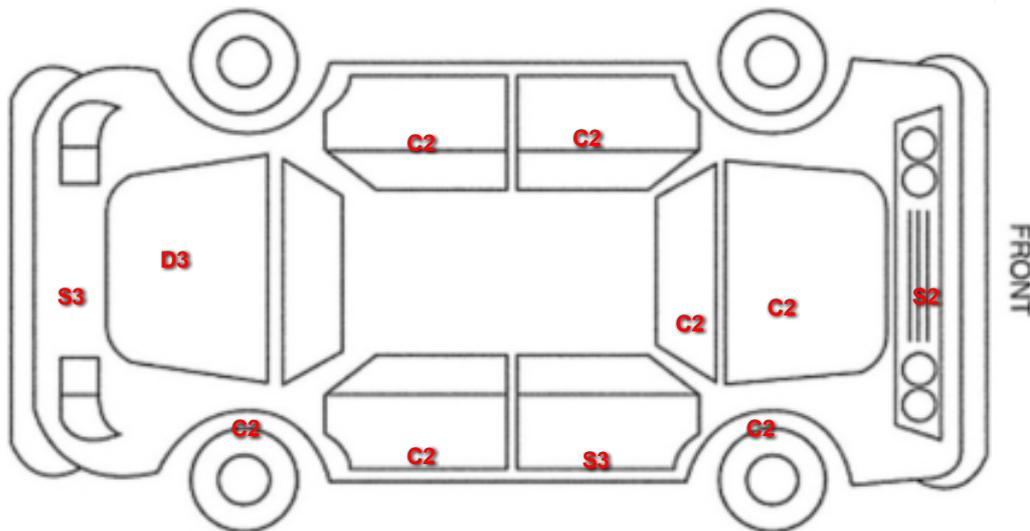

Splat Key

- S2**
Scratch/Paint defect 30-100mm
- S3**
Scratch/Paint defect 100m +
- D3**
Dent/damage 100mm +
- C2**
Multiple Chips

Comments

£100 ADDITIONAL FEE Last Service - 07/11/2024 at 87,111 miles (4 SERVICES (1 MAIN DEALER))

rear bumper misaligned and slight noise from engine bay

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.