

Vehicle Inspection Report

Date Inspected: 18/03/2025 15:07

Reg: GU22ZFB

VIN: WAUZZZGA5NA035177

NAMA Grading



Grade

2

Appraised By: Eastbourne Car Auctions

General Details

<b>Make</b>	AUDI	<b>Body Type</b>	Estate	<b>Doors</b>	5
<b>Model</b>	Q2 TECHNIK 30 TFSI - 999cc	<b>Fuel Type</b>	Petrol	<b>Colour</b>	Black
<b>Mileage</b>	31,186 miles	<b>Transmission</b>	Manual	<b>Year of MFR</b>	2022
		<b>Gears</b>	6	<b>Date First Reg</b>	06/04/2022

Miscellaneous

<b>V5 Location</b>	
<b>No. Keys</b>	2

Tyres & Wheels

<b>OSF Depth</b>	5 mm	<b>Alloys</b>	Yes
<b>NSF Depth</b>	5 mm	<b>Alloys That Need Refurb</b>	4
<b>OSR Depth</b>	5 mm	<b>Tools</b>	No
<b>NSR Depth</b>	5 mm	<b>Spare</b>	No Spare

Interior Condition

<b>Carpets</b>	Good
<b>Upholstery</b>	Good
<b>Seats</b>	Average
<b>Parcel Shelf</b>	Yes
<b>Odour</b>	No


Service History

**Service No History Stamps**

Extras

<b>Metallic Paint</b>	No	<b>Central Locking</b>	Yes	<b>Interior</b>	Cloth	<b>Electric Seats</b>	No
<b>Air Conditioning</b>	Yes	<b>Sun Roof</b>	No	<b>Elec Windows</b>	4	<b>Heated Seats</b>	No
<b>Stereo</b>	Radio	<b>Sat Nav</b>	No	<b>Cruise</b>	Yes	<b>Xenons</b>	No
<b>Keyless Entry</b>	No	<b>Towbar</b>	No	<b>Number of Seats</b>	5	<b>Parking Sensors</b>	Front & Rear
<b>Phone Kit</b>	Yes	<b>Drv Airbag</b>	Yes	<b>Reversing Camera</b>	No	<b>EML</b>	No

Damage Assessment

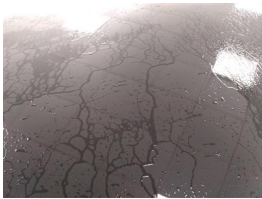

**Bonnet**

Chipped  
1 To 5  
Smart Repair

**Bumper Front**

Scratched  
Over 25mm Not Thru Paint  
Machine Polish

**Wing nsf**






Scratched  
Over 25mm Not Thru Paint  
Machine Polish

**Door nsf**

Scratched  
Over 25mm Not

**Door Mirror Assy nsf**

Scratched

	Thru Paint		<b>Door nsf</b>	
	Machine Polish		Chipped 1 To 5 Smart Repair	
	<b>Door nsr</b>		<b>Qtr Panel nsr</b>	
	Dented		Scratched	
	With Paint Damage		Over 25mm Not Thru Paint	
	Repair and Refinish		Machine Polish	
	<b>Bumper Rear</b>		<b>Bumper Rear</b>	<b>Qtr Panel osr</b>
	Scratched		Scratched	Scratched
	Over 25mm Not Thru Paint		25 to 100mm Thru Paint	Over 25mm Not Thru Paint
	Machine Polish		Smart Repair	Machine Polish
	<b>Door osr</b>		<b>Door osf</b>	<b>Wing osf</b>
	Scratched		Dented	Scratched
	Over 25mm Not Thru Paint		Between 10mm + 30mm	Over 25mm Not Thru Paint
	Machine Polish		Smart Repair	Machine Polish
	<b>Door nsf</b>			
	Dented			
	Between 10mm + 30mm			
	Smart Repair			

Damage Lines			
Component	Condition	Severity	Repair
Bonnet	Chipped	1 To 5	Smart Repair
Bumper Front	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Chipped	1 To 5	Smart Repair
Door Mirror Assy nsf	Scratched (Painted)	Over 25mm Not Thru Paint	Machine Polish
Door nsr	Dented	With Paint Damage	Repair and Refinish
Qtr Panel nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel nsr	Scratched	UpTo 25mm Thru Paint	Smart Repair
Bumper Rear	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Rear	Scratched	25 to 100mm Thru Paint	Smart Repair
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osf	Dented	Between 10mm + 30mm	Smart Repair
Wing osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Dented	Between 10mm + 30mm	Smart Repair

Vehicle Splat

Splat Key

**S1**  
Scratch/Paint defect to 30mm

**S2**  
Scratch/Paint defect 30-100mm

**D1**  
Dent/damage under 30mm

**D2**  
Dent/damage 30-100mm

**C2**  
Multiple Chips

Comments
<p>£65 ADDITIONAL FEE</p> <p><b>No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.</b></p>