

Vehicle Inspection Report

Date Inspected: 27/03/2025 12:58

Reg: SE09FOM

VIN: VF1CRCJ0H41628924

NAMA Grading



Grade

5

Appraised By: Eastbourne Car Auctions

General Details

Make	RENAULT	Body Type	Hatchback	Doors	3
Model	CLIO TOM TOM EDITION - 1149cc	Fuel Type	Petrol	Colour	Black
Mileage	97788 miles	Transmission	Manual	Year of MFR	2009
		Gears	5	Date First Reg	31/07/2009

Miscellaneous

V5 Location	
No. Keys	2

Tyres & Wheels

OSF Depth	4 mm	Alloys	Yes
NSF Depth	5 mm	Alloys That Need Refurb	4
OSR Depth	5 mm	Tools	No
NSR Depth	6 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	Yes
Odour	No

Service History

Service No
History
Stamps

Extras

Metallic Paint	Yes	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	2	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	No	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	5	Parking Sensors	No
Phone Kit	No	Drv Airbag	Yes	Reversing Camera	No	EML	No

Damage Assessment

Wing osf

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



Door osf

Chipped

Edge Chip

Smart
Repair

Door osf

Scratched

Over
25mm Not
Thru Paint

Machine
Polish



Door osf
Chipped
1 To 5
Smart
Repair



**Qtr Panel
osr**
Scratched
UpTo
25mm
Thru Paint
Smart
Repair



**Qtr Panel
osr**
Dented
2 Or Less
UpTo
10mm
Smart
Repair

**Qtr Panel
osr**
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



**Bumper
Rear**
Poor
Previous
Repair
Paint
Flake
Refinish



Tailgate
Dented
Over
30mm
Repair
and
Refinish



**Qtr Panel
nsr**
Dented
Over 30%
Of Panel
Replace




Door nsf
Dented
Over 30%
Of Panel
Replace

Wing nsf
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



**Bumper
Front**
Poor
Previous
Repair
Poor Paint
Refinish

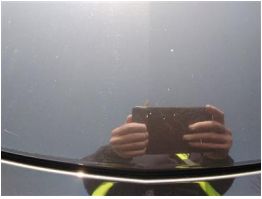

Bonnet
Chipped
1 To 5
Smart
Repair

Bonnet
Scratched
Over
25mm Not
Thru Paint
Machine
Polish



**Screen
Front**
Chipped
UpTo
10mm
Smart
Repair

Roof
Scratched
Over
25mm Not
Thru Paint
Machine
Polish

Damage Lines			
Component	Condition	Severity	Repair
Wing osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osf	Chipped	Edge Chip	Smart Repair
Door osf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door osf	Chipped	1 To 5	Smart Repair
Qtr Panel osr	Scratched	UpTo 25mm Thru Paint	Smart Repair
Qtr Panel osr	Dented	2 Or Less UpTo 10mm	Smart Repair
Qtr Panel osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Rear	Poor Previous Repair	Paint Flake	Refinish
Tailgate	Dented	Over 30mm	Repair and Refinish
Qtr Panel nsr	Dented	Over 30% Of Panel	Replace
Door nsf	Dented	Over 30% Of Panel	Replace
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Bumper Front	Poor Previous Repair	Poor Paint	Refinish
Bonnet	Chipped	1 To 5	Smart Repair
Bonnet	Scratched	Over 25mm Not Thru Paint	Machine Polish
Screen Front	Chipped	UpTo 10mm	Smart Repair
Roof	Scratched	Over 25mm Not Thru Paint	Machine Polish

Vehicle Splat

Splat Key

S1
Scratch/Paint defect to 30mm

D1
Dent/damage under 30mm

D3
Dent/damage 100mm +

C2
Multiple Chips

PP
Poor Previous

X
Req Replacement

Comments
<p>£65 ADDITIONAL FEE.</p> <p>No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.</p>