

Vehicle Inspection Report

Date Inspected: 23/01/2025 15:45

Reg: EY17WTP

VIN: W0LPD9E31H1084389

NAMA Grading



Grade

3

Appraised By: Eastbourne Car Auctions

General Details

Make	VAUXHALL	Body Type	MPV	Doors	5
Model	ZAFIRA TOURER SRI CDTI EC - 1598cc	Fuel Type	Diesel	Colour	Grey
Mileage	114195 miles	Transmission	Manual	Year of MFR	2017
		Gears	6	Date First Reg	14/06/2017

Miscellaneous

V5 Location	
No. Keys	2

Tyres & Wheels

OSF Depth	6 mm	Alloys	Yes
NSF Depth	6 mm	Alloys That Need Refurb	4
OSR Depth	5 mm	Tools	No
NSR Depth	6 mm	Spare	No Spare

Interior Condition

Carpets	Average
Upholstery	Average
Seats	Average
Parcel Shelf	No
Odour	No
Comments	SEATS AND CARPETS STAINED

Service History

Service No	
History	
Stamps	

Extras


Metallic Paint	Yes	Central Locking	Yes	Interior	Cloth	Electric Seats	No
Air Conditioning	Yes	Sun Roof	No	Elec Windows	4	Heated Seats	No
Stereo	Radio	Sat Nav	No	Cruise	Yes	Xenons	No
Keyless Entry	No	Towbar	No	Number of Seats	7	Parking Sensors	Front & Rear
Phone Kit	Yes	Drv Airbag	Yes	Reversing Camera	No	EML	Yes

Damage Assessment



Door osf
Dented
2 Or Less
UpTo
10mm

Smart
Repair

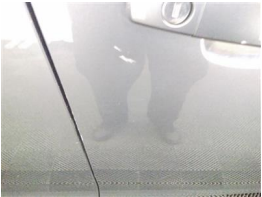

Door osf
Scratched

UpTo
25mm
Thru Paint






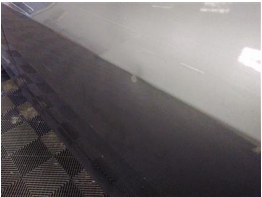






Smart
Repair



Door osf
Chipped
Edge Chip

Smart
Repair

Door osr
Scratched

	Over 25mm Not Thru Paint Machine Polish		Qtr Panel osr Chipped 1 To 5 Smart Repair		Bumper Rear Scratched Over 100mm Thru Paint Refinish
	Tailgate Dented 2 Or Less UpTo 10mm Smart Repair		Qtr Panel nsr Scratched Over 25mm Not Thru Paint Machine Polish		Qtr Panel nsr Dented 2 Or Less UpTo 10mm Smart Repair
	Door nsf Chipped Edge Chip Smart Repair		Door nsr Dented Between 10mm + 30mm Smart Repair		Door nsr Scratched Over 25mm Not Thru Paint Machine Polish
	Door nsf Scratched Over 25mm Not Thru Paint Machine Polish		Door nsf Chipped Edge Chip Smart Repair		Door Mirror Assy nsf Scratched (Painted) UpTo 25mm Thru Paint Smart Repair
	Wing nsf Scratched Over 25mm Not Thru Paint Machine Polish		Wing nsf Dented 2 Or Less UpTo 10mm Smart Repair		Bumper Front Cracked UpTo 25mm Repair and Refinish
	Bonnet Chipped 1 To 5 Smart Repair		Screen Front Chipped UpTo 10mm Smart Repair		B Post os Dented 2 Or Less UpTo 10mm Smart Repair



C Post os

Dented


Between 10mm + 30mm

Smart Repair

Damage Lines

Component	Condition	Severity	Repair
Door osf	Dented	2 Or Less UpTo 10mm	Smart Repair
Door osf	Scratched	UpTo 25mm Thru Paint	Smart Repair
Door osf	Chipped	Edge Chip	Smart Repair
Door osr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel osr	Chipped	1 To 5	Smart Repair
Bumper Rear	Scratched	Over 100mm Thru Paint	Refinish
Tailgate	Dented	2 Or Less UpTo 10mm	Smart Repair
Qtr Panel nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel nsr	Dented	2 Or Less UpTo 10mm	Smart Repair
Door nsf	Chipped	Edge Chip	Smart Repair
Door nsr	Dented	Between 10mm + 30mm	Smart Repair
Door nsr	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Door nsf	Chipped	Edge Chip	Smart Repair
Door Mirror Assy nsf	Scratched (Painted)	UpTo 25mm Thru Paint	Smart Repair
Wing nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing nsf	Dented	2 Or Less UpTo 10mm	Smart Repair
Bumper Front	Cracked	UpTo 25mm	Repair and Refinish
Bonnet	Chipped	1 To 5	Smart Repair
Screen Front	Chipped	UpTo 10mm	Smart Repair
B Post os	Dented	2 Or Less UpTo 10mm	Smart Repair
C Post os	Dented	Between 10mm + 30mm	Smart Repair

Vehicle Splat

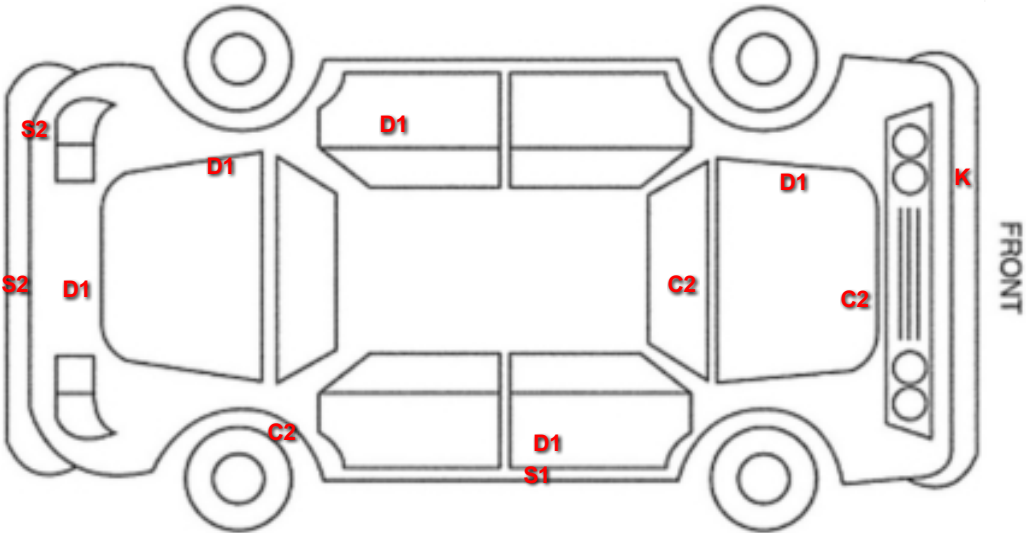

Splat Key

- S1 Scratch/Paint defect to 30mm
- S2 Scratch/Paint defect 30-100mm
- D1 Dent/damage under 30mm
- C2 Multiple Chips
- K Crack/Torn

Comments

eml light on

No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.