



VEHICLE INSPECTION REPORT

KO15NWU

Nissan Qashqai 1.6 dCi N-Tec 5dr Xtronic

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
3

Details

Reg. date	29/06/2015	Keys	1	CAP Clean	£5,625.00
Year	2015	Service history	Yes	CAP Average	£4,875.00
Mileage	67,818 Miles Warranted	Service documents	Service Book	CAP Below	£4,100.00
Fuel Type	Diesel	Number of stamps	9	Gearbox	CVT
Colour	RED	Last service date	17/03/2025	Gears	1
VIN	SJNFDAJ11U1421074	Last service miles	66,084	Doors	5
Body Style	Hatchback	MOT Due	29/09/2025		

Last Service: 17/03/2025 at 66084 miles. (9 services (1 main dealer)) Stop start fault

Tyres

NSF	BUDGET	3.0mm
NSR	BUDGET	5.0mm
OSF	BUDGET	3.0mm
OSR	BUDGET	5.0mm
Spare		


Features

- Bluetooth connection
- Park assist camera
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Cruise control
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Front parking sensor
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Navigation system
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking

Photos



Condition Check

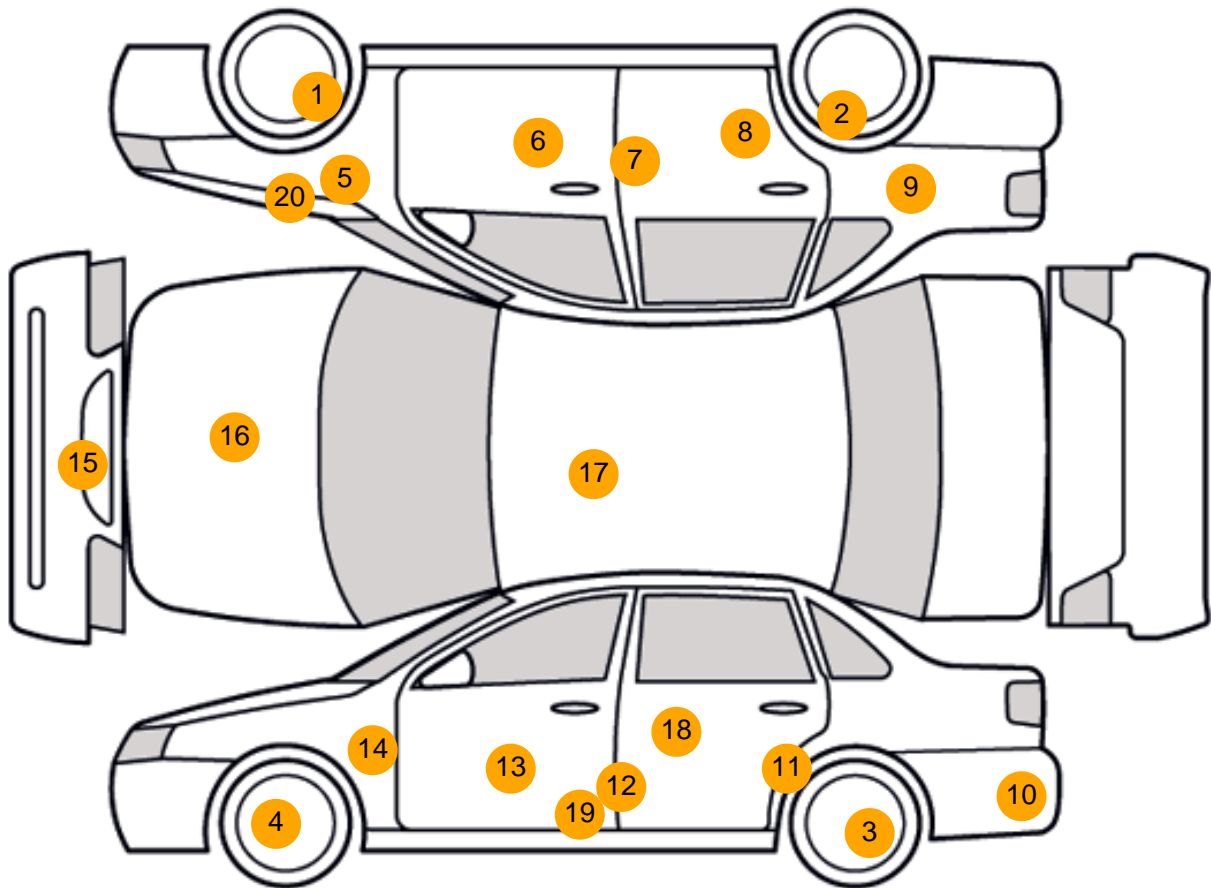

Damage Photos



1: Wheel osf
Scratched
Over 50mm



2: Wheel osr
Scratched
Up To 50mm



3: Wheel nsr
Scratched
Over 50mm



4: Wheel nsf
Scratched
Over 50mm



5: Wing osf
Chipped
1 To 5



6: Door osf
Chipped
1 To 5



7: Door osf
Chipped
Edge Chip



8: Door osr
Scratched
Over 25mm Not Thru Paint



9: Qtr Panel osr
Scratched
Over 25mm Not Thru Paint




10: Bumper Rear
Poor Previous Repair
Paint Flake



11: Door nsr
Chipped
Edge Chip



12: Door nsf
Chipped
Edge Chip

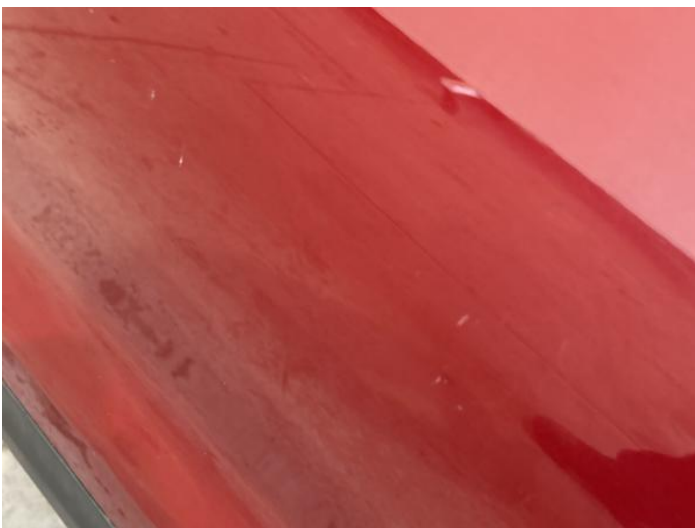


13: Door nsf
Chipped
1 To 5



14: Wing nsf
Scratched
Over 25mm Not Thru Paint



15: Bumper Front
Poor Previous Repair
Poor Paint

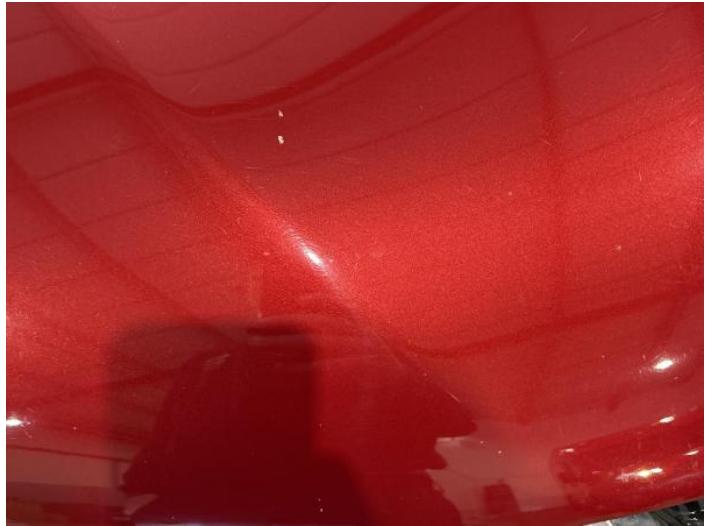


16: Bonnet
Chipped
1 To 5




17: Roof
Dented
Between 10mm + 30mm



18: Door nsr
Dented
2 Or Less UpTo 10mm

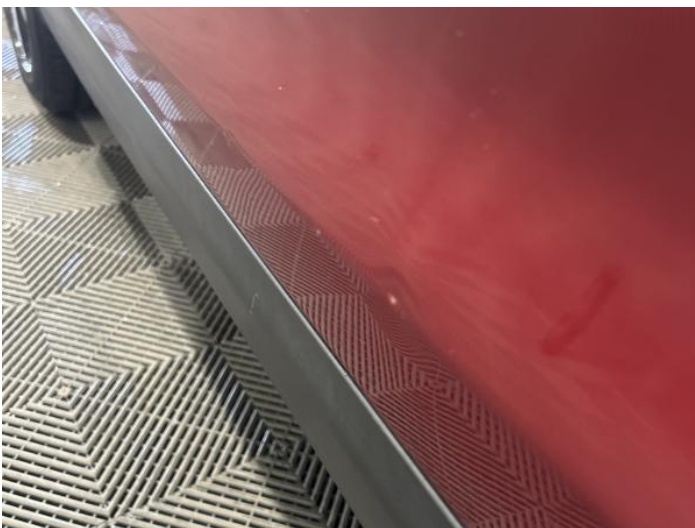

19: Door nsf
Dented
Between 10mm + 30mm

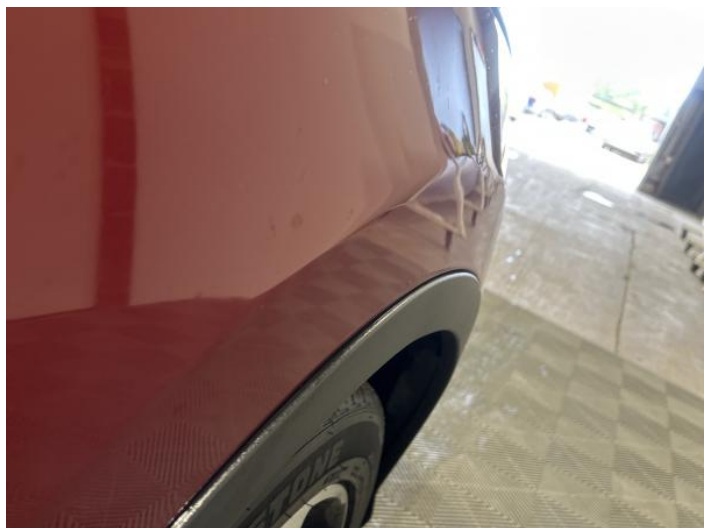

20: Wing osf
Dented
Over 2 UpTo 10mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK