



VEHICLE INSPECTION REPORT

LW17FWP

Vauxhall Insignia 1.5T Elite Nav 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	TBC

nama
GRADE
4

Details

Reg. date	15/06/2017	VIN	W0LZT8EB2J1016928	CAP Average	£6,050.00
Year	2017	Body Style	Estate	CAP Below	£5,125.00
Mileage	53,808 Miles Warranted	Keys	2	Gearbox	MANUAL
Fuel Type	Petrol	MOT Due	24/09/2025	Gears	6
Colour	GREEN	CAP Clean	£6,975.00		

£100 ADDITIONAL FEE.

Tyres		
NSF	BUDGET	2.0mm
NSR	BUDGET	3.0mm
OSF	BUDGET	3.0mm
OSR	HIFLY	4.0mm
Spare		

Features


- Bluetooth connection
- Rear parking sensor
- Digital radio
- Climate control
- Height adjustable drivers seat
- Metallic Paint
- Alloy wheels
- Cruise control
- Rear wiper
- Body coloured bumpers
- Front armrest
- Rear armrest
- Central locking
- Park assist camera
- Steering wheel mounted controls
- Electric door mirrors
- Front electric windows
- Rear electric windows
- Remote central locking
- PAS
- Audio remote control
- Air conditioning
- Front head restraints
- Rear headrests
- Leather seat trim

Photos





Condition Check

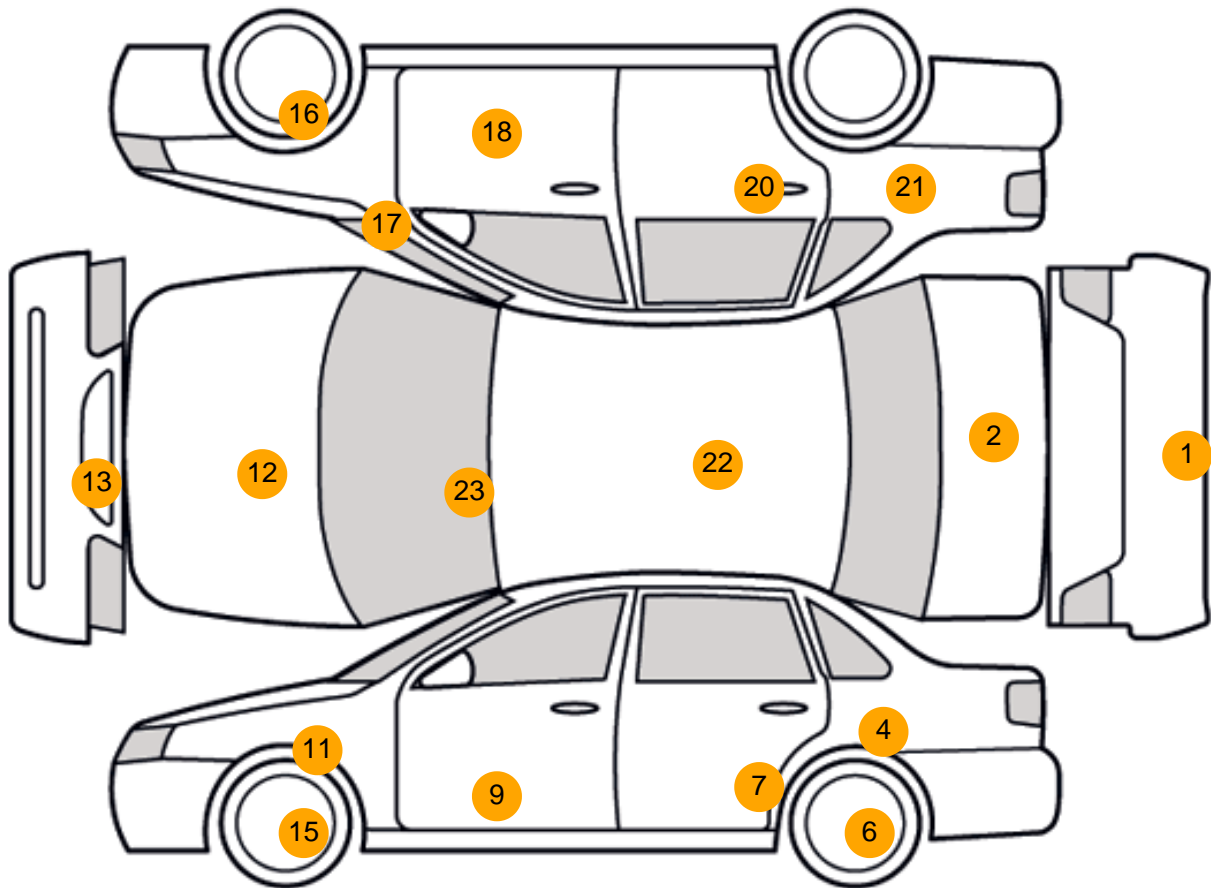

Damage Photos



1: Bumper Rear
Scratched
Over 100mm Thru Paint



2: Boot Lid
Dented
Between 10mm + 30mm

No Image

3: Boot Lid
Scratched
Over 25mm Not Thru Paint



4: Qtr Panel nsr
Dented
Over 2 UpTo 10mm

No Image

5: Qtr Panel nsr
Scratched
Over 25mm Not Thru Paint



6: Wheel nsr
Scratched
Over 50mm




7: Door nsr
Chipped
1 To 5

No Image

8: Door nsr
Scratched
Over 25mm Not Thru Paint



9: Door nsf
Chipped
1 To 5

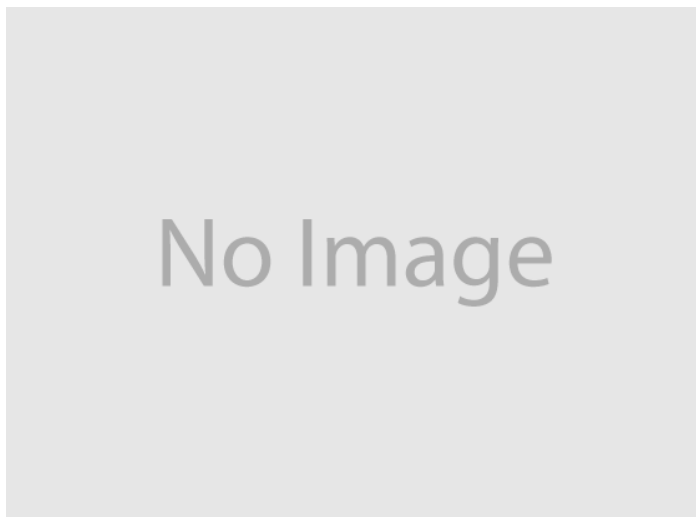

10: Door nsf
Scratched
Over 25mm Not Thru Paint




11: Wing nsf
Chipped
1 To 5



12: Bonnet
Chipped
1 To 5



13: Bumper Front
Scratched
25 to 100mm Thru Paint

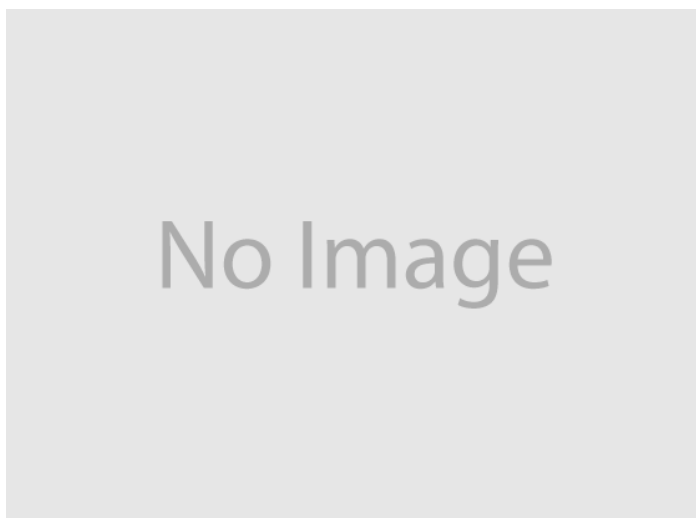

14: Bumper Front
Scratched
Over 25mm Not Thru Paint



15: Wheel nsf
Scratched
Over 50mm



16: Wheel osf
Scratched
Over 50mm



17: Wing osf
Chipped
1 To 5



18: Door osf
Chipped
1 To 5




19: Door osf
Scratched
Over 25mm Not Thru Paint



20: Door osr
Chipped
Multiple Chips



21: Qtr Panel osr
Scratched
Over 25mm Thru Paint

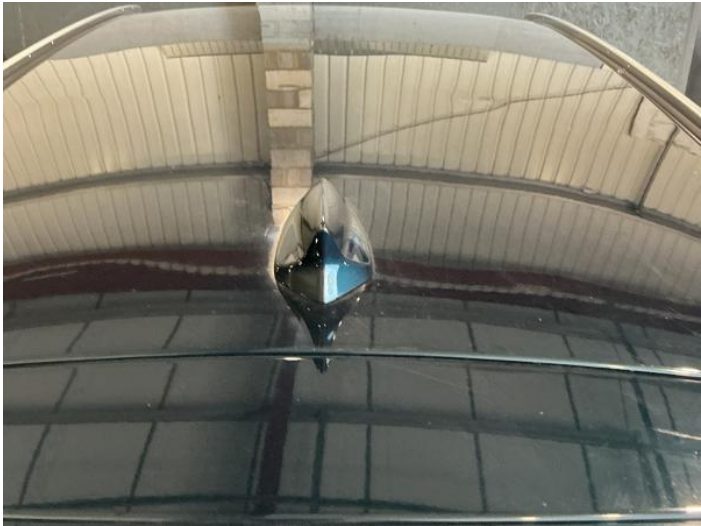

22: Roof
Dented
Over 30mm



23: Screen Front
Cracked
Replace

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer
Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK