

Vehicle Inspection Report

Date Inspected: 14/04/2025 17:20

Reg: RO70VZK

VIN: VF1AG000065885357

NAMA Grading



Grade

4

Appraised By: Eastbourne Car Auctions

General Details

<b>Make</b>	RENAULT	<b>Body Type</b>	Hatchback	<b>Doors</b>	5
<b>Model</b>	ZOE I GT LINE ZE 50 - 0cc	<b>Fuel Type</b>	Petrol	<b>Colour</b>	Blue
<b>Mileage</b>	35375 miles	<b>Transmission</b>	Auto	<b>Year of MFR</b>	2020
				<b>Date First Reg</b>	28/09/2020

Miscellaneous

<b>V5 Location</b>	Here
<b>MOT Location</b>	Here
<b>MOT Expiry</b>	27/09/2025
<b>No. Keys</b>	2

Tyres & Wheels

<b>OSF Depth</b>	3 mm	<b>Alloys</b>	Yes
<b>NSF Depth</b>	3 mm	<b>Alloys That Need Refurb</b>	4
<b>OSR Depth</b>	6 mm	<b>Tools</b>	No
<b>NSR Depth</b>	6 mm	<b>Spare</b>	No Spare

Interior Condition








<b>Carpets</b>	Average
<b>Upholstery</b>	Average
<b>Seats</b>	Average
<b>Parcel Shelf</b>	Yes
<b>Odour</b>	No

Service History


**Service History Stamps**

Extras

<b>Metallic Paint</b>	Yes	<b>Central Locking</b>	Yes	<b>Interior</b>	Half Leather	<b>Electric Seats</b>	No
<b>Air Conditioning</b>	Yes	<b>Sun Roof</b>	No	<b>Elec Windows</b>	4	<b>Heated Seats</b>	No
<b>Stereo</b>	Radio	<b>Sat Nav</b>	Built In	<b>Cruise</b>	Yes	<b>Xenons</b>	No
<b>Keyless Entry</b>	Yes	<b>Towbar</b>	No	<b>Number of Seats</b>	5	<b>Parking Sensors</b>	Front & Rear
<b>Phone Kit</b>	Yes	<b>Drv Airbag</b>	Yes	<b>Reversing Camera</b>	Yes	<b>EML</b>	No

Damage Assessment				
	<b>Door osf</b> Chipped Edge Chip Smart Repair		<b>Bumper Rear</b> Scratched Up To 25mm Thru Paint Smart Repair	<b>Bumper Rear</b> Scratched Over 25mm Not Thru Paint Machine Polish
	<b>Qtr Panel nsr</b> Dented Over 30mm Repair and Refinish		<b>Door nsr</b> Chipped 1 To 5 Smart Repair	<b>Door nsf</b> Scratched Over 25mm Not Thru Paint Machine Polish
	<b>Wing nsf</b> Cracked Needs Replaced Replace		<b>Bumper Front</b> Scratched 25 to 100mm Thru Paint Smart Repair	<b>Roof</b> Dented Over 2 UpTo 10mm Smart Repair
	<b>Seat Base Cover osf</b> Torn UpTo 3mm Smart Repair			

Damage Lines			
Component	Condition	Severity	Repair
Door osf	Chipped	Edge Chip	Smart Repair
Bumper Rear	Scratched	Up To 25mm Thru Paint	Smart Repair
Bumper Rear	Scratched	Over 25mm Not Thru Paint	Machine Polish
Qtr Panel nsr	Dented	Over 30mm	Repair and Refinish
Door nsr	Chipped	1 To 5	Smart Repair
Door nsf	Scratched	Over 25mm Not Thru Paint	Machine Polish
Wing nsf	Cracked	Replace	Replace
Bumper Front	Scratched	25 to 100mm Thru Paint	Smart Repair
Roof	Dented	Over 2 UpTo 10mm	Smart Repair
Seat Base Cover osf	Torn	UpTo 3mm	Smart Repair

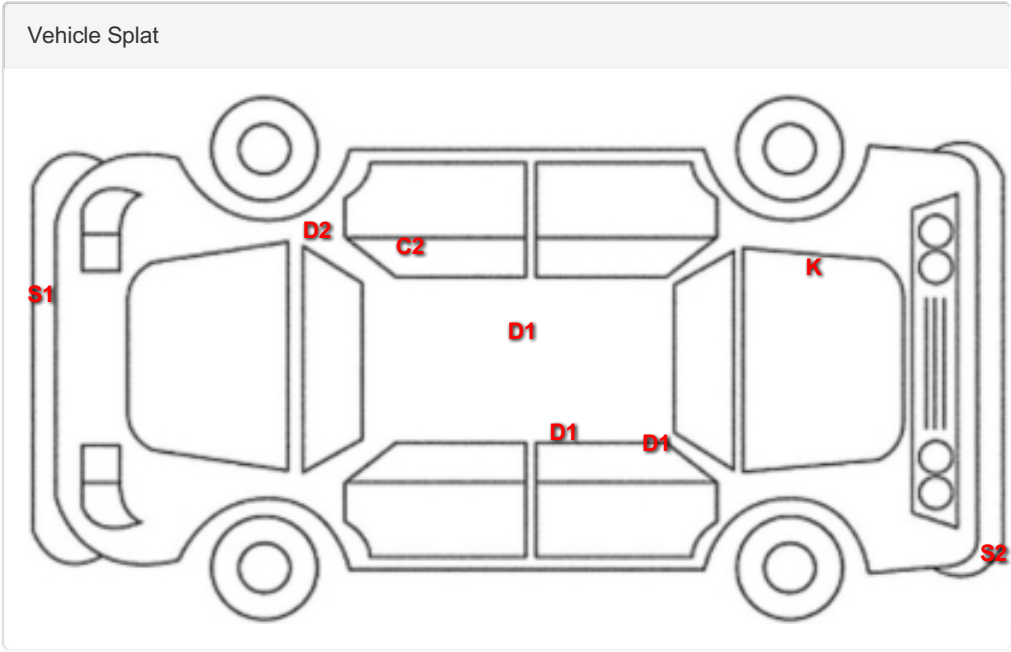

Splat Key
<b>S1</b> Scratch/Paint defect to 30mm
<b>S2</b> Scratch/Paint defect 30-100mm
<b>D1</b> Dent/damage under 30mm
<b>D2</b> Dent/damage 30-100mm
<b>C2</b> Multiple Chips
<b>K</b> Crack/Torn

Comments
<p>Battery is owned. Last Service - 13/06/2024 at 28,670 miles (4 MAIN DEALER SERVICES)</p> <p><b>No mechanical inspection has been undertaken on this vehicle, any mechanical items noted are for reference only and cannot be relied on.</b></p>