



VEHICLE INSPECTION REPORT

AK70UOB

Audi Q5 40 TDI Quattro S Line 5dr S Tronic

nama
 GRADE
2

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	05/12/2020	Body Style	Estate	Last service miles	66,278
Year	2020	Keys	2	MOT Due	07/07/2026
Mileage	74,284 Miles Warranted	Service history	Yes	Gearbox	SEMI AUTO
Fuel Type	Diesel	Service documents	Printout	Gears	7
Colour	SILVER	Number of stamps	5		
VIN	WAUZZZF5M2016975	Last service date	10/07/2025		

£90 ADDITIONAL FEE

LAST SERVICE 10/07/2025 @ 66,278 MILES (5 SERVICES, ALL MAIN DEALER)

Emergency call function faulty message displayed

Tyres

NSF	WESTLAKE	5.0mm
NSR	GOODYEAR	Damaged
OSF	WESTLAKE	5.0mm
OSR	GOODYEAR	3.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Rear wiper
- Electric door mirrors
- Front armrest
- Rear electric windows
- Metallic Paint
- Passenger airbag
- Partial leather seat trim
- Cruise control
- Park assist camera
- Steering wheel mounted controls
- Front fog lights
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Side airbags
- Alloy wheels
- Front parking sensor
- PAS
- Digital radio
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Central locking
- Heated front seat
- Rear parking sensor
- Body coloured bumpers
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Drivers airbag
- Remote central locking

Photos






Condition Check

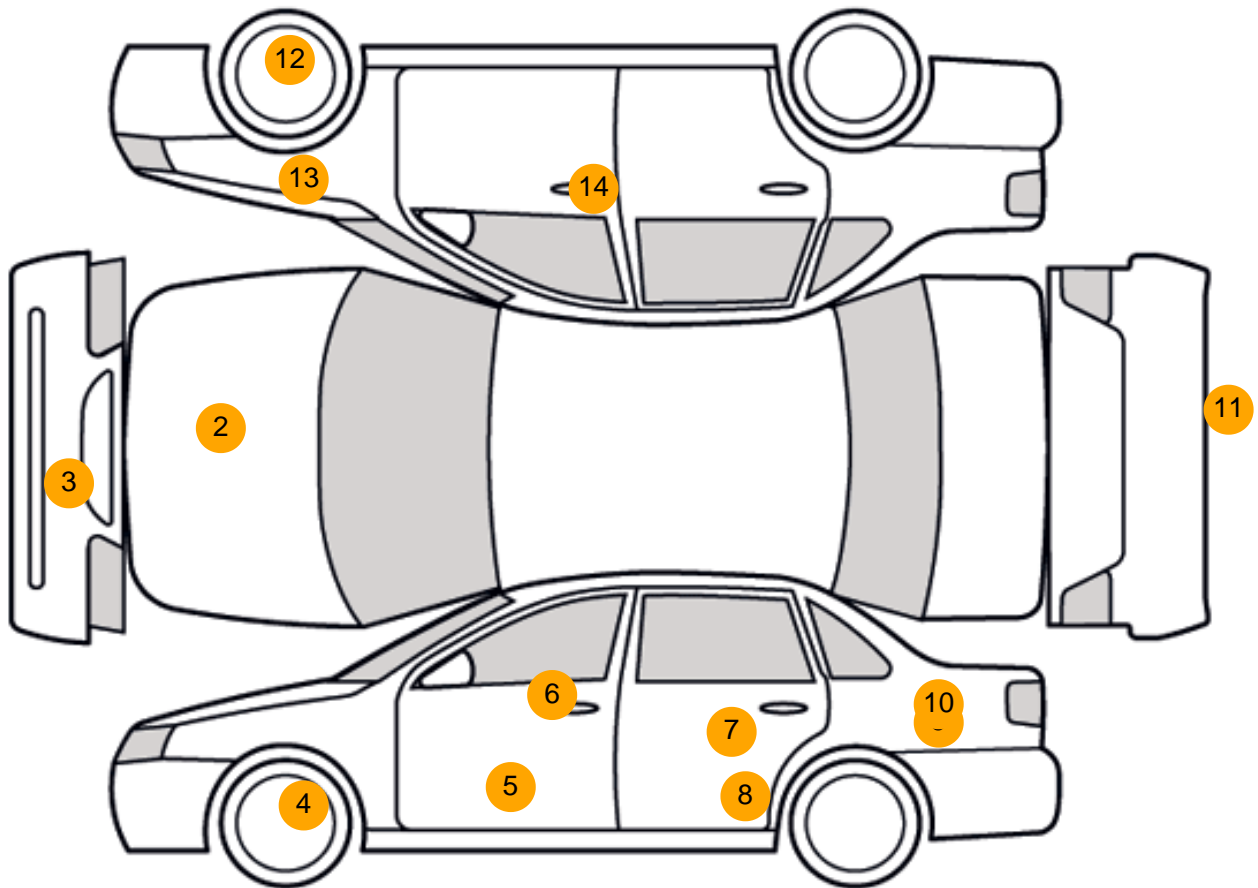

Damage Photos



1: Tyre nsr
Damaged
Replace

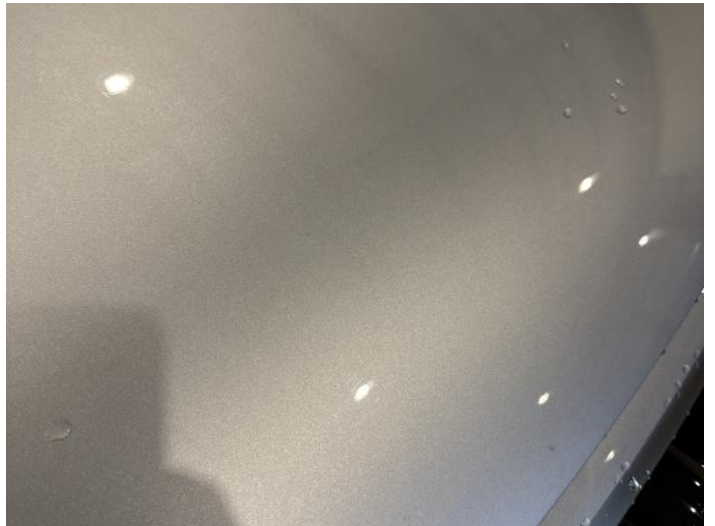

2: Bonnet
Chipped
1 To 5



3: Bumper Front
Chipped
1 To 5



4: Wheel nsf
Scratched
Over 50mm



5: Door nsf
Scratched
Over 25mm Thru Paint



6: Door nsf
Dented
Between 10mm + 30mm



7: Door nsr
Dented
Between 10mm + 30mm



8: Door nsr
Scratched
Up To 25mm Thru Paint



9: Qtr Panel nsr
Dented
Between 10mm + 30mm



10: Qtr Panel nsr
Scratched
UpTo 25mm Thru Paint



11: Bumper Rear
Chipped
1 To 5



12: Wheel osf
Scratched
Up To 50mm



13: Wing osf
Chipped
1 To 5



14: Door osf
Chipped
Edge Chip

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Gearbox Static Gear Selection (engine running)	OK
Turbo Boosting	OK	No Excessive Smoking	OK
Parking Brake	OK		
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK