

VEHICLE INSPECTION REPORT

GV09OSG

Ford Fiesta 1.25 Zetec 5dr [82]

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
4

Details

Reg. date	28/08/2009	Body Style	Hatchback	Last service miles	60,220
Year	2009	Keys	2	MOT Due	09/07/2026
Mileage	102,545 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Service Book	Gears	5
Colour	RED	Number of stamps	12	Doors	5
VIN	WF0JXXGAJJ9G43721	Last service date	07/06/2021		

Last service 07/06/2021 at 60,220 miles- 12 services (6 main dealer)


Tyres


NSF	FARROAD	4.0mm
NSR	MAZZINI	5.0mm
OSF	FARROAD	4.0mm
OSR	MAZZINI	5.0mm
Spare		

Features


- Bluetooth connection
- Body coloured bumpers
- Rear headrests
- Passenger airbag
- Cloth seat trim
- Rear wiper
- Electric door mirrors
- Metallic Paint
- Traction control
- Alloy wheels
- Telephone
- Air conditioning
- ABS
- Central locking
- Radio/CD
- Front electric windows
- Drivers airbag
- Remote central locking

Photos

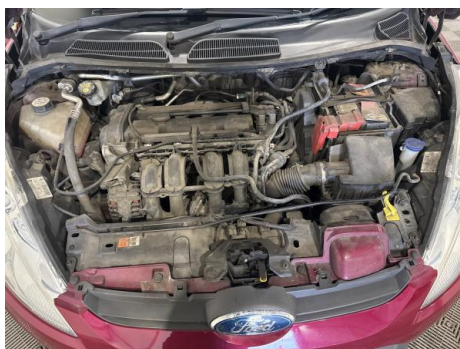

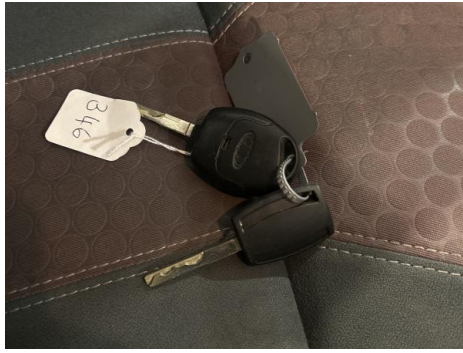

Condition Check

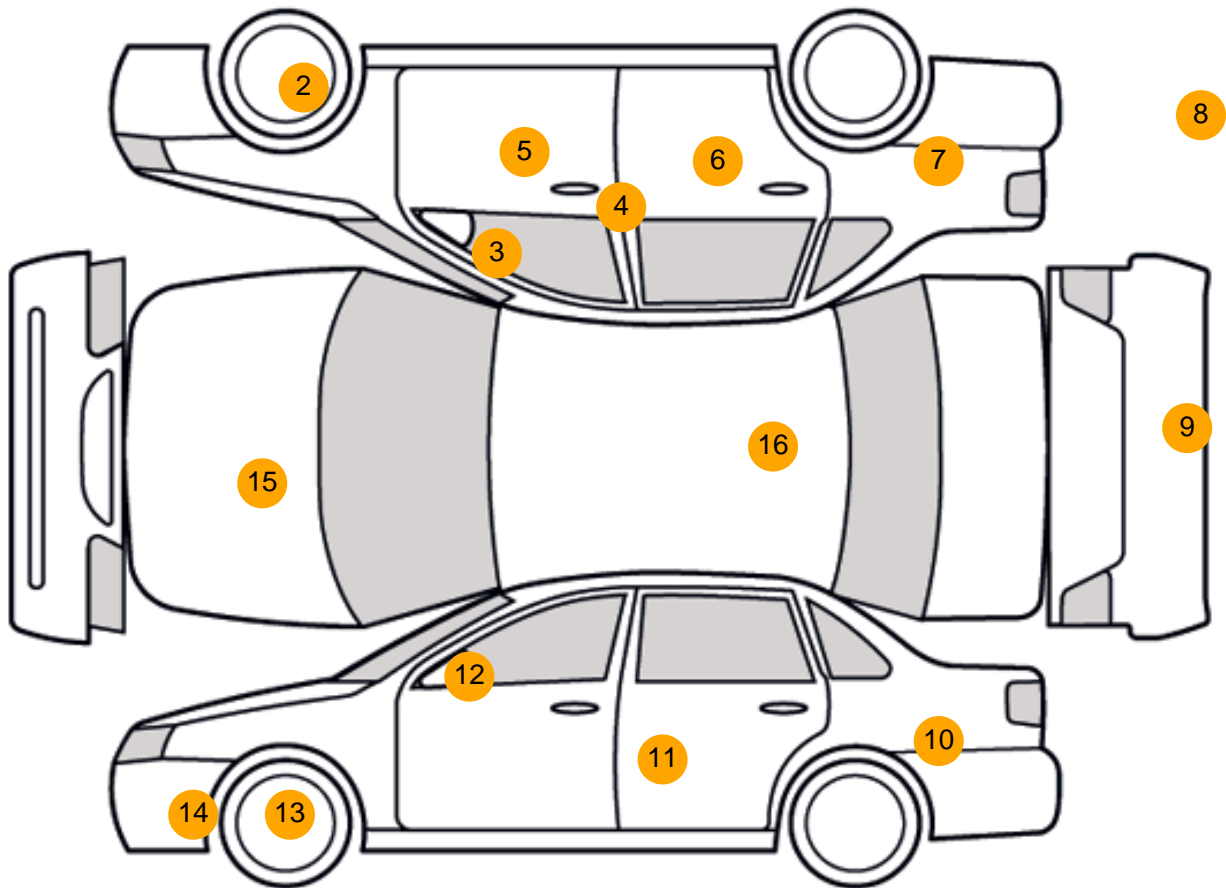

Damage Photos



1: Seat Back Cover of
Holed
Over 3mm



2: Wheel of
Scratched
Over 50mm



3: Door Mirror Assy osf
Scratched (Painted)
Over 25mm Thru Paint



4: Other
N/A
N/A



5: Door osf
Poor Previous Repair
Poor Paint



6: Door osr
Scratched
Over 25mm Thru Paint



7: Qtr Panel osr
Dented
Between 10mm + 30mm



8: Bumper Rear
Scratched
Over 100mm Thru Paint



9: Tailgate
Poor Previous Repair
Paint Flake



10: Qtr Panel nsr
Scratched
Over 25mm Thru Paint



11: Door nsf
Chipped
Edge Chip



12: Door Mirror Assy nsf
Missing
Replace




13: Wheel nsf
Scratched
Over 50mm



14: Bumper Front
Scratched
25 to 100mm Thru Paint



15: Bonnet
Chipped
1 To 5

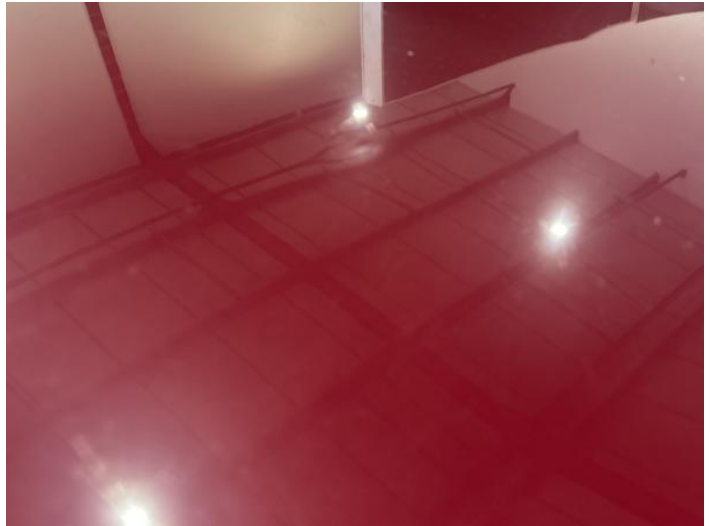

16: Roof
Dented
Between 10mm + 30mm

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK