

VEHICLE INSPECTION REPORT

LM62MYJ

Nissan Qashqai+2 1.6 [117] Acenta 5dr



Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	09/11/2012	Body Style	Hatchback	Last service miles	67,366
Year	2012	Keys	2	MOT Due	29/10/2026
Mileage	124,819 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Service Book	Gears	5
Colour	WHITE	Number of stamps	8	Doors	5
VIN	SJNJAAJ10U7154523	Last service date	16/09/2026		

Last Service - 16.09.2020 at 67366 miles (8 services) Radio Fault


Tyres

NSF	BRIDGESTONE	4.0mm
NSR	BRIDGESTONE	5.0mm
OSF	BRIDGESTONE	4.0mm
OSR	BRIDGESTONE	4.0mm
Spare		

Features


- Cruise control
- Body coloured bumpers
- Climate control
- Rear headrests
- Passenger airbag
- Cloth seat trim
- Rear wiper
- Electric door mirrors
- Front armrest
- Solid Paint
- Traction control
- Alloy wheels
- Telephone
- Fixed panoramic glass roof
- Front electric windows
- ABS
- Central locking
- Radio/CD
- Air conditioning
- Rear electric windows
- Drivers airbag
- Remote central locking

Photos

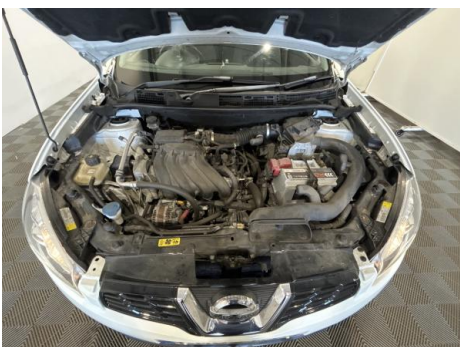



Condition Check

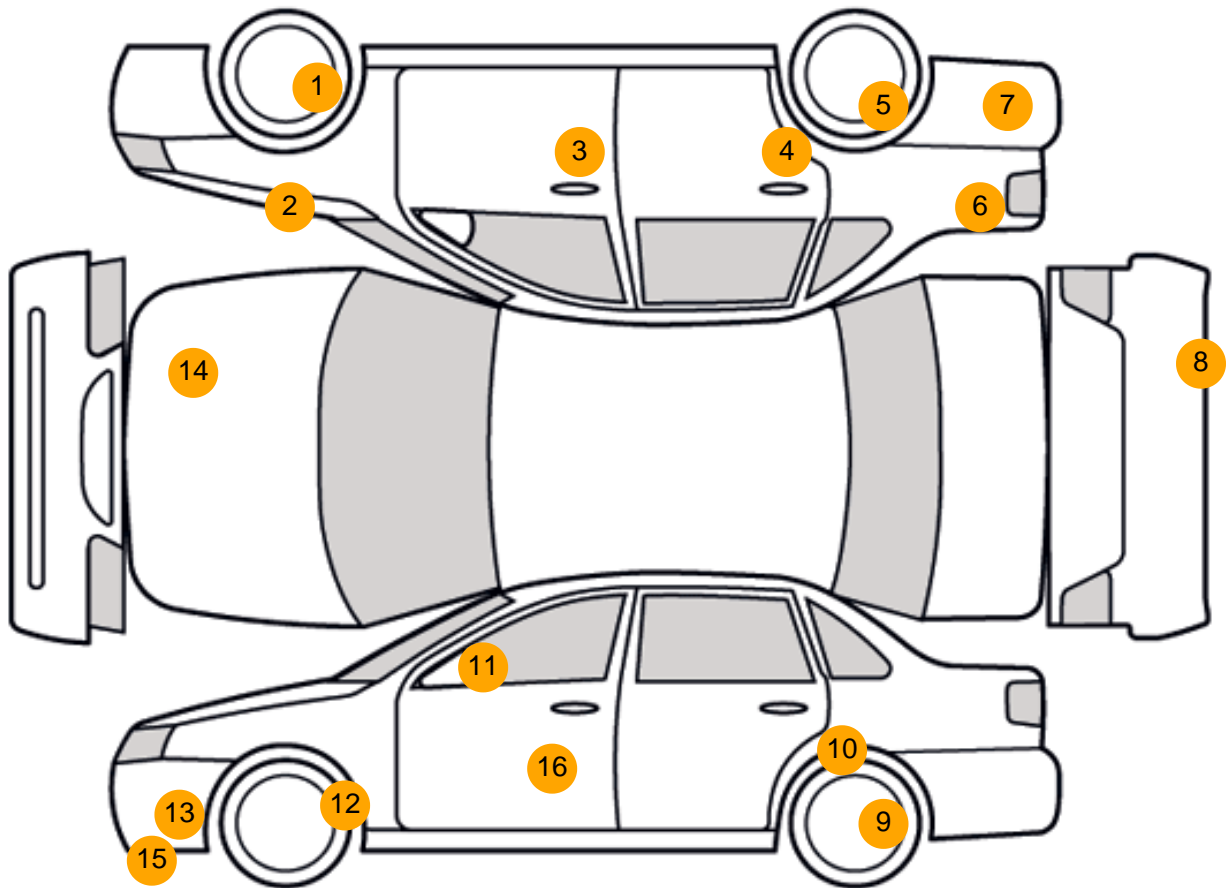

Damage Photos



1: Wheel of
Scratched
Over 50mm



2: Wing of
Chipped
1 To 5



3: Door osf
Chipped
1 To 5



4: Door osr
Scratched
Over 25mm Thru Paint



5: Wheel osr
Scratched
Over 50mm



6: Qtr Panel osr
Dented
With Paint Damage



7: Bumper Rear
Scratched
Over 100mm Thru Paint



8: Tailgate
Chipped
1 To 5



9: Wheel nsr
Scratched
Over 50mm



10: Door nsr
Chipped
Edge Chip



11: Door nsf
Scratched
Over 25mm Thru Paint



12: Wheel nsf
Scratched
Up To 50mm



13: Bumper Front
Scratched
25 to 100mm Thru Paint



14: Bonnet
Chipped
1 To 5



15: Bumper Front Moulding
Scuffed (Unpainted)
Over 100mm



16: Door nsf
Poor Previous Repair
Poor Paint

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	Fault
		Steering	OK