



# VEHICLE INSPECTION REPORT

**BU19KPV**

## Ford Kuga 2.0 TDCi 180 Titanium Edition 5dr Auto

nama  
GRADE  
**3**

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

### Details

Reg. date	28/03/2019	Body Style	Hatchback	Last service miles	32,208
Year	2019	Keys	2	MOT Due	20/02/2027
Mileage	44,468 Miles Warranted	Service history	Yes	Gearbox	AUTOMATIC
Fuel Type	Diesel	Service documents	Service Book	Gears	6
Colour	RED	Number of stamps	3	Doors	5
VIN	WF0AXXWPMKAD58914	Last service date	21/02/2025		

£90 ADDITIONAL FEE

Last service 21/02/2025 at 32,208 miles- 3 main dealer services

### Tyres

NSF	NEXEN	4.0mm
NSR	NEXEN	5.0mm
OSF	BUDGET	3.0mm
OSR	CONTINENTAL	5.0mm
Spare		

## Features


- Bluetooth connection
- Rear parking sensor
- Radio/CD
- Roof rails
- Front armrest
- Rear electric windows
- Metallic Paint
- Passenger airbag
- Partial leather seat trim
- Cruise control
- Rear wiper
- Body coloured bumpers
- Space saver spare wheel
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Side airbags
- Alloy wheels
- Navigation system
- Steering wheel mounted controls
- Electric door mirrors
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Central locking
- PAS
- Digital radio
- Front fog lights
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Drivers airbag
- Remote central locking

## Photos





## Condition Check

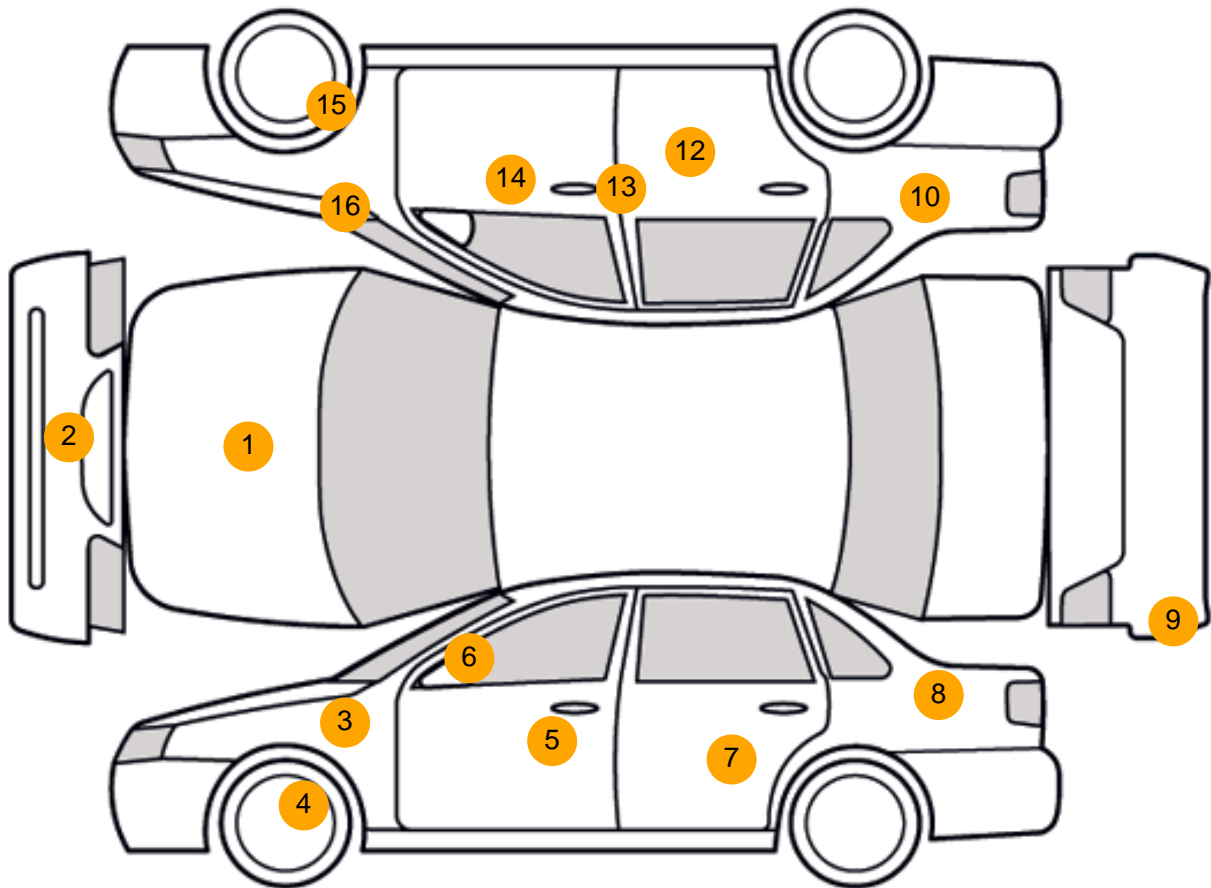

## Damage Photos



1: Bonnet  
Chipped  
Multiple Chips



2: Bumper Front  
Chipped  
1 To 5



3: Wing nsf  
Scratched  
Over 25mm Thru Paint



4: Wheel nsf  
Scratched  
Over 50mm



5: Door nsf  
Scratched  
Over 25mm Thru Paint



6: Door Mirror Assy nsf  
Scratched (Painted)  
UpTo 25mm Thru Paint



7: Door nsr  
Chipped  
1 To 5



8: Qtr Panel nsr  
Chipped  
1 To 5



9: Bumper Rear  
Poor Previous Repair  
Poor Paint




10: Qtr Panel osr  
Chipped  
1 To 5



11: Bumper Rear  
Insecure  
Action Required



12: Door osr  
Chipped  
Edge Chip

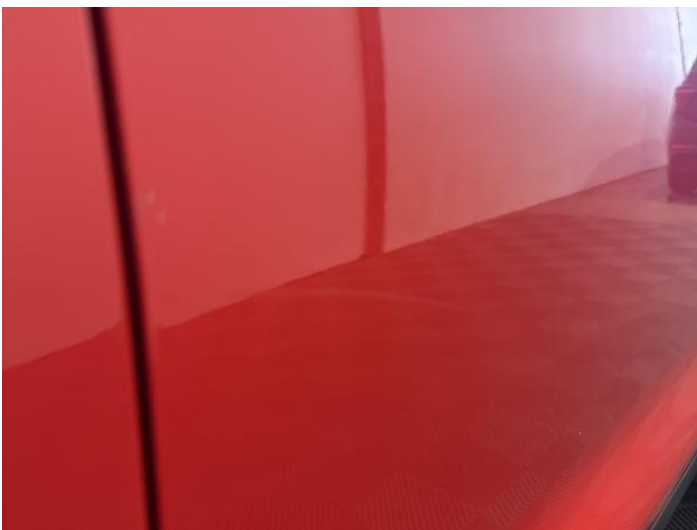

13: Door osf  
Chipped  
Edge Chip



14: Door osf  
Chipped  
1 To 5



15: Wheel osf  
Corroded  
Light



16: Wing osf  
Chipped  
1 To 5

### Interior

**Carpet Condition** Average  
**Seat Condition** Average

**Upholstery Condition** Average  
**Odour** No

## Vehicle Inspection Report

### Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Gearbox Static Gear Selection (engine running)	OK
Turbo Boosting	OK	No Excessive Smoking	OK
Parking Brake	OK		
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK