



VEHICLE INSPECTION REPORT

MM69KZT

Volkswagen Golf 1.5 TSI EVO 150 Match Edition 5dr DSG

| Inspection | | Vehicle | |
|-----------------|----|---------|---------|
| Serious Damage? | No | VAT | Margin |
| | | V5 | Present |

nama
GRADE
3

Details

| | | | | | |
|-----------|------------------------|-------------------|------------|--------------------|------------|
| Reg. date | 21/01/2020 | Body Style | Hatchback | Last service miles | 29,069 |
| Year | 2020 | Keys | 2 | MOT Due | 18/10/2026 |
| Mileage | 47,372 Miles Warranted | Service history | Yes | Gearbox | SEMI AUTO |
| Fuel Type | Petrol | Service documents | Printout | Gears | 7 |
| Colour | GREY | Number of stamps | 4 | Doors | 5 |
| VIN | WVVZZZAUZLW088290 | Last service date | 04/04/2024 | | |

£90 ADDITIONAL FEE

LAST SERVICE 04/04/2024 @ 29,069 MILES (4 SERVICES, ALL MAIN DEALER)

Tyres

| | | |
|-----|-------------|-------|
| NSF | LANDSAIL | 5.0mm |
| NSR | SAILUN | 5.0mm |
| OSF | LANDSAIL | 5.0mm |
| OSR | CONTINENTAL | 4.0mm |

Spare

Features


- Bluetooth connection
- Navigation system
- Steering wheel mounted controls
- Electric door mirrors
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel rake adjustment
- ABS
- Side airbags
- Alloy wheels
- Cruise control
- PAS
- Trip computer
- Front fog lights
- Front armrest
- Rear armrest
- Steering wheel reach adjustment
- Drivers airbag
- Alarm
- Front parking sensor
- Rear parking sensor
- Radio/CD
- Air conditioning
- Front electric windows
- Rear electric windows
- Metallic Paint
- Isofix child seat anchor points
- Remote central locking
- Heated front seat
- Rear wiper
- Body coloured bumpers
- Climate control
- Front head restraints
- Rear headrests
- 3x3 point rear seat belts
- Passenger airbag
- Cloth seat trim

Photos





Condition Check

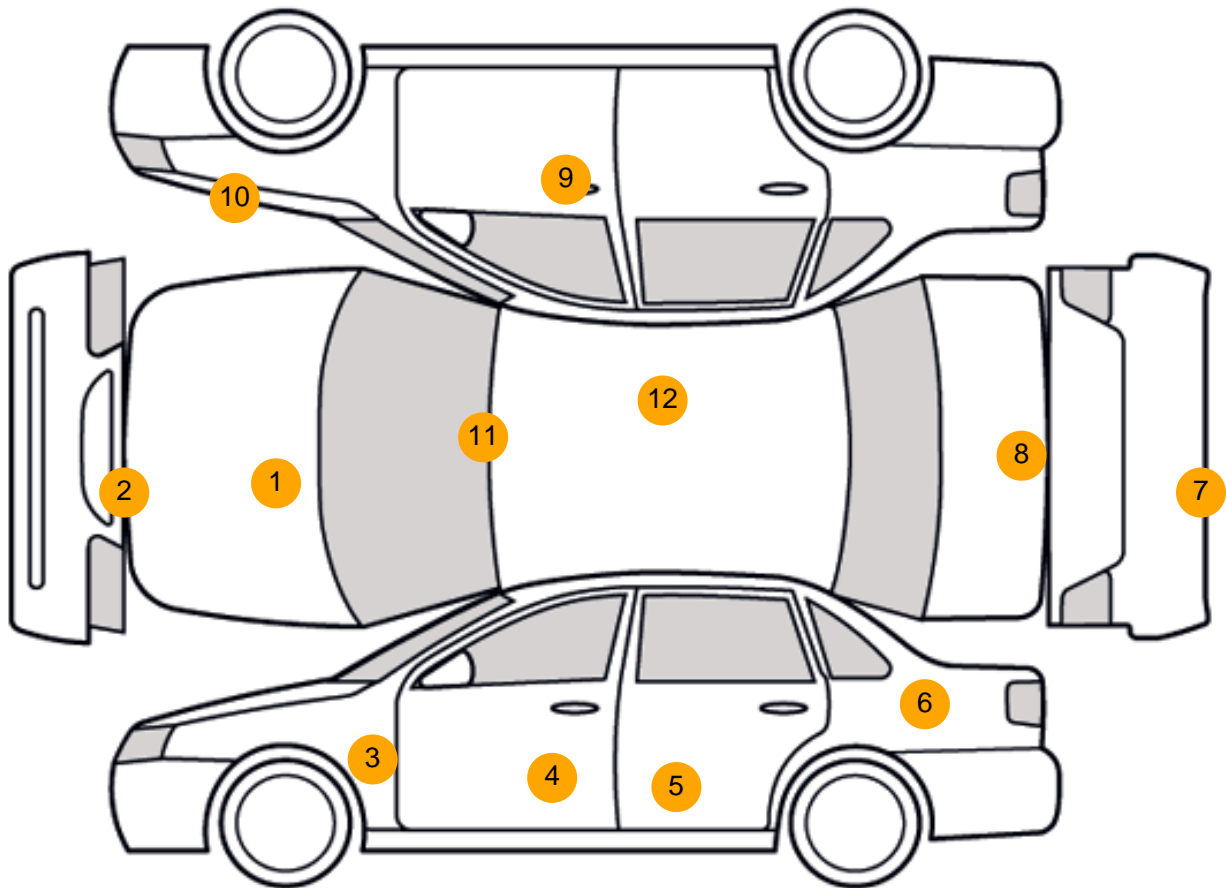

Damage Photos



1: Bonnet
Chipped
1 To 5




2: Bumper Front
Chipped
Multiple Chips



3: Wing nsf
Scratched
Over 25mm Thru Paint



4: Door nsf
Scratched
UpTo 25mm Thru Paint

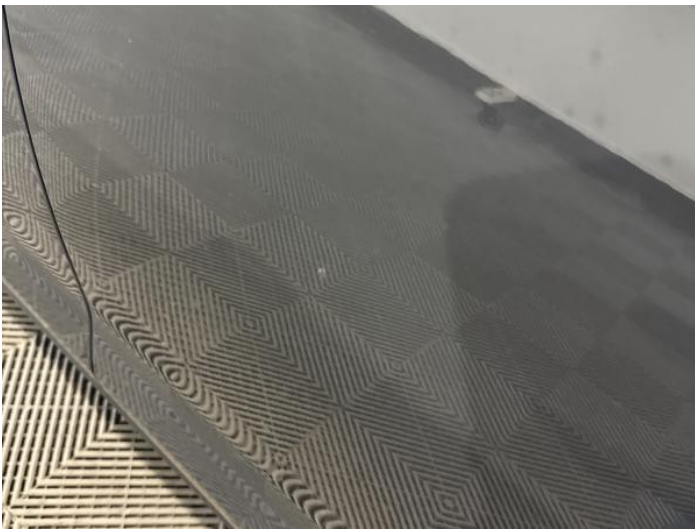

5: Door nsr
Chipped
1 To 5



6: Qtr Panel nsr
Scratched
Rusted



7: Bumper Rear
Scratched
25 to 100mm Thru Paint



8: Tailgate
Chipped
1 To 5



9: Door osf
Scratched
Over 25mm Thru Paint



10: Wing osf
Chipped
1 To 5



11: Screen Front
Chipped
UpTo 10mm



12: Roof
Chipped
1 To 5

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

| | | | |
|----------------|----|--|----|
| Engine Runs | OK | Gearbox 1st and Reverse Test | OK |
| Brakes | OK | Clutch Slip Test from Static | OK |
| Turbo Boosting | OK | Gearbox Static Gear Selection (engine running) | OK |
| Parking Brake | OK | No Excessive Smoking | OK |

| | | | |
|--------------------------|----|-------------------------------------|----|
| EML light illuminated | OK | Oil warning light illuminated | OK |
| Airbag light illuminated | OK | DPF light illuminated | OK |
| ABS light illuminated | OK | Service indicator light illuminated | OK |
| Windows | OK | Radio | OK |
| Sat nav | OK | Steering | OK |