



VEHICLE INSPECTION REPORT

KP55XHZ

Saab 9-3 2.0T Aero 4dr [5]

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	10/11/2005	Body Style	Saloon	MOT Due	10/11/2026
Year	2005	Service history	Yes	Gearbox	MANUAL
Mileage	124,640 Miles Warranted	Service documents	Service Book	Gears	5
Fuel Type	Petrol	Number of stamps	11	Doors	4
Colour	SILVER	Last service date	08/11/2024		
VIN	YS3FH45YX61024391	Last service miles	119,843		

£100 ADDITIONAL FEE

Last service 08/11/2024 at 119,843 miles- 11 services (6 main dealer) Book and print Engine rattle

Tyres

NSF	MICHELIN	4.0mm
NSR	MICHELIN	4.0mm
OSF	MICHELIN	4.0mm
OSR	MICHELIN	5.0mm
Spare		

Features


- PAS
- Body coloured bumpers
- Front armrest
- Rear electric windows
- Metallic Paint
- Drivers airbag
- Alarm
- Rear parking sensor
- Electric door mirrors
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking
- Steering wheel mounted controls
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Leather seat trim
- Radio/CD
- Climate control
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Curtain airbags
- Side airbags
- Alloy wheels

Photos






Condition Check

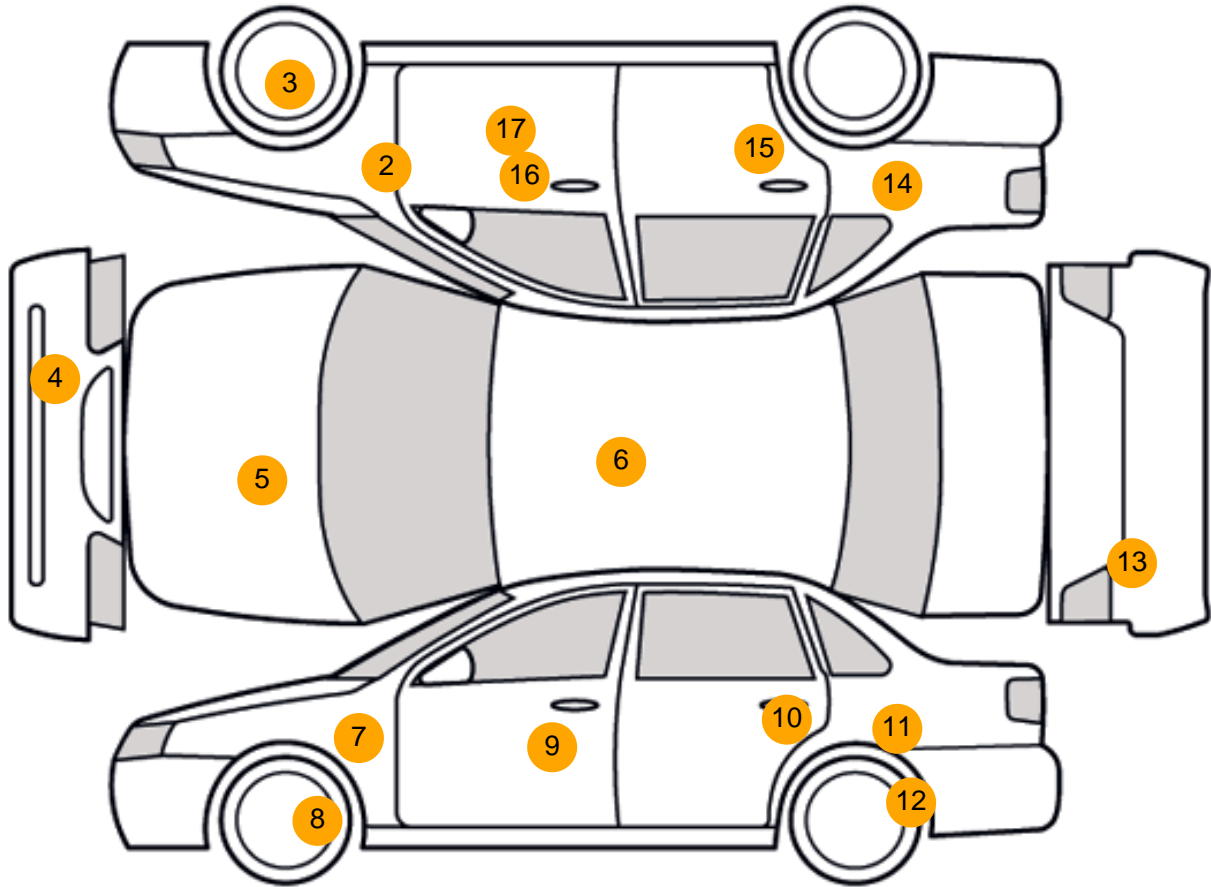

Damage Photos

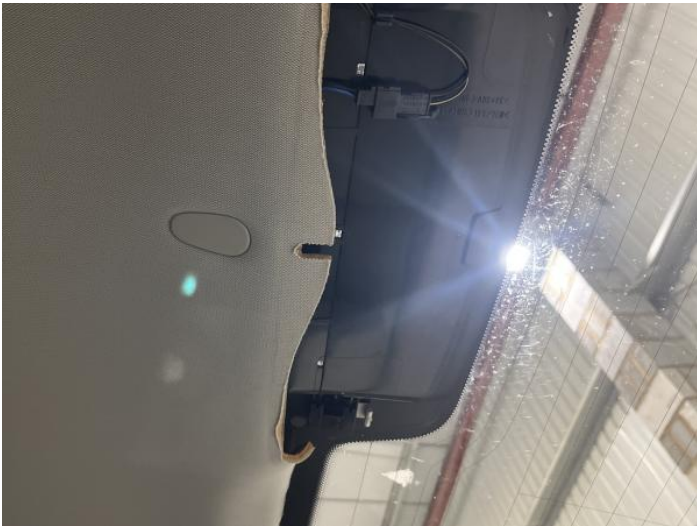

1: Other
N/A
N/A



2: Wing of
Rusted
Over 5mm



3: Wheel osf
Scratched
Over 50mm



4: Bumper Front
Scratched
Over 100mm Thru Paint



5: Bonnet
Chipped
Multiple Chips



6: Roof
Chipped
Multiple Chips



7: Wing nsf
Scratched
Rusted



8: Wheel nsf
Scratched
Over 50mm



9: Door nsf
Scratched
Over 25mm Thru Paint



10: Door nsr
Dented
Between 10mm + 30mm



11: Qtr Panel nsr
Rusted
Over 5mm



12: Wheel nsr
Corroded
Light



13: Bumper Rear
Scratched
Over 100mm Thru Paint



14: Qtr Panel osr
Rusted
Over 5mm



15: Door osr
Scratched
Over 25mm Thru Paint



16: Door osf
Dented
Between 10mm + 30mm



17: Door osf
Scratched
Over 25mm Thru Paint



18: Aerial
Missing
Replace

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
		Steering	OK