



# VEHICLE INSPECTION REPORT

**GK68BYP**

## Audi A1 1.4 TFSI Sport Nav 5dr S Tronic

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama  
GRADE  
**4**

### Details

Reg. date	10/09/2018	Body Style	Hatchback	MOT Due	Expired
Year	2018	Keys	2	Gearbox	SEMI AUTO
Mileage	35,265 Miles Warranted	Service history	Yes	Gears	7
Fuel Type	Petrol	Service documents	Printout	Doors	5
Colour	BLUE	Number of stamps	4		
VIN	WAUZZZ8X5JB075783	Last service date	20/09/2025		

last service 20/9/25 mileage not recorded (4 services 1 main dealer) Service light on

### Tyres

NSF	NANKANG	4.0mm
NSR	NANKANG	5.0mm
OSF	NANKANG	4.0mm
OSR	FARROAD	5.0mm
Spare		

## Features


- Bluetooth connection
- Rear parking sensor
- Digital radio
- Front fog lights
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Cloth seat trim
- Cruise control
- Rear wiper
- Radio/CD
- Air conditioning
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Curtain airbags
- Side airbags
- Alloy wheels
- Front parking sensor
- Service indicator
- Body coloured bumpers
- Folding rear seats
- Rear electric windows
- Metallic Paint
- Drivers airbag
- Central locking
- PAS
- Steering wheel mounted controls
- Electric door mirrors
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking

## Photos





## Condition Check

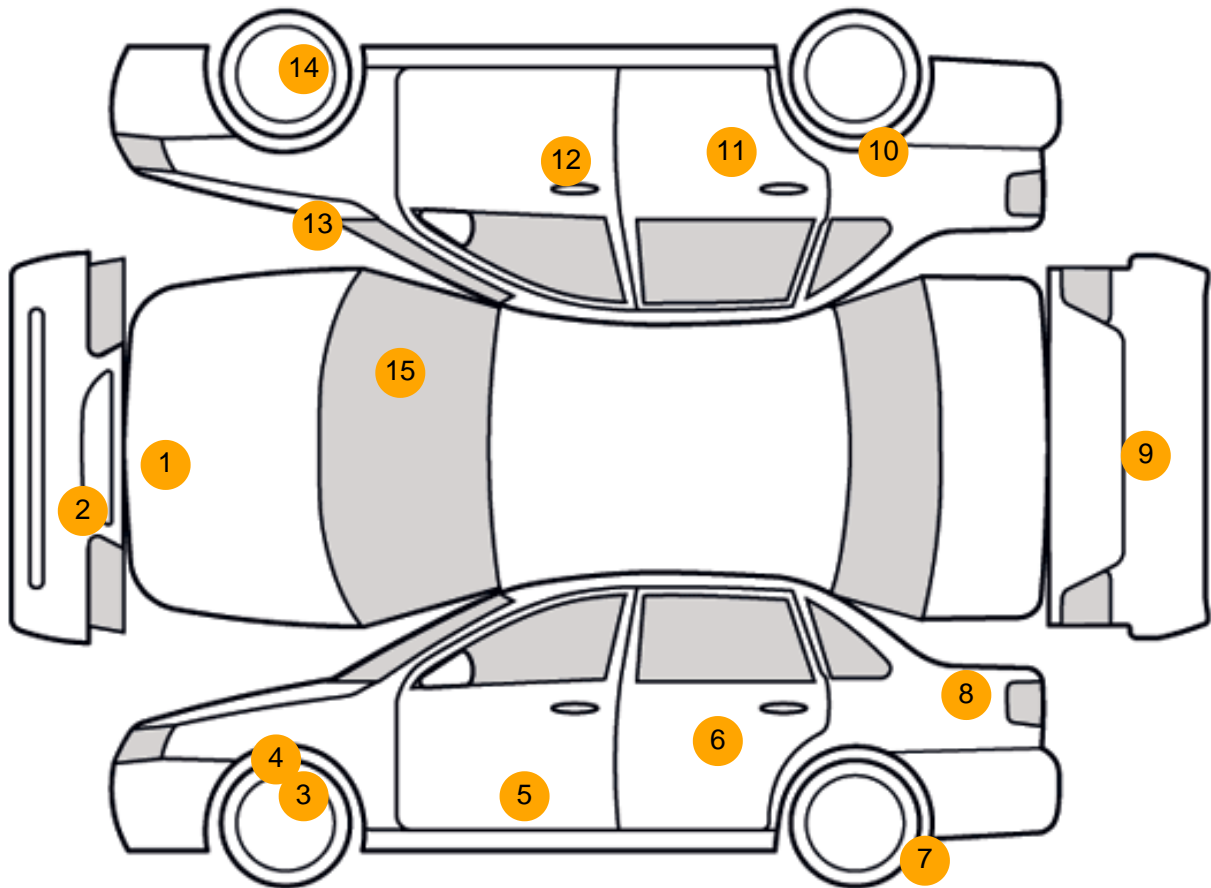

## Damage Photos



1: Bonnet  
Chipped  
Multiple Chips



2: Bumper Front  
Scratched  
Over 100mm Thru Paint



3: Wheel nsf  
Scratched  
Over 50mm



4: Wing nsf  
Scratched  
Over 25mm Thru Paint



5: Door nsf  
Chipped  
1 To 5



6: Door nsr  
Dented  
Between 10mm + 30mm



7: Wheel nsr  
Scratched  
Up To 50mm



8: Qtr Panel nsr  
Poor Previous Repair  
Poor Paint



9: Bumper Rear  
Scratched  
Over 100mm Thru Paint



10: Wheel osf  
Scratched  
Over 50mm



11: Door osf  
Scratched  
Over 25mm Thru Paint



12: Door osf  
Chipped  
Edge Chip



13: Wing osf  
Scratched  
Over 25mm Thru Paint



14: Wheel osf  
Scratched  
Over 50mm



15: Screen Front  
Chipped  
UpTo 10mm

### Interior

**Carpet Condition**  
**Seat Condition**

Average  
Average

**Upholstery Condition**  
**Odour**

Average  
No

## Vehicle Inspection Report

### Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	Fault
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK