



VEHICLE INSPECTION REPORT

YS22VZT

Seat Ateca 1.5 TSI EVO FR Sport 5dr DSG

nama
 GRADE
3

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

Details

Reg. date	22/08/2022	Body Style	Hatchback	Last service miles	35,881
Year	2022	Keys	2	MOT Due	21/08/2026
Mileage	36,355 Miles Warranted	Service history	Yes	Gearbox	SEMI AUTO
Fuel Type	Petrol	Service documents	Printout	Gears	7
Colour	GREY	Number of stamps	4	Doors	5
VIN	VSSZZZ5FZN6539563	Last service date	21/05/2026		

£90 ADDITIONAL FEE

last service 21/5/26 @ 35,881 miles (4 services 3 main dealer) Bonnet does not shut

Tyres

NSF	BUDGET	5.0mm
NSR	BRIDGESTONE	5.0mm
OSF	MAXXIS	5.0mm
OSR	BRIDGESTONE	5.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Radio/CD
- Climate control
- Rear electric windows
- Drivers airbag
- Central locking
- Cruise control
- Rear parking sensor
- Body coloured bumpers
- Electrically adjustable drivers seat
- Rear headrests
- Passenger airbag
- Remote central locking
- Front parking sensor
- Rear wiper
- Electric door mirrors
- Front armrest
- Metallic Paint
- Traction control
- Leather seat trim
- Heated front seat
- Telephone
- Air conditioning
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels

Photos





Condition Check

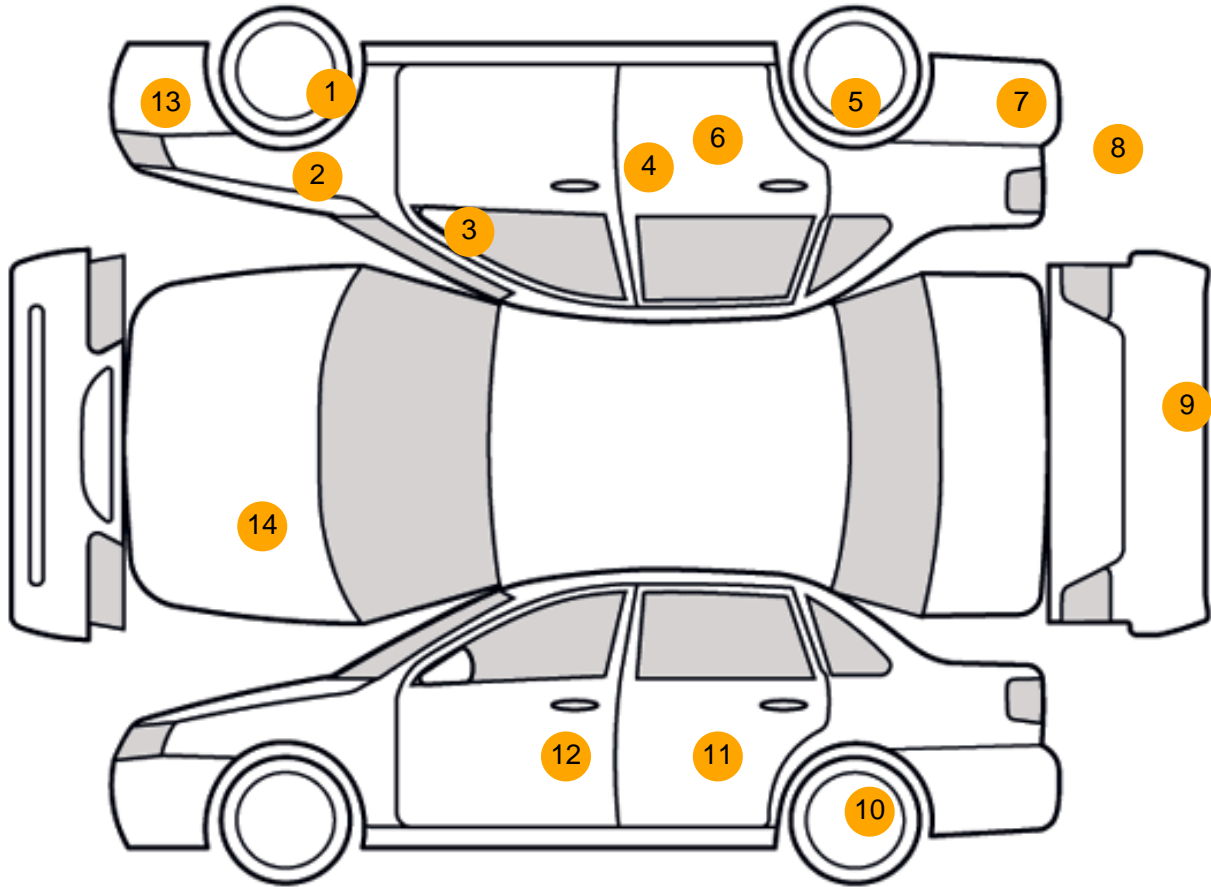

Damage Photos



1: Wheel osf
Corroded
Light



2: Wing osf
Chipped
1 To 5



3: Door Mirror Assy osf
Scratched (Painted)
Over 25mm Thru Paint



4: Door osf
Chipped
Edge Chip



5: Wheel osr
Corroded
Light



6: Door osr
Chipped
1 To 5



7: Bumper Rear
Scratched
25 to 100mm Thru Paint



8: Bumper Rear
Chipped
1 To 5



9: Tailgate
Scratched
Over 25mm Thru Paint



10: Wheel nsr
Corroded
Light



11: Door nsr
Scratched
Over 25mm Thru Paint



12: Door nsf
Poor Previous Repair
Poor Paint



13: Bumper Front
Scratched
25 to 100mm Thru Paint



14: Bonnet
Chipped
1 To 5



15: Other
N/A
N/A

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK