

VEHICLE INSPECTION REPORT

WV09OFP

Audi A3 S3 Quattro 3dr

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
4

Details

Reg. date	24/07/2009	Body Style	Hatchback	Last service miles	107,192
Year	2009	Keys	2	MOT Due	20/03/2027
Mileage	167,883 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	PETROL	Service documents	Service Book	Gears	6
Colour	SILVER	Number of stamps	13	Doors	3
VIN	WAUZZZ8P3AA025034	Last service date	18/03/2021		

Last service 18/03/2021 at 107,192 miles- 13 services Arm rest broken



Tyres




NSF	PIRELLI	5.0mm
NSR	PIRELLI	4.0mm
OSF	PIRELLI	5.0mm
OSR	PIRELLI	4.0mm
Spare		

Features


- Bluetooth connection
- Body coloured bumpers
- Front armrest
- ABS
- Central locking
- Heated front seat
- Electric door mirrors
- Front electric windows
- Drivers airbag
- Remote central locking
- Rear wiper
- Air conditioning
- Rear headrests
- Passenger airbag
- Leather seat trim
- Radio/CD
- Climate control
- Metallic Paint
- Traction control
- Alloy wheels

Photos

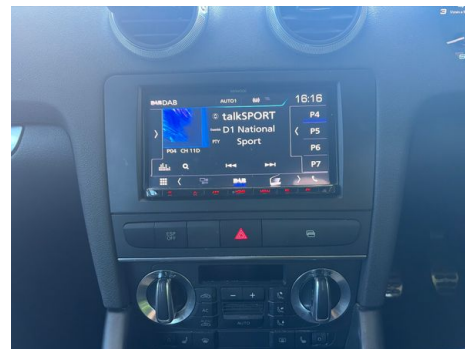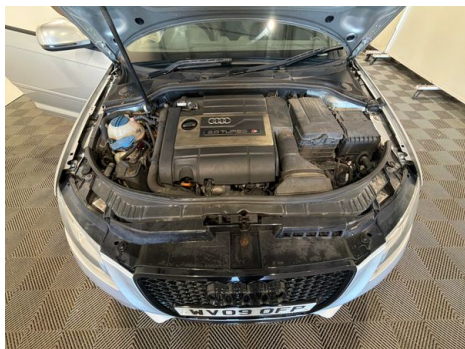

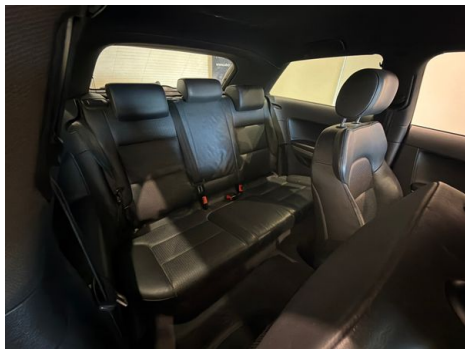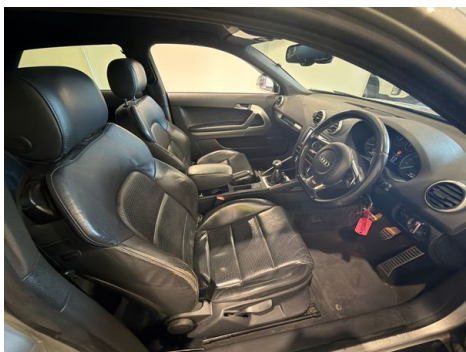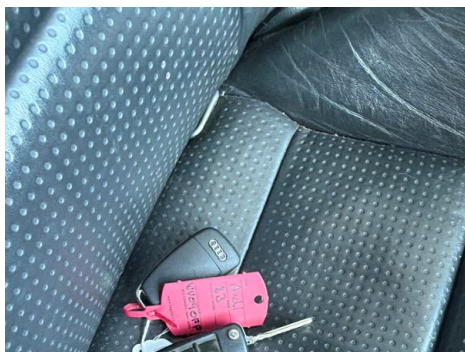

Condition Check

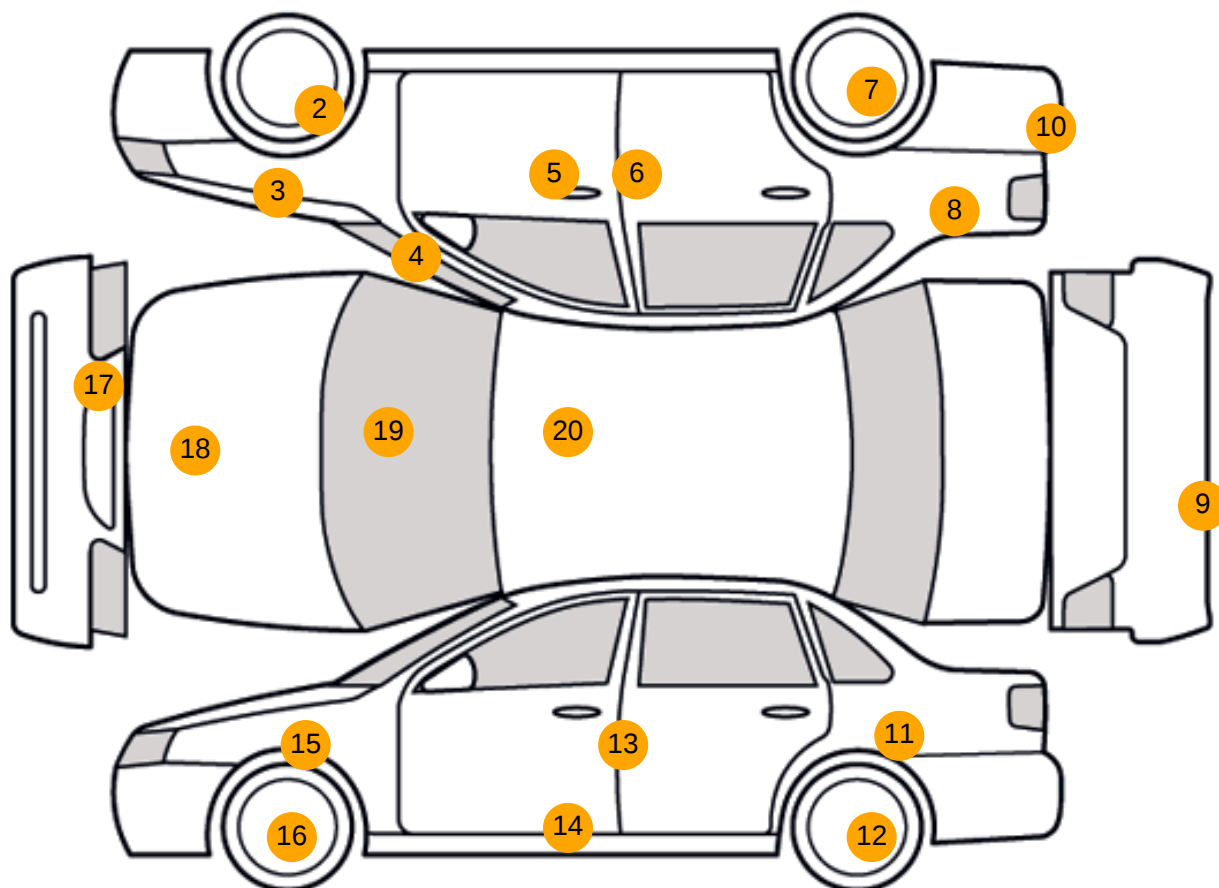

Damage Photos



1: Door Pad osf
Holed
Over 3mm



2: Wheel osf
Scratched
Over 50mm



3: Wing osf
Poor Previous Repair
Poor Paint



4: A Post os
Chipped
1 To 5



5: Door osf
Chipped
1 To 5



6: Door osf
Chipped
Edge Chip



7: Wheel osr
Scratched
Over 50mm



8: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



9: Tailgate
Poor Previous Repair
Poor Paint




10: Bumper Rear
Scratched
Up To 25mm Thru Paint



11: Qtr Panel nsr
Dented
With Paint Damage



12: Wheel nsr
Scratched
Up To 50mm

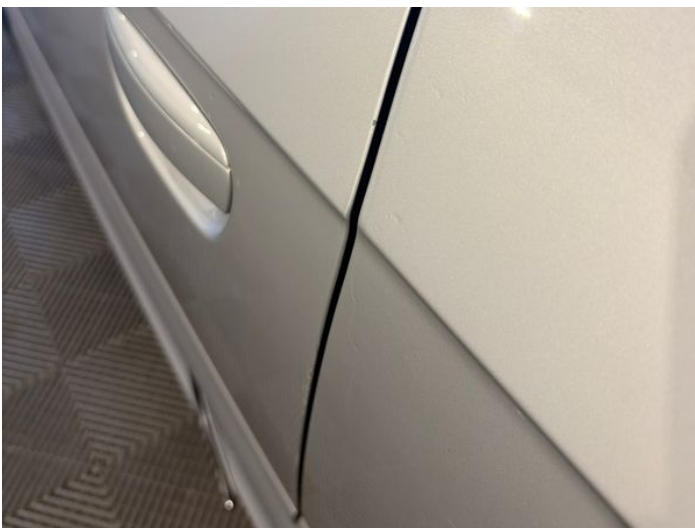

13: Door nsf
Chipped
Edge Chip



14: Other
N/A
N/A



15: Wing nsf
Chipped
1 To 5



16: Wheel nsf
Scratched
Up To 50mm



17: Bumper Front
Poor Previous Repair
Paint Flake



18: Bonnet
Chipped
Multiple Chips



19: Screen Front
Chipped
Up To 10mm



20: Roof
Chipped
1 To 5

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK