



VEHICLE INSPECTION REPORT

GU67NOF

Nissan Qashqai 1.2 DiG-T Tekna 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
3

Details

Reg. date	29/09/2017	Body Style	Hatchback	Last service miles	54,638
Year	2017	Keys	2	MOT Due	30/03/2027
Mileage	81,840 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	PETROL	Service documents	Service Book	Gears	6
Colour	BLUE	Number of stamps	5	Doors	5
VIN	SJNFEAJ11U2089546	Last service date	29/09/2022		

Last Service - 29.09.2022 at 54638 miles (5 main dealer services) Traction light on and system fault displays on dash


Tyres		
NSF	BUDGET	5.0mm
NSR	BUDGET	3.0mm
OSF	BUDGET	5.0mm
OSR	NEXEN	2.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Telephone
- Fixed panoramic glass roof
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Cruise control
- Park assist camera
- Radio/CD
- Air conditioning
- Front electric windows
- ABS
- Tyre pressure monitor
- Leather seat trim
- Front parking sensor
- Rear parking sensor
- Body coloured bumpers
- Climate control
- Rear electric windows
- Drivers airbag
- Central locking
- Alloy wheels
- Heated front seat
- Rear wiper
- Electric door mirrors
- Electrically adjustable drivers seat
- Rear headrests
- Passenger airbag
- Remote central locking

Photos



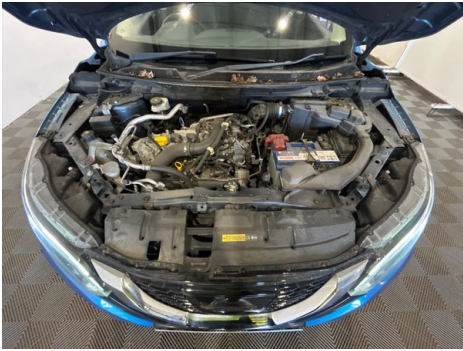

Condition Check

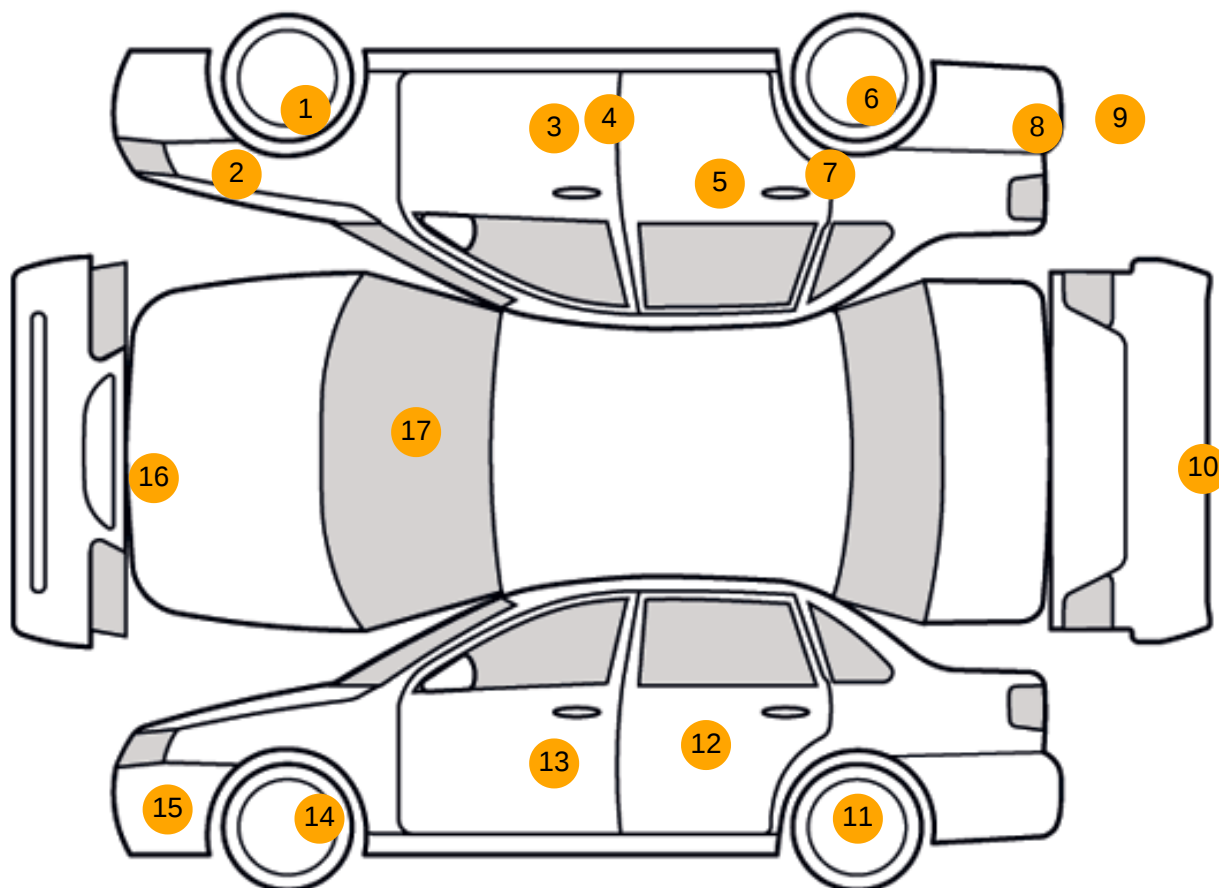

Damage Photos



1: Wheel osf
Scratched
Over 50mm



2: Wing osf
Chipped
1 To 5



3: Door osf
Chipped
1 To 5



4: Door osf
Dented
Between 10mm + 30mm



5: Door osr
Dented
2 Or Less UpTo 10mm



6: Wheel osr
Scratched
Over 50mm



7: Door osr
Chipped
Edge Chip



8: Bumper Rear
Scratched
Over 100mm Thru Paint



9: Bumper Rear Moulding
Scuffed (Unpainted)
UpTo 100mm




10: Tailgate
Chipped
1 To 5



11: Wheel nsr
Corroded
Light



12: Door nsr
Chipped
Multiple Chips

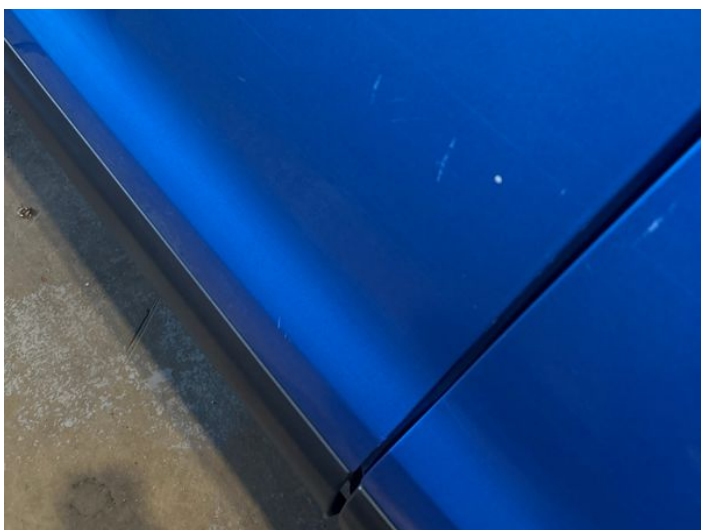

13: Door nsf
Chipped
1 To 5



14: Wheel nsf
Scratched
Over 50mm



15: Bumper Front
Chipped
Multiple Chips



16: Bonnet
Chipped
1 To 5



17: Screen Front
Chipped
UpTo 10mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer
 Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
 Additional fees may apply to some vendors.
 Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Roof / sunroof	OK	Radio	OK
Windows	OK	Steering	OK
Sat nav	OK		