



VEHICLE INSPECTION REPORT

GL67WCT

Skoda Rapid 1.0 TSI 110 SE L 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
3

Details

Reg. date	07/12/2017	Body Style	Hatchback	Last service miles	107,193
Year	2017	Keys	1	MOT Due	06/12/2026
Mileage	121,562 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	PETROL	Service documents	Printout	Gears	6
Colour	SILVER	Number of stamps	10	Doors	5
VIN	TMBBR6NH1J4527135	Last service date	27/01/2026		

Last service 27/01/2026 at 107,193 miles- 10 main dealer services


Tyres


NSF	GOODYEAR	2.0mm
NSR	GOODYEAR	3.0mm
OSF	GOODYEAR	2.0mm
OSR	GOODYEAR	3.0mm
Spare		

Features


- Bluetooth connection
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Cruise control
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels

Photos

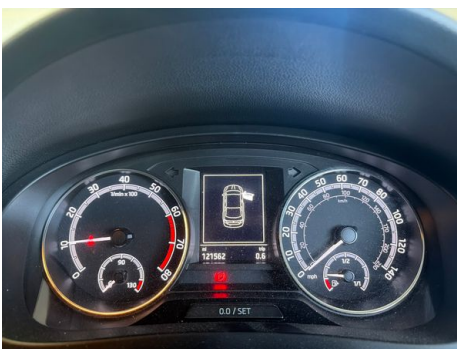

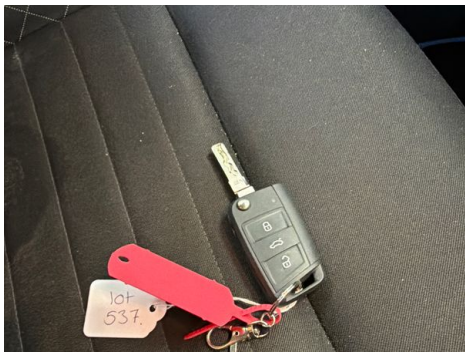

Condition Check

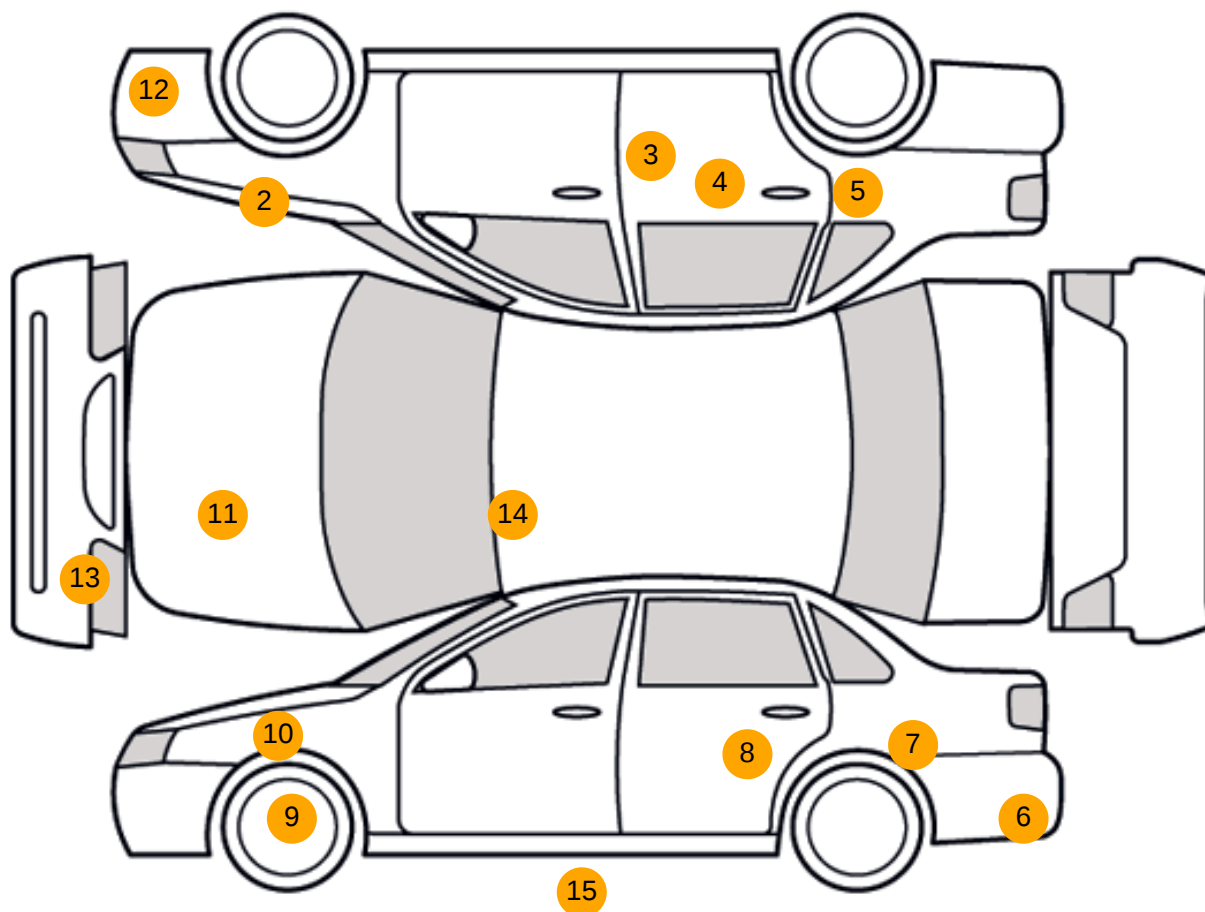

Damage Photos



1: Carpets Front
Scuffed
Over 25mm



2: Wing osf
Chipped
1 To 5



3: Door osf
Chipped
Edge Chip


5: Qtr Panel osr
Dented
2 Or Less UpTo 10mm



4: Door osr
Chipped
1 To 5



6: Bumper Rear
Scratched
Up To 25mm Thru Paint

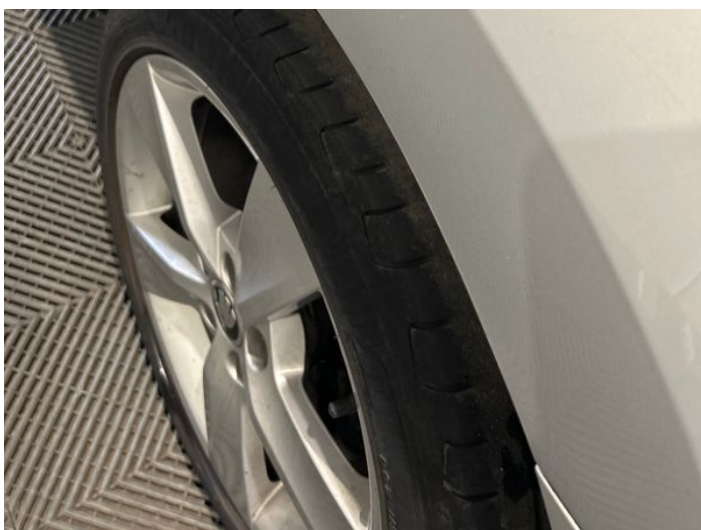

7: Qtr Panel nsr
Dented
Between 10mm + 30mm



8: Door nsr
Dented
Over 30mm




9: Wheel nsf
Scratched
Over 50mm



10: Wing nsf
Chipped
1 To 5



11: Bonnet
Chipped
Multiple Chips

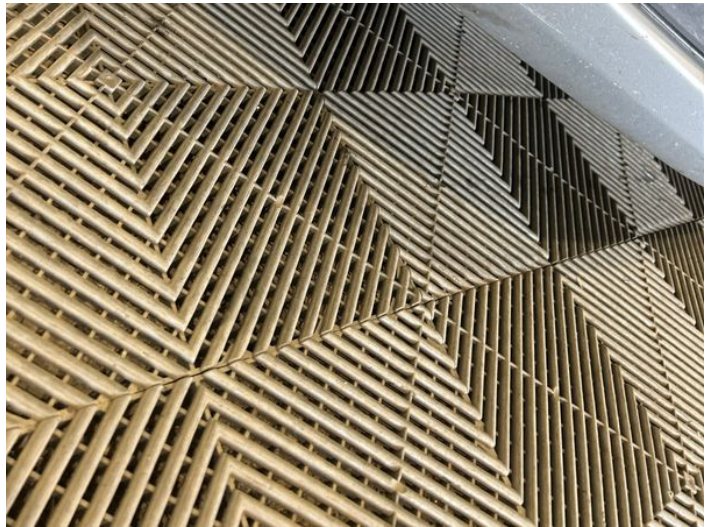

12: Bumper Front
Scratched
25 to 100mm Thru Paint



13: Bumper Front
Chipped
Multiple Chips



14: Roof
Chipped
1 To 5



15: Sill ns
Dented
Over 30mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer
Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	Fault
ABS light illuminated	OK		
Windows	Fault	Radio	OK
		Steering	OK