



VEHICLE INSPECTION REPORT

HY14JUJ

Mini Clubman 1.6 One 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	09/05/2014	Body Style	Estate	Last service miles	60,993
Year	2014	Keys	2	MOT Due	18/08/2026
Mileage	64,649 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	PETROL	Service documents	Printout	Gears	6
Colour	WHITE	Number of stamps	1	Doors	5
VIN	WMWZE32070T580284	Last service date	12/08/2025		

Last service 12/08/2025 at 60,993 miles- 1 service Radio faulty

Tyres


NSF	FALKEN	4.0mm
NSR	FALKEN	5.0mm
OSF	ZEETEX	5.0mm
OSR	FALKEN	5.0mm
Spare		

Features


- Bluetooth connection
- Radio/CD
- Air conditioning
- Height adjustable drivers seat
- Metallic Paint
- Drivers airbag
- Central locking
- PAS
- Body coloured bumpers
- Folding rear seats
- Rear headrests
- 3x3 point rear seat belts
- Passenger airbag
- Remote central locking
- Rear wiper
- Electric door mirrors
- Front electric windows
- Steering wheel rake adjustment
- ABS
- Rear airbags
- Cloth seat trim
- Service indicator
- Roof rails
- Front head restraints
- Steering wheel reach adjustment
- Curtain airbags
- Side airbags
- Alloy wheels

Photos



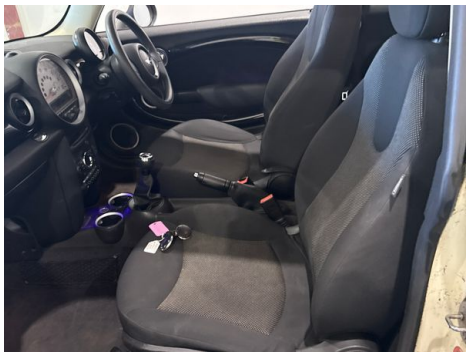

Condition Check

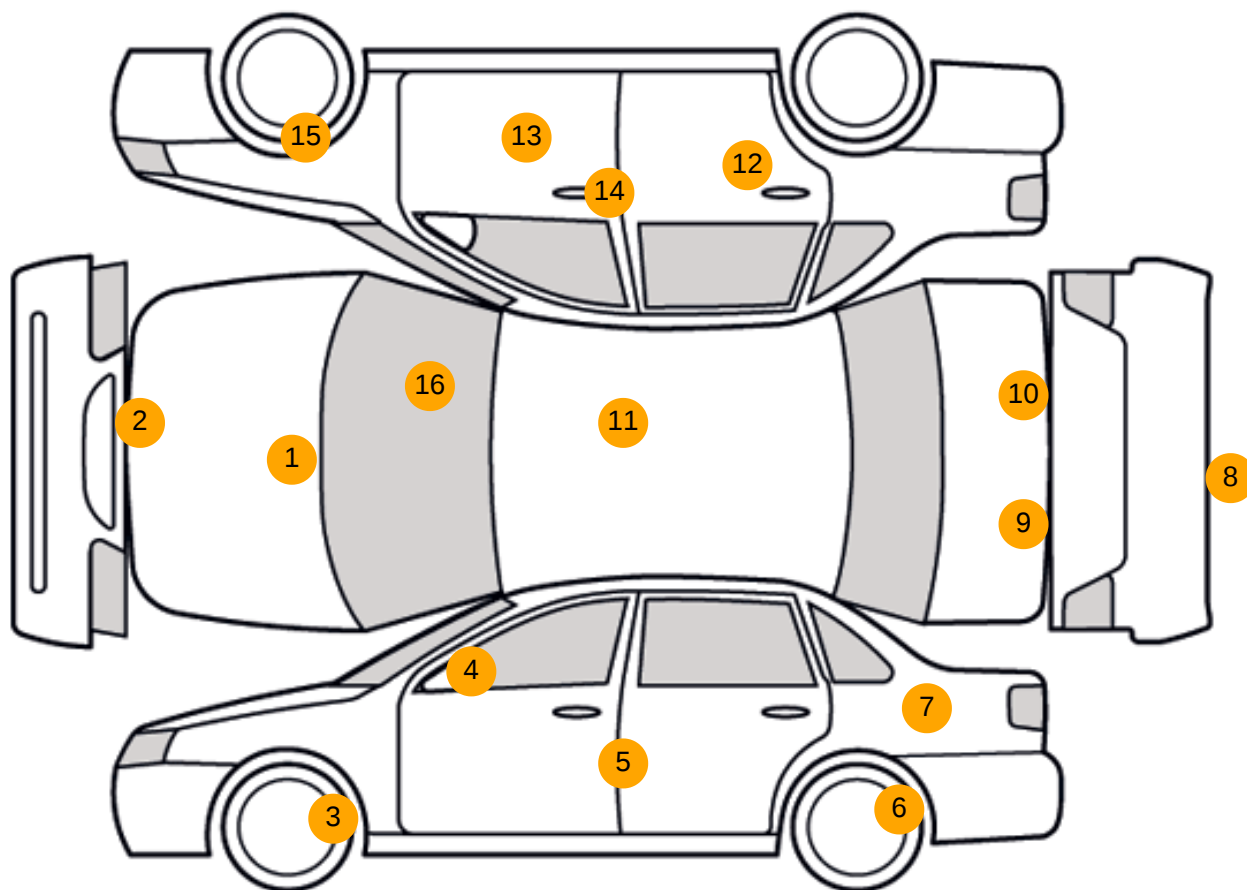

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front Moulding
Broken
Replace



3: Wheel nsf
Scratched
Over 50mm



4: Door Mirror Assy nsf
Scratched (Painted)
Up To 25mm Thru Paint



5: Door nsf
Chipped
Edge Chip



6: Wheel nsr
Scratched
Up To 50mm



7: Qtr Panel Arch Extension ns
Scuffed (Unpainted)
Over 100mm



8: Bumper Rear
Scratched
25 to 100mm Thru Paint



9: Tailgate
Dented
2 Or Less UpTo 10mm



10: Tailgate
Scratched
UpTo 25mm Thru Paint



11: Roof
Dented
Between 10mm + 30mm



12: Door osr
Chipped
Edge Chip



13: Door osf
Dented
Between 10mm + 30mm



14: Door osf
Chipped
Edge Chip



15: Wheel osf
Scratched
Over 50mm



16: Screen Front
Chipped
UpTo 10mm



17: Tyre nsf
Damaged
Replace

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer
 Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
 Additional fees may apply to some vendors.
 Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	Fault
		Steering	OK