



VEHICLE INSPECTION REPORT

DX10UGB

Volkswagen Golf 1.4 TSI SE 5dr DSG

Imported
Inspection

Vehicle	
Serious Damage?	No
VAT	Margin
V5	Present



Details

Reg. date	01/08/2021	Body Style	Estate	Last service miles	63,290
Year	2010	Keys	2	MOT Due	Expired
Mileage	123,434 Miles Warranted	Service history	Yes	Gearbox	SEMI AUTO
Fuel Type	Petrol	Service documents	Service Book	Gears	7
Colour	WHITE	Number of stamps	6		
VIN	WVWZZZ1KZAM679259	Last service date	16/06/2022		

£90 ADDITIONAL FEE

Import - Date of 1st Registration in the UK 01/08/2021

Year of Manufacture- 2010

Last service 16/06/2022 at 63,290 miles- 6 services. Book and print

MOT EXPIRED Roof lining sagged

Tyres

NSF	BUDGET	5.0mm
NSR	BUDGET	6.0mm
OSF	KUMHO	3.0mm
OSR	KUMHO	5.0mm
Spare		

Features


- Bluetooth connection
- Body coloured bumpers
- Front armrest
- Solid Paint
- Traction control
- Alloy wheels
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Central locking
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Remote central locking
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Cloth seat trim

Photos





Condition Check

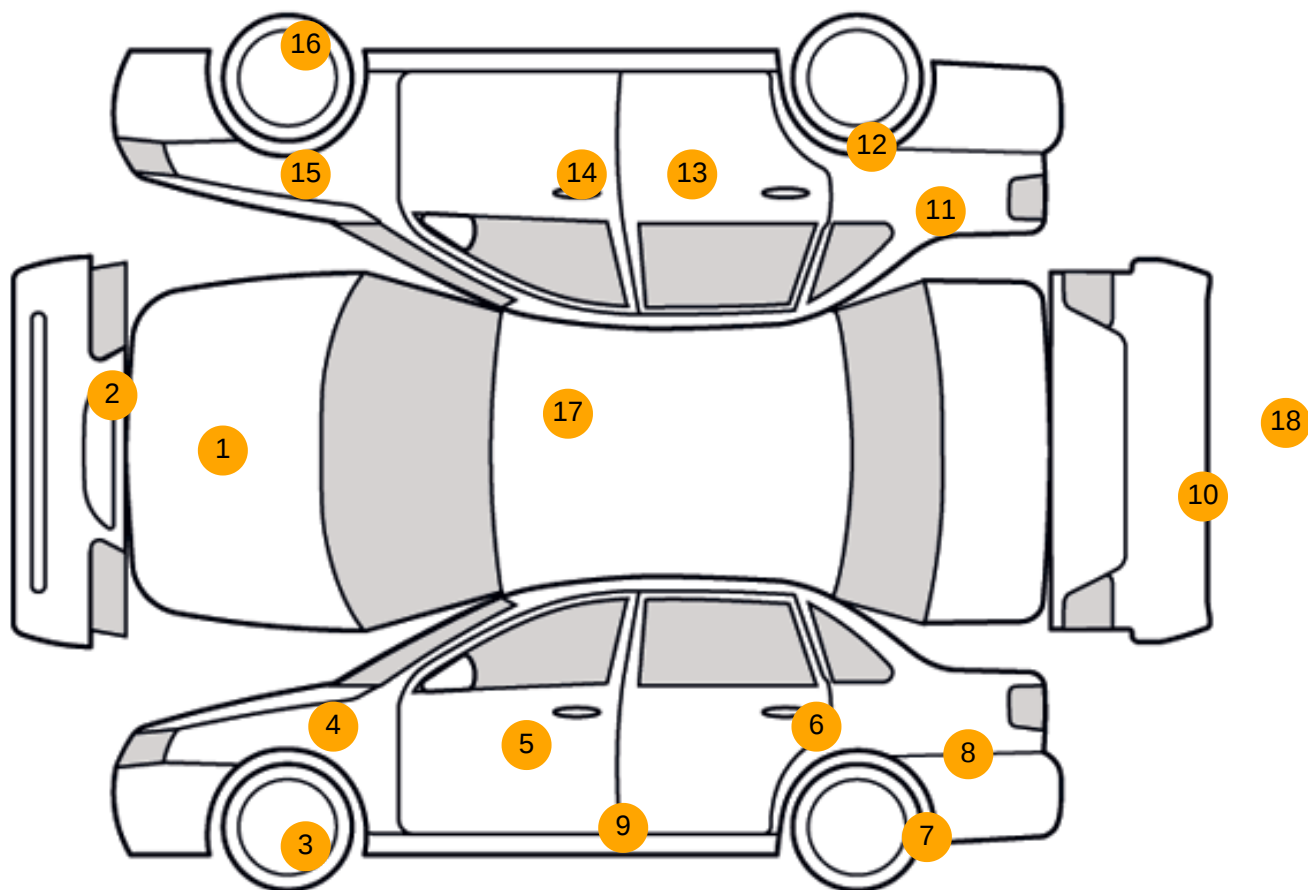

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Chipped
Multiple Chips



3: Wheel nsf
Scratched
Over 50mm



4: Wing osf
Chipped
1 To 5



5: Door nsf
Dented
Over 30mm




6: Door nsr
Chipped
Edge Chip



7: Wheel nsr
Scratched
Over 50mm



8: Qtr Panel nsr
Scratched
Over 25mm Thru Paint

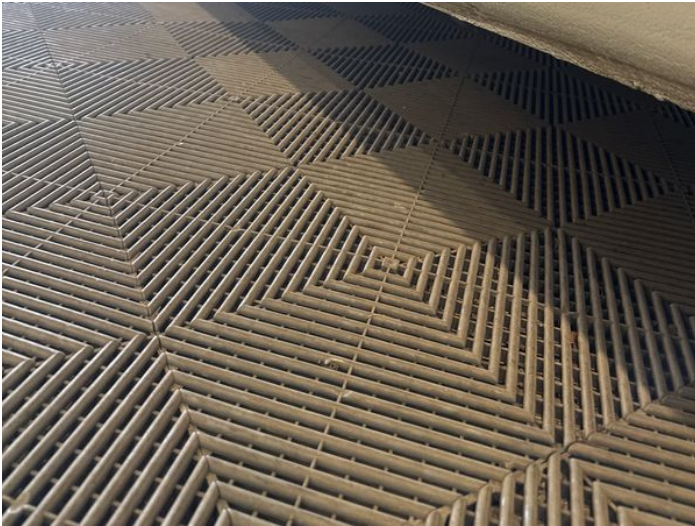

9: Sill ns
Dented
Over 30% Of Panel



10: Bumper Rear
Scratched
Over 100mm Thru Paint



11: Qtr Panel osr
Dented
Between 10mm + 30mm



12: Wheel osr
Scratched
Up To 50mm



13: Door osr
Chipped
1 To 5




14: Door osf
Scratched
Rusted



15: Wing osf
Chipped
1 To 5



16: Wheel osf
Scratched
Over 50mm

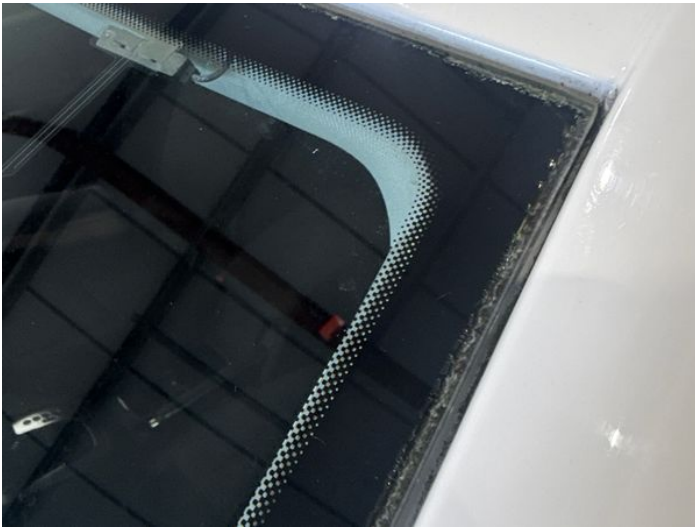

17: Screen Front
Scratched
Over 30mm



18: Rear TowEye Cvr
Missing
Replace

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer
Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK