



VEHICLE INSPECTION REPORT

GJ15WMO

Ford Fiesta 1.25 82 Zetec 5dr

Cat: N Incident History

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
3

Details

Reg. date	23/03/2015	Body Style	Hatchback	Last service miles	88,863
Year	2015	Keys	1	MOT Due	28/03/2027
Mileage	117,591 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	PETROL	Service documents	Printout	Gears	5
Colour	RED	Number of stamps	1	Doors	5
VIN	WF0DXXGAKDFK34112	Last service date	08/12/2023		

£90 ADDITIONAL FEE

Category N Insurance Loss. No Structural Damage and Repairable - Insurer Decided Not to Repair

LAST SERVICE 08/12/2023 @ 88,863 MILES (1 SERVICE) Ignition barrel fault

Engine tappy

Tyres

NSF	FARROAD	5.0mm
NSR	BUDGET	5.0mm
OSF	AUTOGRIP	5.0mm
OSR	BUDGET	5.0mm
Spare		

Features


- Bluetooth connection
- Radio/CD
- Front electric windows
- Drivers airbag
- Central locking
- Rear parking sensor
- Body coloured bumpers
- Rear headrests
- Passenger airbag
- Remote central locking
- Rear wiper
- Electric door mirrors
- Metallic Paint
- Traction control
- Cloth seat trim
- Telephone
- Air conditioning
- ABS
- Tyre pressure monitor
- Alloy wheels

Photos





Condition Check

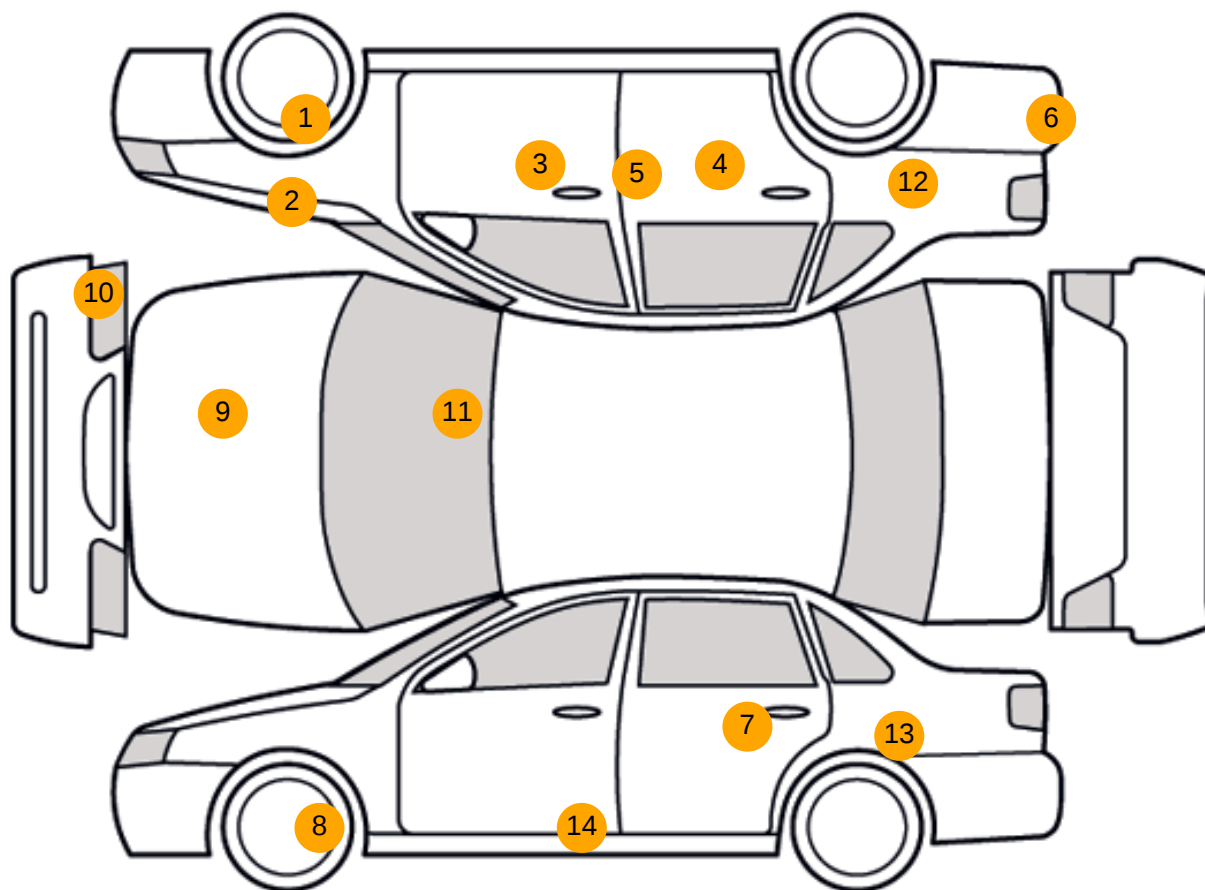

Damage Photos



1: Wheel osf
Scratched
Over 50mm




2: Wing osf
Chipped
1 To 5



3: Door osf
Chipped
1 To 5



4: Door osr
Chipped
1 To 5

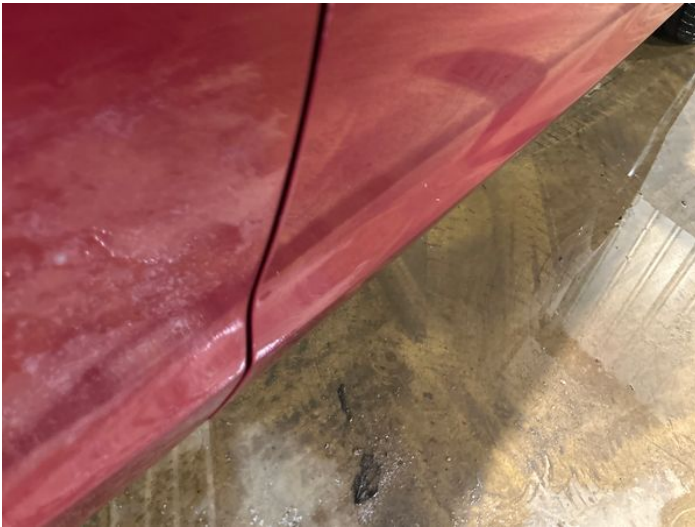

5: Door osf
Chipped
Edge Chip



6: Bumper Rear
Scratched
25 to 100mm Thru Paint



7: Door nsr
Scratched
UpTo 25mm Thru Paint



8: Wheel nsf
Scratched
Up To 50mm



9: Bonnet
Chipped
1 To 5



10: Bumper Front
Chipped
Multiple Chips




11: Screen Front
Chipped
UpTo 10mm



12: Qtr Panel osr
Dented
2 Or Less UpTo 10mm



13: Qtr Panel nsr
Dented
Over 30mm

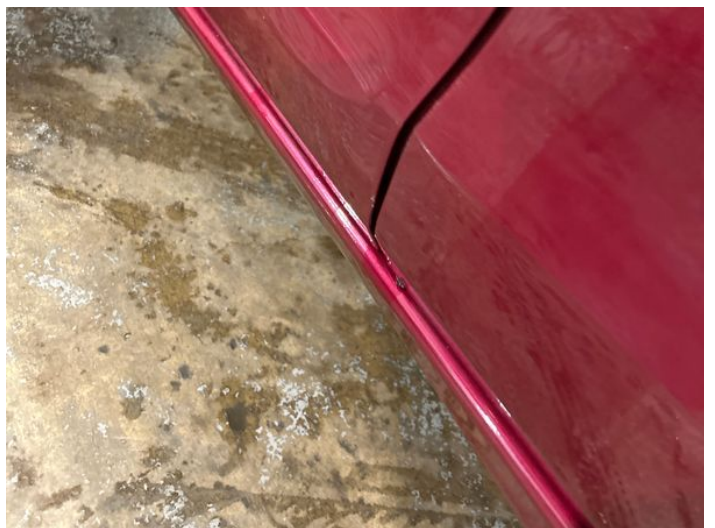

14: Door nsf
Dented
With Paint Damage



15: Seat Base Cover osf
Scuffed
Over 25mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer
Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK