



VEHICLE INSPECTION REPORT

GU19LTJ

Kia Sportage 1.6 CRDi ISG 2 5dr DCT Auto

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	31/05/2019	Body Style	Estate	Last service miles	31,617
Year	2019	Keys	1	MOT Due	05/07/2027
Mileage	86,245 Miles Warranted	Service history	Yes	Gearbox	SEMI AUTO
Fuel Type	DIESEL	Service documents	Printout	Gears	7
Colour	GREY	Number of stamps	1	Doors	5
VIN	U5YPH812VKL715122	Last service date	22/04/2023		

£100 ADDITIONAL FEE

Last service 22/04/2023 at 31,617 miles- 1 main dealer services

Tyres


NSF	TRIANGLE	2.0mm
NSR	BUDGET	4.0mm
OSF	TRIANGLE	Illegal
OSR	TRIANGLE	3.0mm
Spare		

Features


- Bluetooth connection
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Heated front seat
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Navigation system
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Park assist camera
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking

Photos



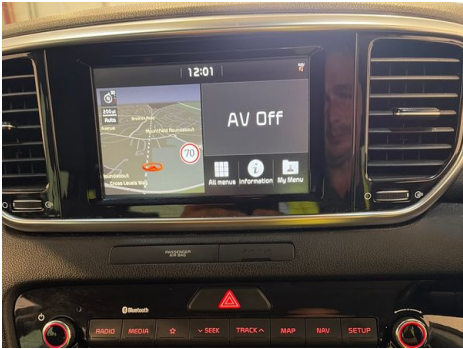

Condition Check

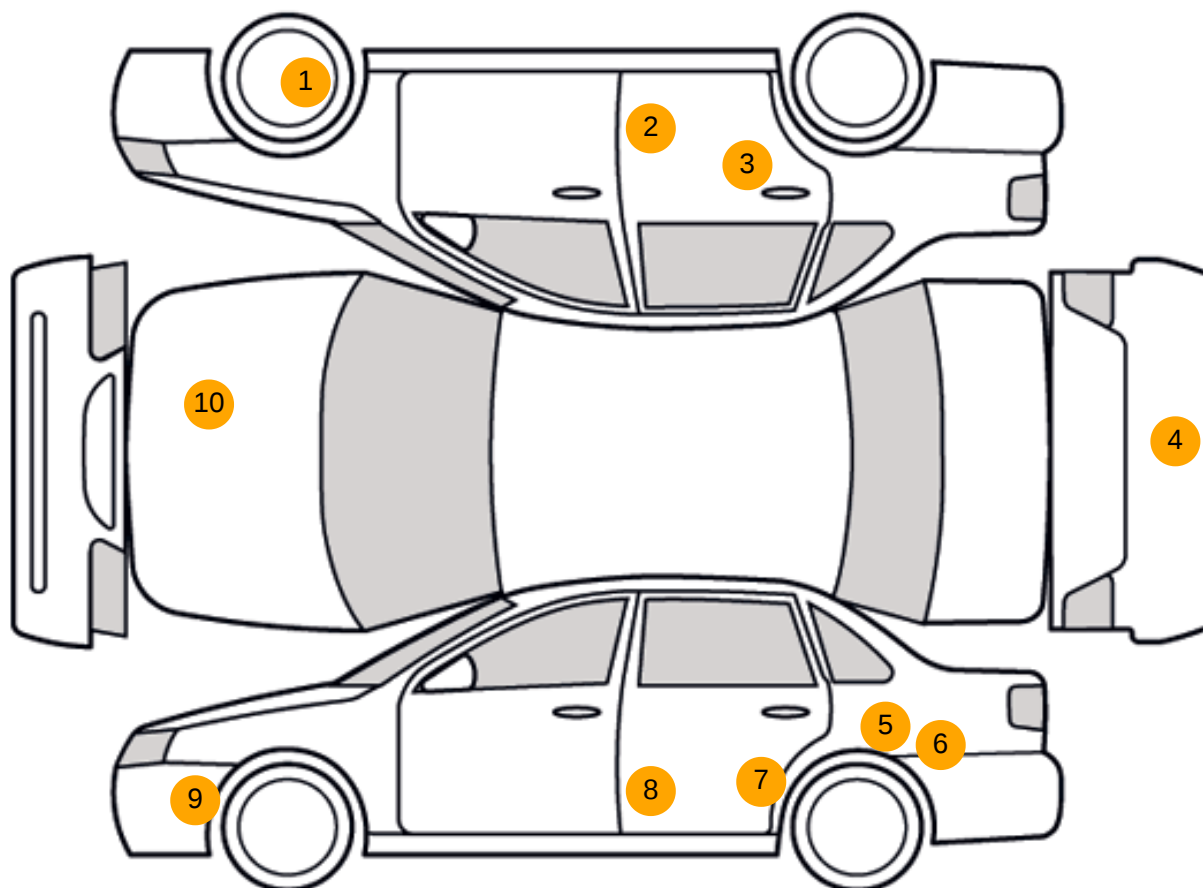

Damage Photos



1: Wheel osf
Corroded
Light



2: Door osf
Chipped
Edge Chip



3: Door osr
Chipped
1 To 5



4: Tailgate
Chipped
1 To 5



5: Qtr Panel nsr
Scratched
UpTo 25mm Thru Paint



6: Qtr Panel nsr
Dented
Between 10mm + 30mm



7: Door nsr
Dented
With Paint Damage



8: Door nsf
Chipped
Edge Chip



9: Bumper Front
Scratched
25 to 100mm Thru Paint

10: Bonnet
Poor Previous Repair
Paint Flake

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	Fault
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK