



VEHICLE INSPECTION REPORT

GX65UGR

Audi A3 1.6 TDI 110 SE Technik 5dr

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
4

Details

Reg. date	04/09/2015	Body Style	Hatchback	Last service miles	117,555
Year	2015	Keys	2	MOT Due	28/07/2027
Mileage	126,924 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	DIESEL	Service documents	Service Book	Gears	6
Colour	BLACK	Number of stamps	8	Doors	5
VIN	WAUZZZ8V7GA028090	Last service date	26/08/2025		

£90 ADDITIONAL FEE

Last Service - 26.08.2025 at 117555 miles (8 services)

Clutch + Fly Wheel Replaced 31.03.2025 @ 112754 miles

Tyres

NSF	BUDGET	5.0mm
NSR	MAXTREK	5.0mm
OSF	FARROAD	5.0mm
OSR	MAXTREK	5.0mm
Spare		

Features


- Bluetooth connection
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Cruise control
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Navigation system
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim

Photos





Condition Check

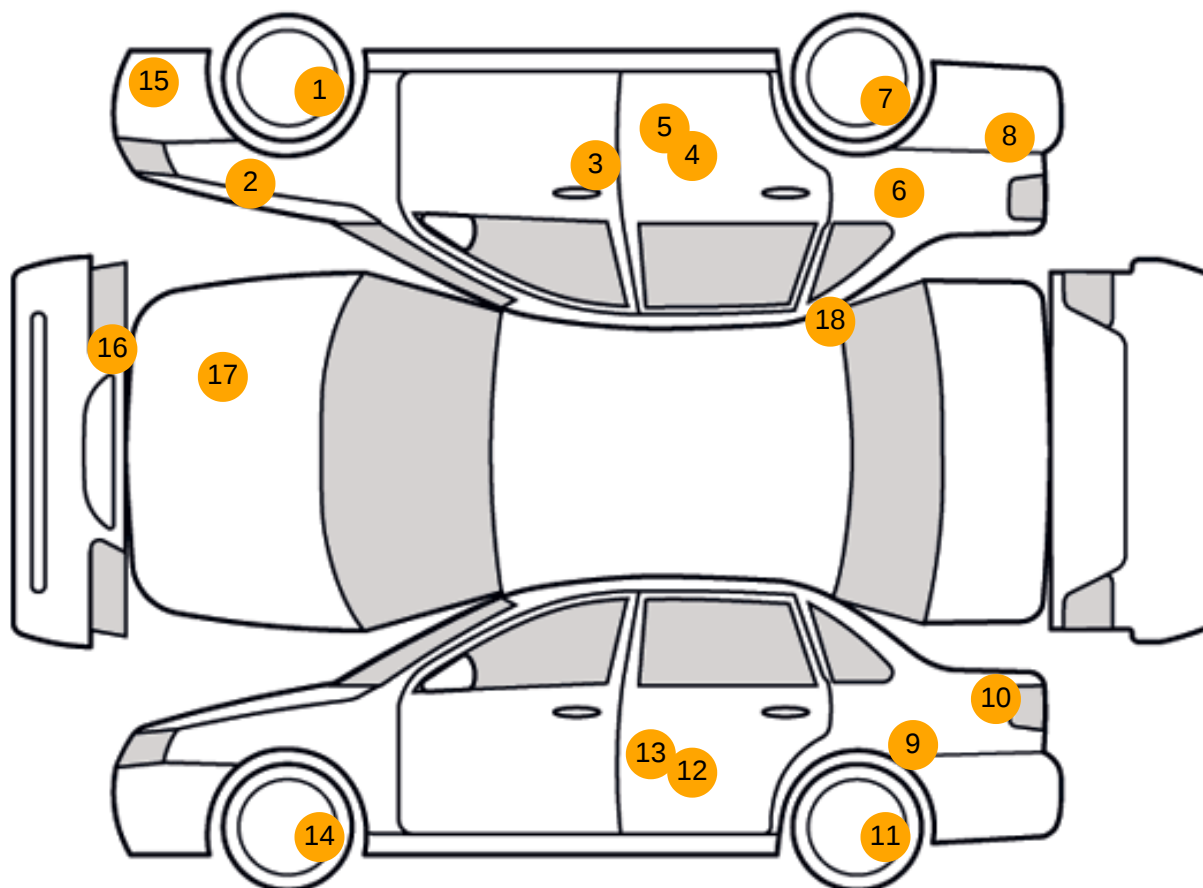

Damage Photos



1: Wheel osf
Scratched
Over 50mm



2: Wing osf
Dented
With Paint Damage



3: Door osf
Chipped
Multiple Chips



4: Door osr
Chipped
1 To 5



5: Door osr
Dented
2 Or Less UpTo 10mm



6: Qtr Panel osr
Dented
Over 30mm



7: Wheel osr
Scratched
Over 50mm



8: Bumper Rear
Dented
With Paint Damage



9: Qtr Panel nsr
Dented
Between 10mm + 30mm



10: Qtr Panel nsr
Scratched
UpTo 25mm Thru Paint



11: Wheel nsr
Scratched
Over 50mm



12: Door nsr
Dented
Between 10mm + 30mm



13: Door nsf
Chipped
Edge Chip



14: Wheel nsf
Scratched
Over 50mm



15: Bumper Front
Scratched
25 to 100mm Thru Paint



16: Bumper Front
Chipped
Multiple Chips



17: Bonnet
Chipped
1 To 5



18: C Post os
Dented
2 Or Less UpTo 10mm



19: Seat Base Cover osf
Holed
Over 3mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK