



# VEHICLE INSPECTION REPORT

**SD18OWF**

## Volkswagen Tiguan Allspace 2.0 TDI 4Motion SE Nav 5dr

| Inspection      |    | Vehicle |         |
|-----------------|----|---------|---------|
| Serious Damage? | No | VAT     | Margin  |
|                 |    | V5      | Present |



### Details

|           |                            |                   |            |         |            |
|-----------|----------------------------|-------------------|------------|---------|------------|
| Reg. date | 14/06/2018                 | Body Style        | Estate     | MOT Due | 05/05/2027 |
| Year      | 2018                       | Keys              | 2          | Gearbox | MANUAL     |
| Mileage   | 123,859 Miles<br>Warranted | Service history   | Yes        | Gears   | 6          |
| Fuel Type | DIESEL                     | Service documents | Printout   | Doors   | 5          |
| Colour    | BLUE                       | Number of stamps  | 4          |         |            |
| VIN       | WVGZZZ5NZJM138152          | Last service date | 20/02/2026 |         |            |

Last Service - 20.02.2026 at unknown miles (4 services) Check oil level message displays on dash  
Ad blue message displayed

### Tyres

|       |          |       |
|-------|----------|-------|
| NSF   | LANDSAIL | 5.0mm |
| NSR   | LANDSAIL | 6.0mm |
| OSF   | LANDSAIL | 5.0mm |
| OSR   | LANDSAIL | 6.0mm |
| Spare |          |       |

## Features


- Bluetooth connection
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Metallic Paint
- Traction control
- Cloth seat trim
- Cruise control
- Rear wiper
- Electric door mirrors
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Front parking sensor
- Telephone
- Air conditioning
- Rear electric windows
- Drivers airbag
- Central locking
- Navigation system
- Radio/CD
- Climate control
- Rear headrests
- Passenger airbag
- Remote central locking

## Photos





## Condition Check

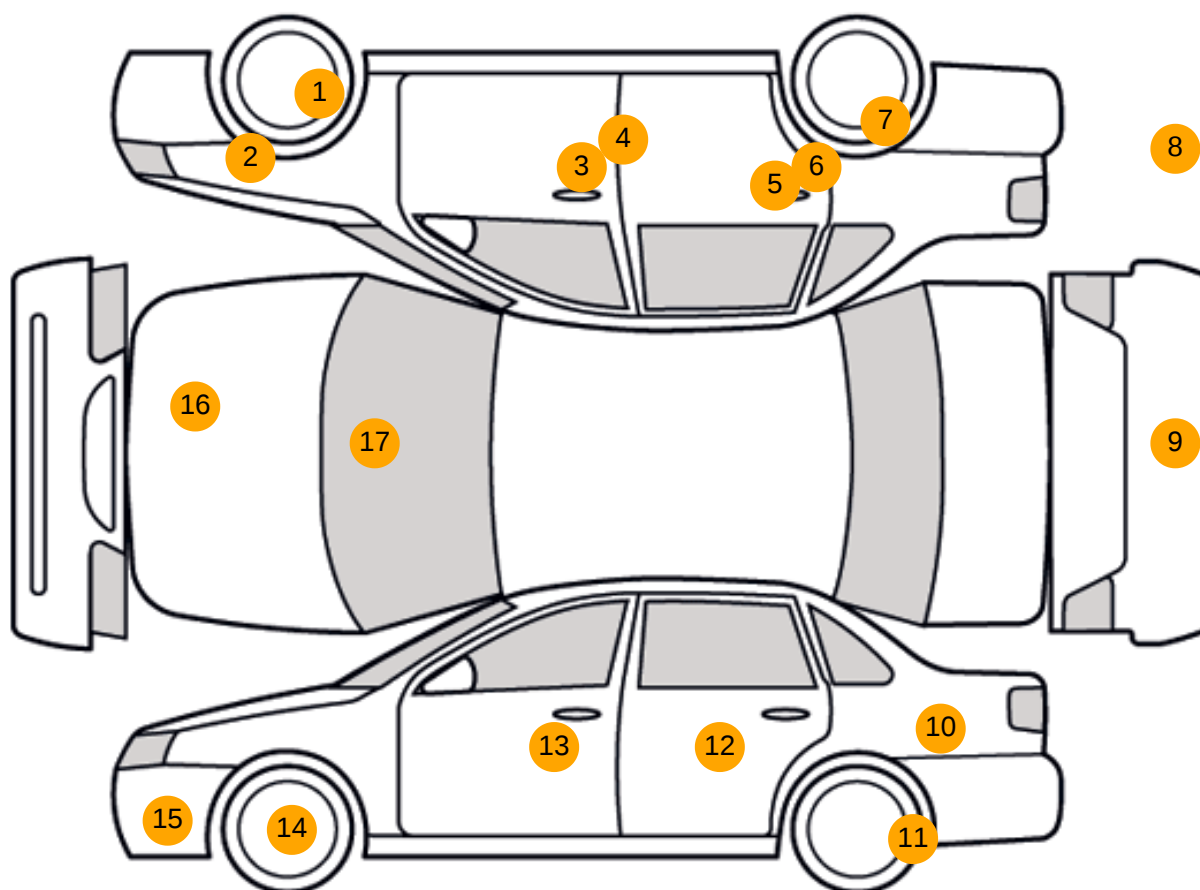

## Damage Photos



1: Wheel ofsf  
Corroded  
Light



2: Wing osf  
Chipped  
1 To 5



3: Door osf  
Chipped  
1 To 5



4: Door osf  
Chipped  
Edge Chip



5: Door osr  
Dented  
2 Or Less UpTo 10mm



6: Door osr  
Chipped  
Edge Chip



7: Wheel osr  
Corroded  
Light



8: Bumper Rear  
Scratched  
Over 100mm Thru Paint



9: Tailgate  
Poor Previous Repair  
Paint Flake



10: Qtr Panel nsr  
Dented  
With Paint Damage



11: Wheel nsr  
Corroded  
Light



12: Door nsr  
Dented  
2 Or Less UpTo 10mm



13: Door nsf  
Chipped  
1 To 5




14: Wheel nsf  
Corroded  
Light



15: Bumper Front  
Scratched  
25 to 100mm Thru Paint

16: Bonnet  
Chipped  
1 To 5

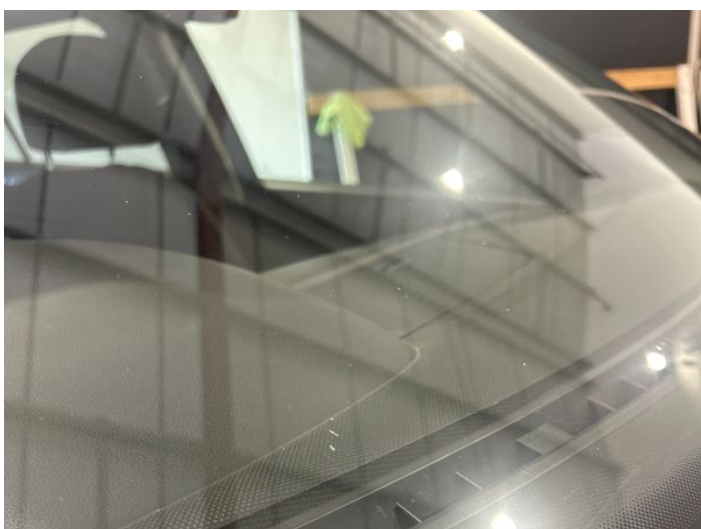

17: Screen Front  
Chipped  
UpTo 10mm

## Interior

**Carpet Condition**  
**Seat Condition**

Average  
Average

**Upholstery Condition**  
**Odour**

Average  
No

## Vehicle Inspection Report

### Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

|                |    |                                                |    |
|----------------|----|------------------------------------------------|----|
| Engine Runs    | OK | Gearbox 1st and Reverse Test                   | OK |
| Brakes         | OK | Clutch Slip Test from Static                   | OK |
| Turbo Boosting | OK | Gearbox Static Gear Selection (engine running) | OK |
| Parking Brake  | OK | No Excessive Smoking                           | OK |

|                          |    |                                     |       |
|--------------------------|----|-------------------------------------|-------|
| EML light illuminated    | OK | Oil warning light illuminated       | Fault |
| Airbag light illuminated | OK | DPF light illuminated               | OK    |
| ABS light illuminated    | OK | Service indicator light illuminated | OK    |
| Windows                  | OK | Radio                               | OK    |
|                          |    | Steering                            | OK    |