



VEHICLE INSPECTION REPORT

GK08CAU

Mini Hatchback 1.6 Cooper 3dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
4

Details

Reg. date	29/04/2008	Colour	SILVER	MOT Due	19/11/2026
Year	2008	VIN	WMWMF32030TV43644	Gearbox	MANUAL
Mileage	69,916 Miles Warranted	Body Style	Hatchback	Gears	6
Fuel Type	PETROL	Service history	None	Doors	3

NO SERVICE HISTORY EML light is on car has been plugged in and detects camshaft position sensor a circuit low input
Boot will not close properly
Oil leak
Roof open a bit then stops

Tyres


NSF	BUDGET	6.0mm
NSR	BUDGET	5.0mm
OSF	BUDGET	4.0mm
OSR	BUDGET	5.0mm
Spare		

Photos






Condition Check

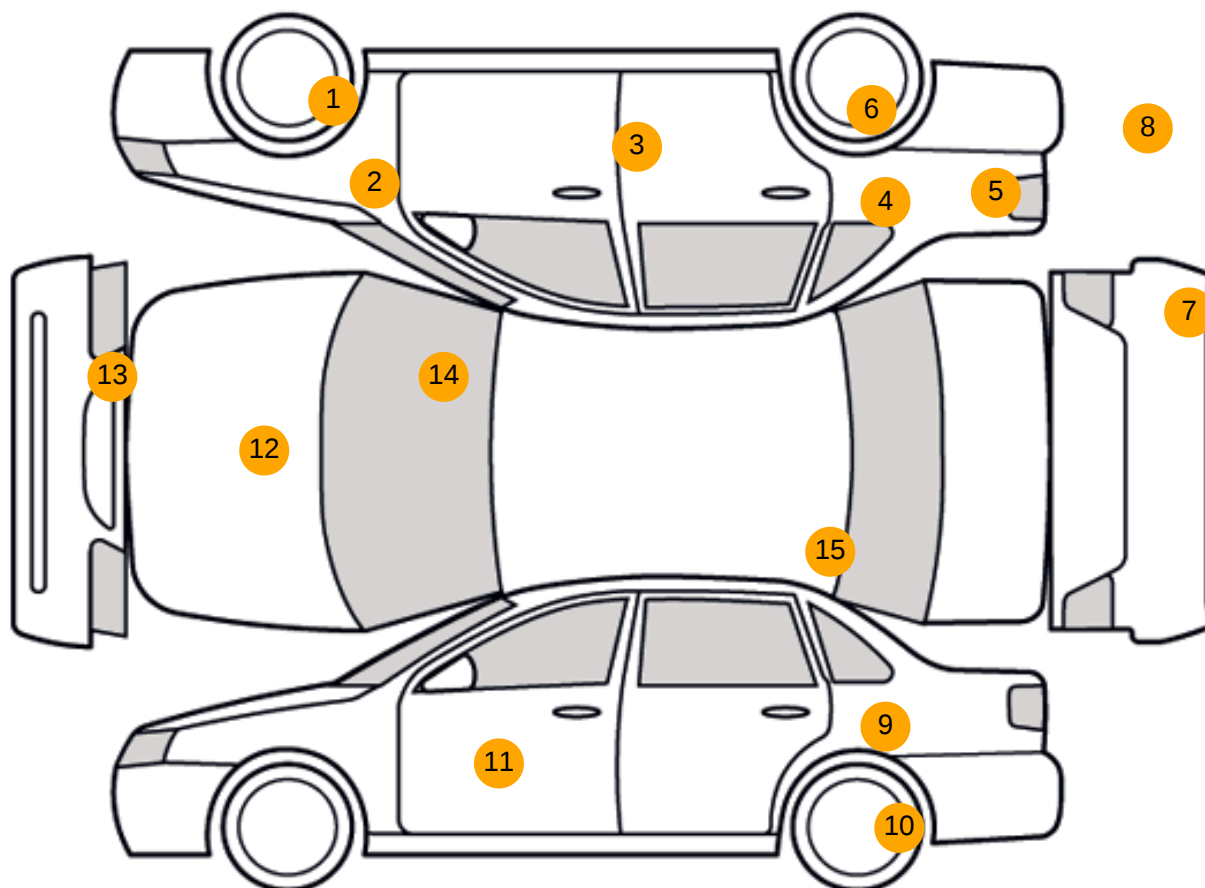

Damage Photos



1: Wheel osf
Scratched
Over 50mm

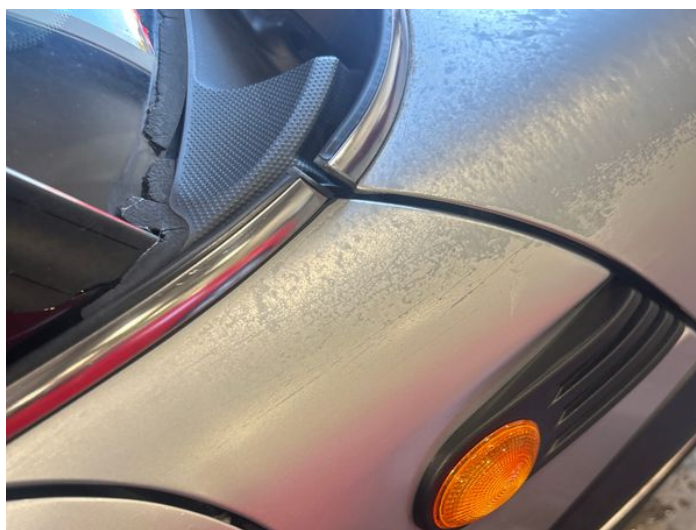

2: Wing osf
Poor Previous Repair
Paint Flake



3: Door osf
Dented
Over 30mm



4: Qtr Panel osr
Chipped
1 To 5



5: Qtr Panel osr
Dented
Between 10mm + 30mm



6: Wheel osr
Scratched
Over 50mm



7: Tailgate
Poor Previous Repair
Poor Paint




8: Bumper Rear
Chipped
Multiple Chips



9: Qtr Panel nsr
Dented
Over 30mm



10: Wheel nsr
Scratched
Over 50mm

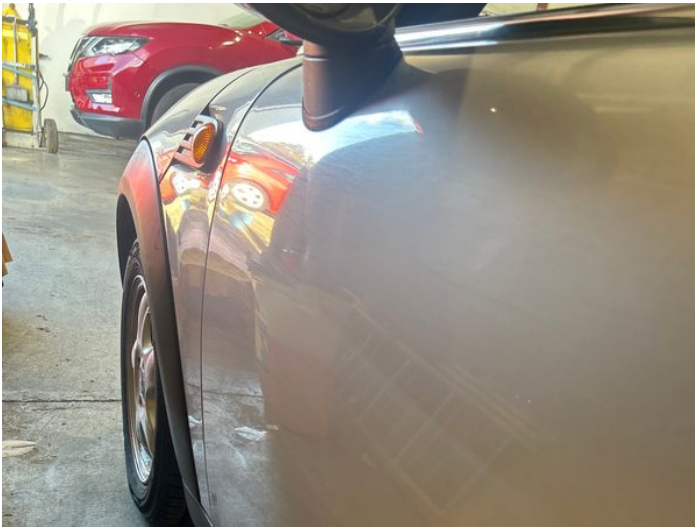


11: Door nsf
Dented
Over 30mm



12: Bonnet
Poor Previous Repair
Paint Flake



13: Bumper Front
Chipped
Multiple Chips

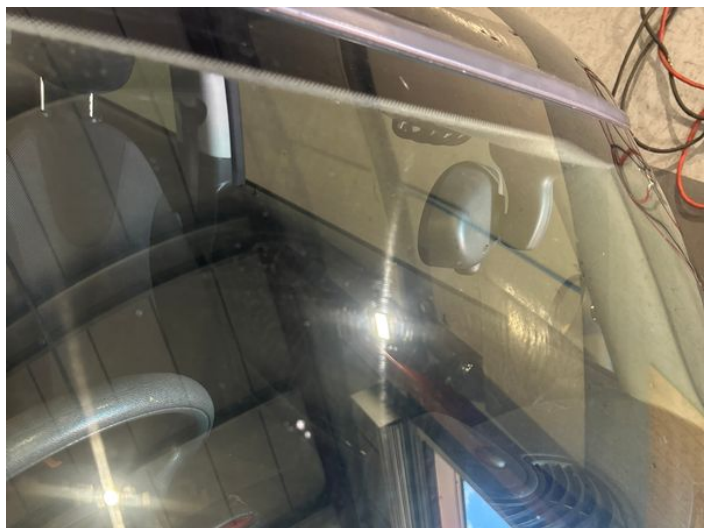

14: Screen Front
Chipped
UpTo 10mm



15: Roof
Chipped
1 To 5

Interior

Carpet Condition	-	Upholstery Condition	-
Seat Condition	-	Odour	-

Vehicle Inspection Report

Disclaimer
 Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
 Additional fees may apply to some vendors.
 Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	Fault	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Roof / sunroof	Fault	Radio	OK
Windows	OK	Steering	OK