



VEHICLE INSPECTION REPORT

FG62MZJ

Toyota Avensis 2.0 D-4D T2 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	17/10/2012	Body Style	Estate	Last service miles	60,961
Year	2012	Keys	2	MOT Due	29/09/2026
Mileage	109,441 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	DIESEL	Service documents	Printout	Gears	6
Colour	BLUE	Number of stamps	1	Doors	5
VIN	SB1ED76L40E103787	Last service date	29/09/2016		

LAST SERVICE 29/06/2016 @ 60,961 MILES (1 SERVICE)

Tyres

NSF	GOODYEAR	5.0mm
NSR	MICHELIN	5.0mm
OSF	AUTOGREEN	5.0mm
OSR	MICHELIN	5.0mm
Spare		

Features


- Rear wiper
- Electric door mirrors
- Front electric windows
- Drivers airbag
- Remote central locking
- Telephone
- Air conditioning
- Rear headrests
- Passenger airbag
- Cloth seat trim
- Radio/CD
- Climate control
- Metallic Paint
- Traction control
- Steel wheels
- Body coloured bumpers
- Front armrest
- ABS
- Central locking

Photos






Condition Check

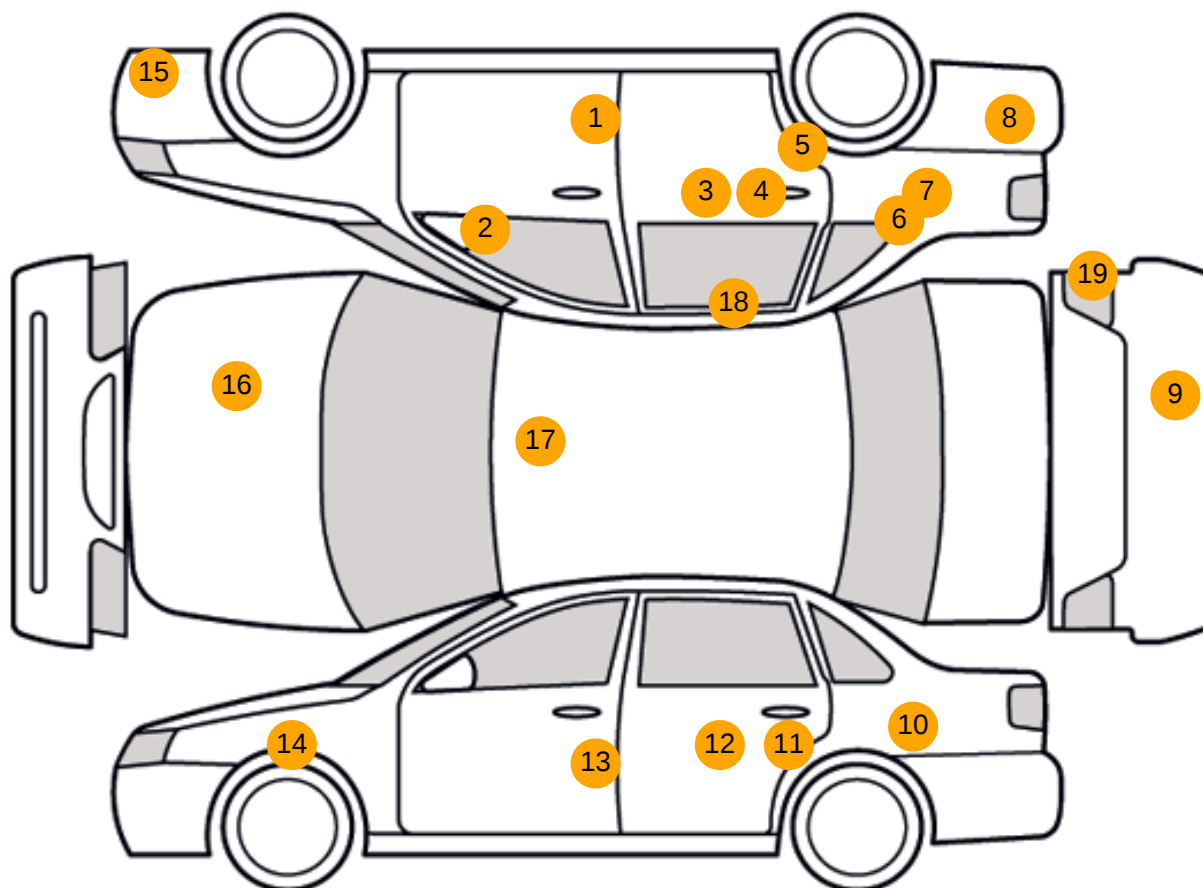

Damage Photos

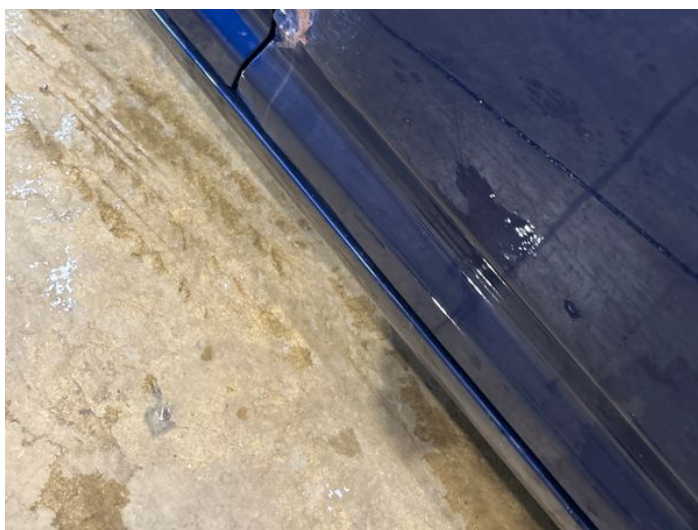

1: Door osf
Dented
With Paint Damage



2: Door Mirror Assy osf
Broken
Replace



3: Door osr
Chipped
1 To 5




4: Door osr
Dented
Between 10mm + 30mm



5: Door osr
Chipped
Edge Chip



6: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint

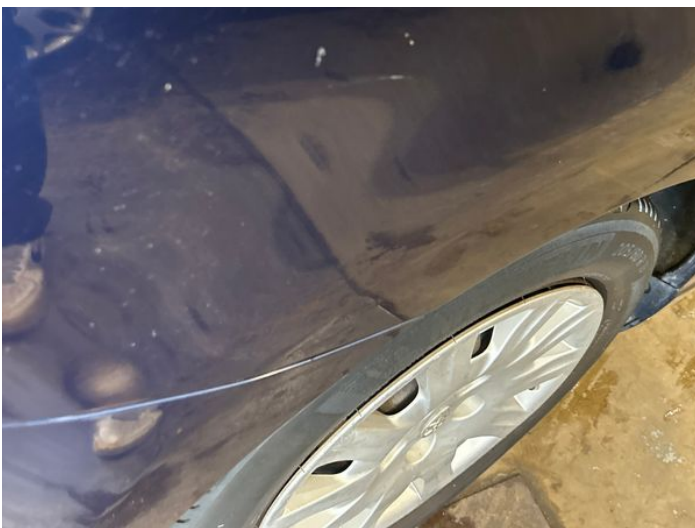

7: Qtr Panel osr
Chipped
1 To 5



8: Bumper Rear
Scratched
Over 100mm Thru Paint



9: Tailgate
Chipped
1 To 5



10: Qtr Panel nsr
Scratched
UpTo 25mm Thru Paint



11: Door nsr
Scratched
UpTo 25mm Thru Paint



12: Door nsr
Chipped
1 To 5



13: Door nsf
Chipped
Multiple Chips




14: Wing nsf
Chipped
1 To 5



15: Bumper Front
Poor Previous Repair
Paint Flake



16: Bonnet
Chipped
Over 5mm

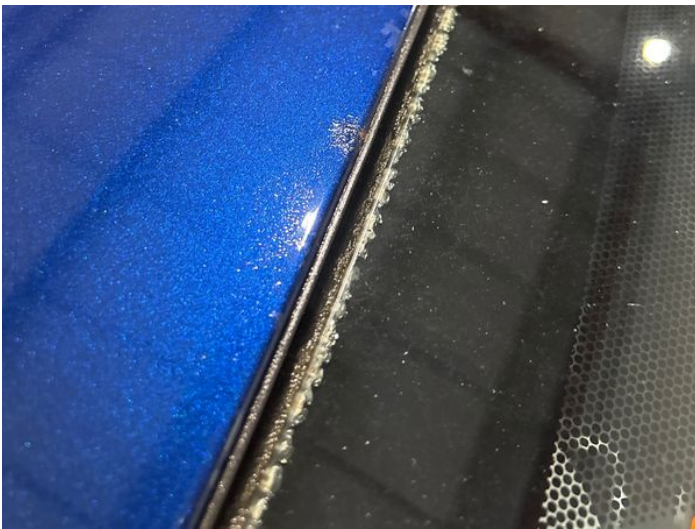

17: Roof
Rusted
UpTo 5mm



18: C Post os
Dented
2 Or Less UpTo 10mm



19: Lamp osr
Broken
Replace

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	Fault
Windows	OK	Radio	OK
		Steering	OK