



VEHICLE INSPECTION REPORT

MT14LTK

Audi A7 3.0 BiTDI Quattro 313 Black Ed 5dr Tip Auto [5st]

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present

nama
GRADE
3

Details

Reg. date	20/06/2014	Body Style	Hatchback	Last service miles	89,700
Year	2014	Keys	2	MOT Due	04/02/2027
Mileage	92,856 Miles Warranted	Service history	Yes	Gearbox	AUTOMATIC
Fuel Type	DIESEL	Service documents	Service Book	Gears	8
Colour	BLACK	Number of stamps	9	Doors	5
VIN	WAUZZZ4G2EN163992	Last service date	17/01/2026		

LAST SERVICE 17/01/2026 @ 89,700 MILES (9 SERVICES) Sat nav will not load map

Tyres


NSF	CONTINENTAL	2.0mm
NSR	BUDGET	4.0mm
OSF	CONTINENTAL	2.0mm
OSR	BUDGET	4.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Radio/CD
- Climate control
- Front electric windows
- ABS
- Tyre pressure monitor
- Alloy wheels
- Cruise control
- Park assist camera
- Body coloured bumpers
- Electrically adjustable drivers seat
- Rear electric windows
- Drivers airbag
- Central locking
- Front parking sensor
- Rear parking sensor
- Electric door mirrors
- Electrically adjustable passenger seat
- Rear headrests
- Passenger airbag
- Remote central locking
- Heated front seat
- Telephone
- Air conditioning
- Front armrest
- Metallic Paint
- Traction control
- Leather seat trim

Photos



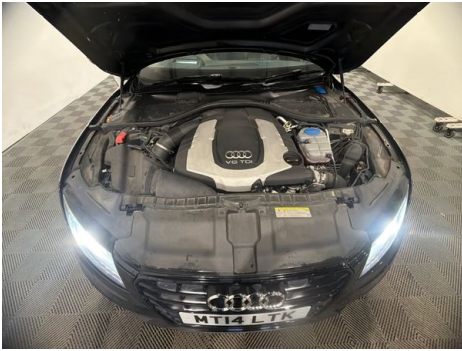


Condition Check

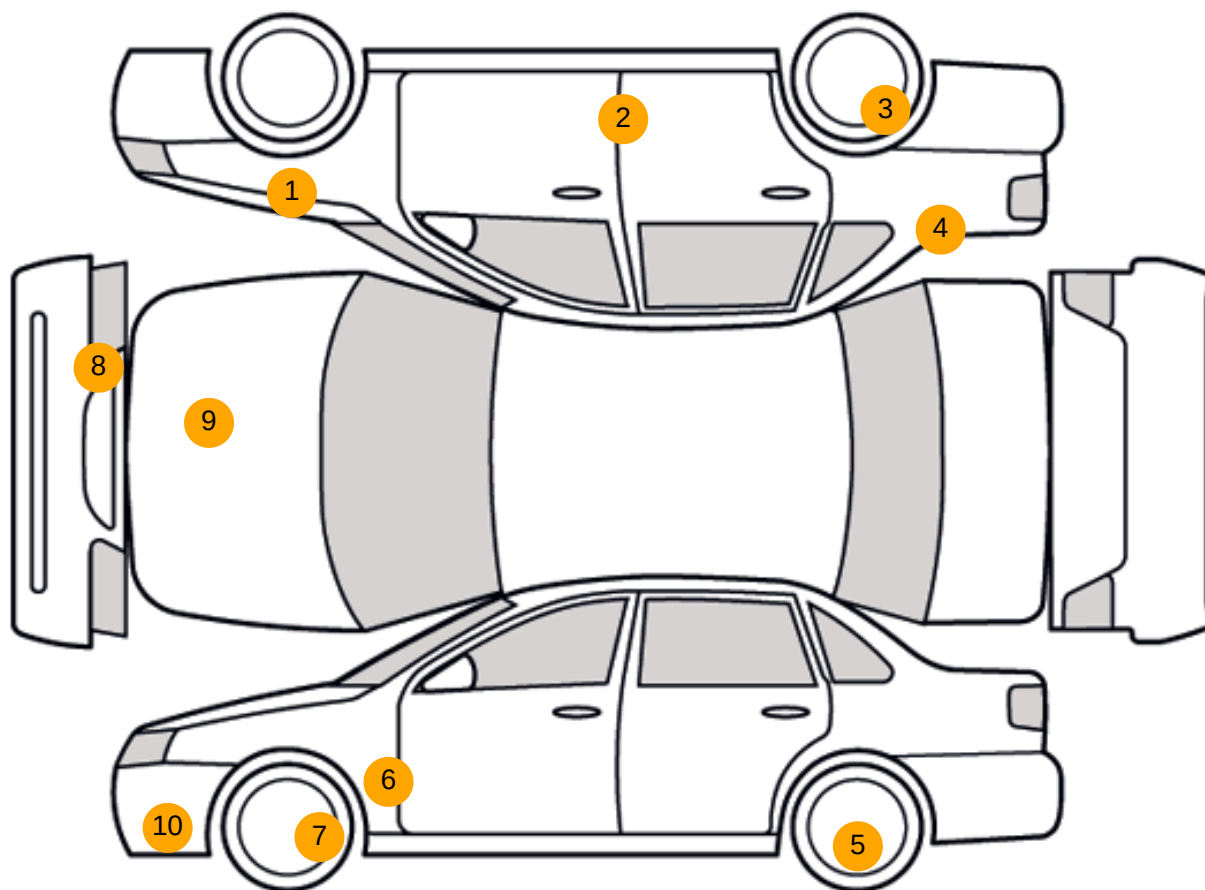

Damage Photos



1: Wing osf
Chipped
1 To 5

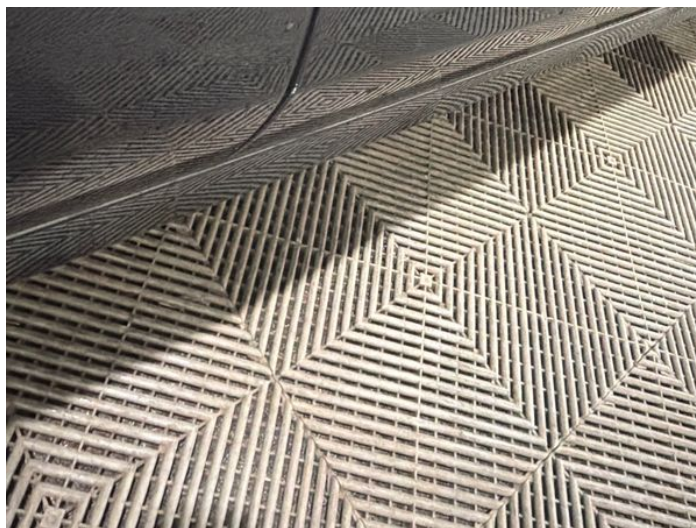

2: Door osf
Chipped
Edge Chip




3: Wheel osr
Corroded
Light



4: Qtr Panel osr
Dented
With Paint Damage



5: Wheel nsr
Corroded
Light

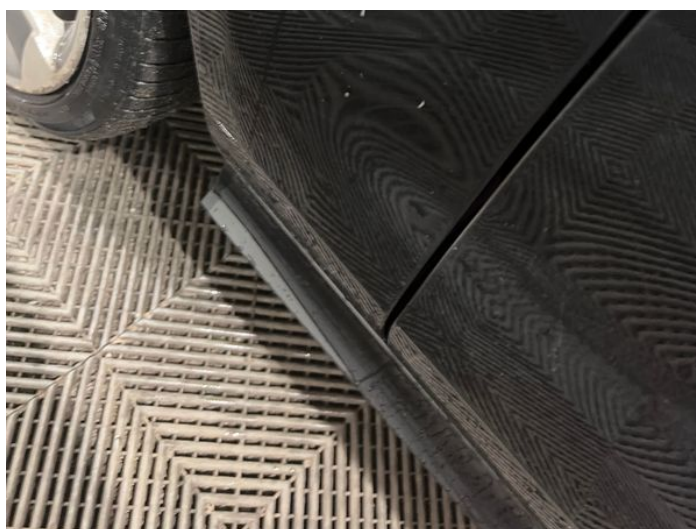

6: Wing nsf
Chipped
1 To 5



7: Wheel nsf
Scratched
Over 50mm



8: Bumper Front
Chipped
Multiple Chips



9: Bonnet
Chipped
Multiple Chips



10: Bumper Front
Scratched
25 to 100mm Thru Paint

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	Fault
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK