



VEHICLE INSPECTION REPORT

LX12TTF

Nissan Note 1.6 N-Tec+ 5dr Auto

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
5

Details

Reg. date 29/03/2012

Year 2012

Mileage 142,974 Miles
Warranted

Fuel Type PETROL

Colour BLACK

VIN SJNFCAE11U2157345

Body Style MPV

Keys 1

Service history Yes

Service documents Service Book

Number of stamps 3

Last service date 22/06/2015

Last service miles 52,742

MOT Due 08/11/2026

Gearbox AUTOMATIC

Gears 4

Doors 5

Last Service - 22.06.2015 at 52742 miles (3 Services) Exhaust blowing
Osr window does not work

Tyres

NSF ROVELO 5.0mm

NSR ROVELO 5.0mm

OSF WESTLAKE Illegal

OSR FIREMAX 5.0mm

Spare

Features


- Bluetooth connection
- Rear wiper
- Electric door mirrors
- Rear headrests
- Passenger airbag
- Cloth seat trim
- Cruise control
- Telephone
- Air conditioning
- Solid Paint
- Traction control
- Leather seat trim
- Navigation system
- Radio/CD
- Front electric windows
- ABS
- Central locking
- Alloy wheels
- Rear parking sensor
- Body coloured bumpers
- Rear electric windows
- Drivers airbag
- Remote central locking

Photos





Condition Check

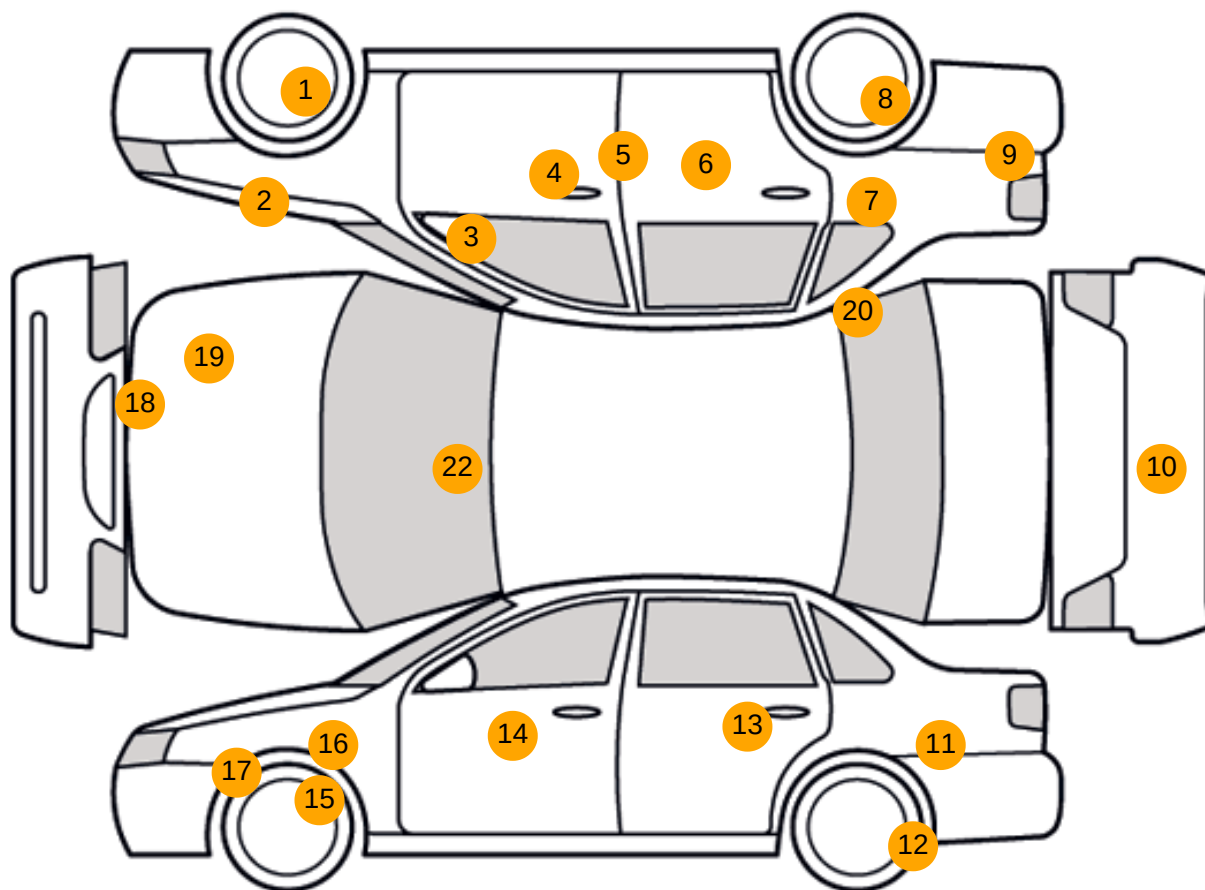

Damage Photos



1: Wheel of
Corroded
Light



2: Wing of
Chipped
1 To 5



3: Door Mirror Assy osf
Missing
Replace



4: Door osf
Chipped
1 To 5



5: Door osf
Chipped
Edge Chip



6: Door osr
Chipped
Multiple Chips



7: Qtr Panel osr
Scratched
Over 25mm Thru Paint



8: Wheel osr
Corroded
Light



9: Bumper Rear
Poor Previous Repair
Paint Flake



10: Tailgate
Dented
With Paint Damage




11: Qtr Panel nsr
Dented
Over 30mm



12: Wheel nsr
Corroded
Light



13: Door nsr
Scratched
Over 25mm Thru Paint

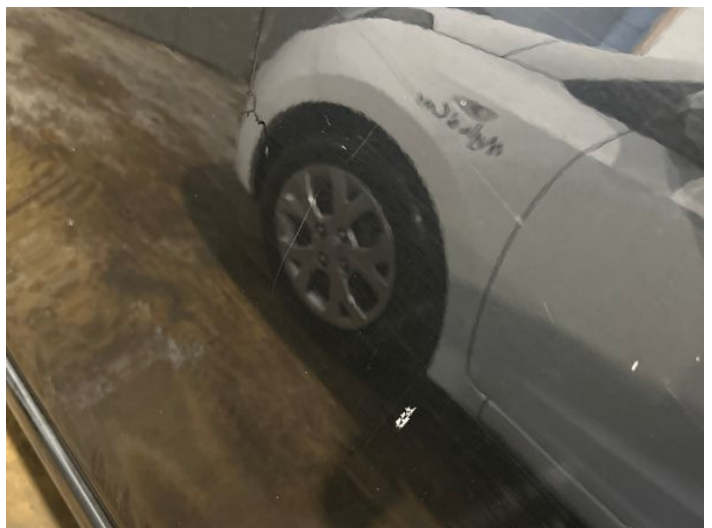

14: Door nsf
Chipped
1 To 5



15: Wheel nsf
Corroded
Light



16: Wing nsf
Hole
UpTo 10mm



17: Bumper Front
Insecure
Action Required



18: Bumper Front
Poor Previous Repair
Paint Flake



19: Bonnet
Chipped
1 To 5



20: D Post os
Dented
2 Or Less UpTo 10mm



21: Seat Base Cover osf
Torn
Over 3mm

22: Screen Front
Chipped
Over 10mm

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	Fault	Radio	OK
Sat nav	OK	Steering	OK