



VEHICLE INSPECTION REPORT

OV59XJK

Audi A6 S6 FSI Quattro 5dr Tip Auto

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 TBC

nama
GRADE
2

Details

Reg. date	11/02/2010	VIN	WAUZZZ4F2AN049444	CAP Average	£4,550.00
Year	2010	Body Style	Estate	CAP Below	£3,825.00
Mileage	118,127 Miles Warranted	Keys	2	Gearbox	AUTOMATIC
Fuel Type	Petrol	MOT Due	26/01/2026	Gears	6
Colour	GREY	CAP Clean	£5,250.00		


Tyres

NSF	MICHELIN	4.0mm
NSR	MICHELIN	4.0mm
OSF	MICHELIN	4.0mm
OSR	MICHELIN	4.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Audio remote control
- Air conditioning
- Front armrest
- Rear electric windows
- ABS
- Side airbags
- Partial leather seat trim
- Cruise control
- PAS
- Radio/CD
- Climate control
- Front electric windows
- Rear headrests
- Drivers airbag
- Traction control
- Alloy wheels
- Front parking sensor
- Rear parking sensor
- Body coloured bumpers
- Electrically adjustable drivers seat
- Front head restraints
- Metallic Paint
- Isofix child seat anchor points
- Central locking
- Heated front seat
- Steering wheel mounted controls
- Electric door mirrors
- Electrically adjustable passenger seat
- Height adjustable drivers seat
- 3x3 point rear seat belts
- Passenger airbag
- Remote central locking

Photos

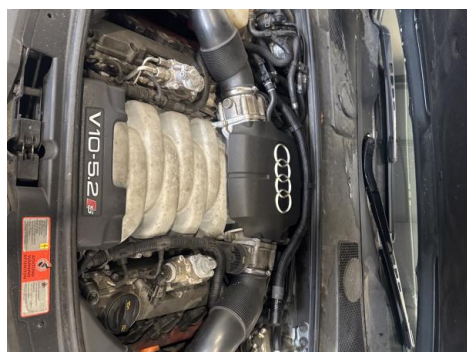



Condition Check

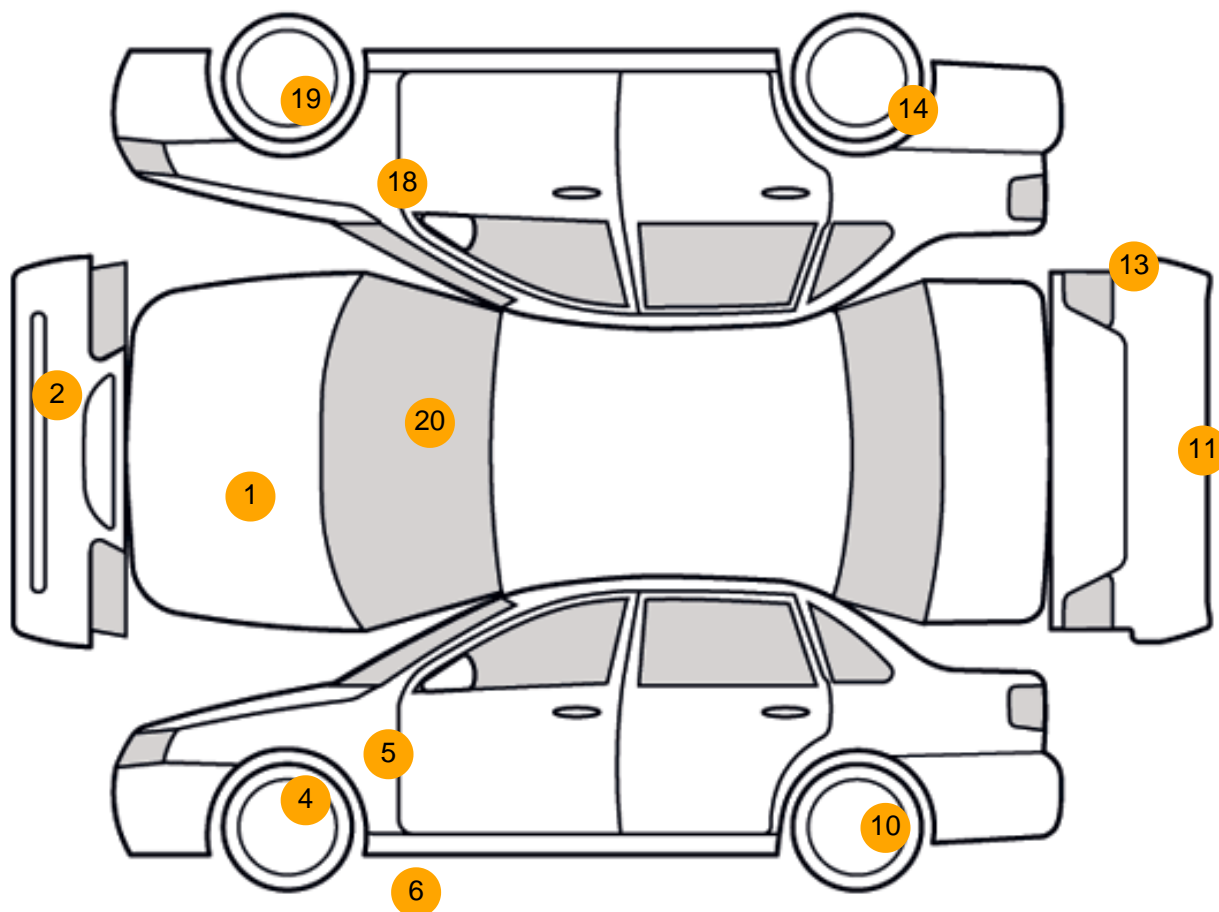

Damage Photos



1: Bonnet
Chipped
1 To 5



2: Bumper Front
Scratched
25 to 100mm Thru Paint

No Image



3: Bumper Front
Scratched
Over 25mm Not Thru Paint

4: Wheel nsf
Scratched
Over 50mm



5: Wing nsf
Rusted
UpTo 5mm



6: Sill ns
Scratched
UpTo 25mm Thru Paint

No Image

7: Door nsf
Scratched
Over 25mm Not Thru Paint

No Image

8: Door nsr
Scratched
Over 25mm Not Thru Paint

No Image

9: Qtr Panel nsr
Scratched
Over 25mm Not Thru Paint



10: Wheel nsr
Scratched
Over 50mm



11: Bumper Rear
Chipped
Multiple Chips

No Image

12: Bumper Rear
Scratched
Over 25mm Not Thru Paint



13: Other
N/A
N/A



14: Wheel osr
Scratched
Over 50mm

No Image

15: Qtr Panel osr
Scratched
Over 25mm Not Thru Paint

No Image

16: Door osr
Scratched
Over 25mm Not Thru Paint

No Image


17: Door osf
Scratched
Over 25mm Not Thru Paint



18: Wing osf
Chipped
1 To 5



19: Wheel osf
Scratched
Over 50mm

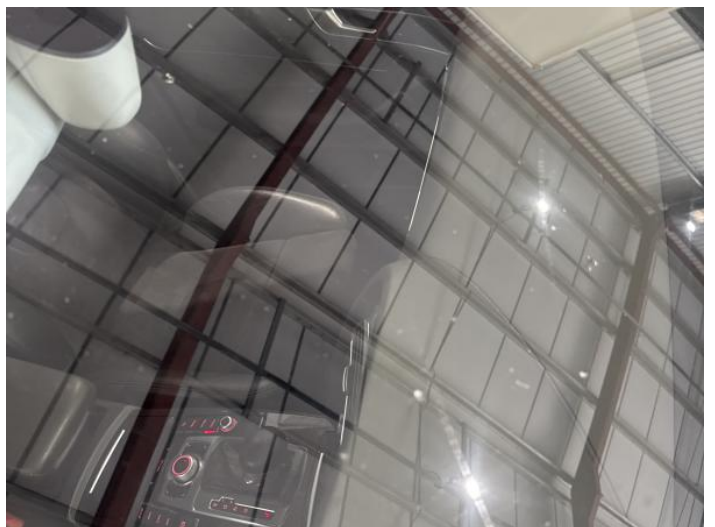

20: Screen Front
Chipped
UpTo 10mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK