

VEHICLE INSPECTION REPORT

YD13EDK

Peugeot 208 1.2 VTi Intuitive 3dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	TBC



Details

Reg. date	21/03/2013	VIN	VF3CAHMZ0DW007787	CAP Average	£1,400.00
Year	2013	Body Style	Hatchback	CAP Below	£1,000.00
Mileage	70,201 Miles Warranted	Keys	1	Gearbox	MANUAL
Fuel Type	Petrol	MOT Due	16/02/2026	Gears	5
Colour	WHITE	CAP Clean	£1,800.00	Doors	3

Radio does not work



Tyres

NSF	LAUFENN	6.0mm
NSR	AVON	3.0mm
OSF	LAUFENN	5.0mm
OSR	AVON	4.0mm
Spare		

Features


- Bluetooth connection
- Body coloured bumpers
- Climate control
- Solid Paint
- Traction control
- Leather seat trim
- Cruise control
- Electric door mirrors
- Front armrest
- ABS
- Central locking
- Alloy wheels
- Rear wiper
- Fixed panoramic glass roof
- Front electric windows
- Drivers airbag
- Remote central locking
- Radio/CD
- Air conditioning
- Rear headrests
- Passenger airbag
- Cloth seat trim

Photos

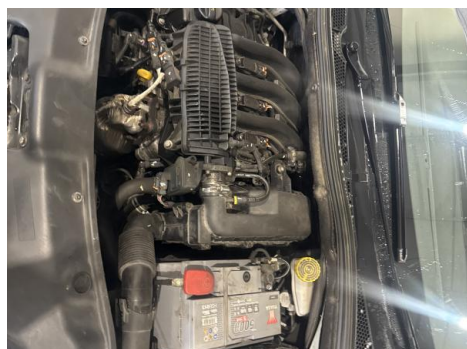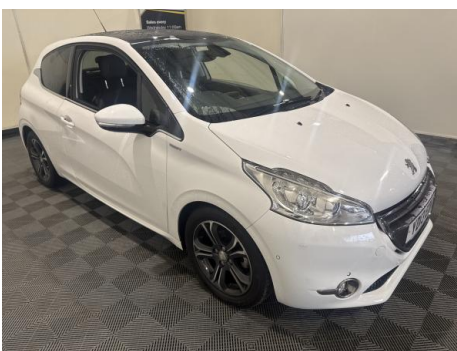



Condition Check

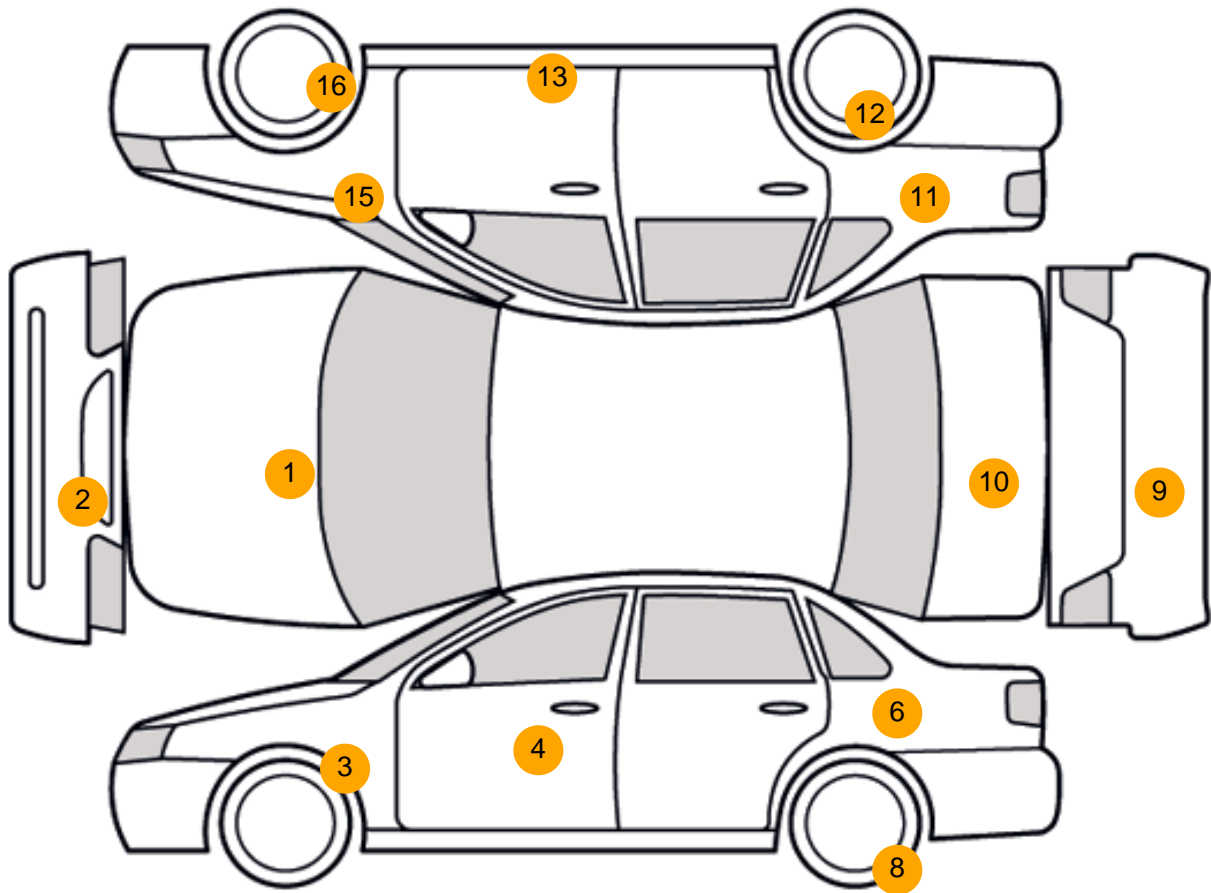

Damage Photos



1: Bonnet
Chipped
Multiple Chips




2: Bumper Front
Poor Previous Repair
Poor Paint



3: Wheel nsf
Scratched
Over 50mm




4: Door nsf
Chipped
1 To 5

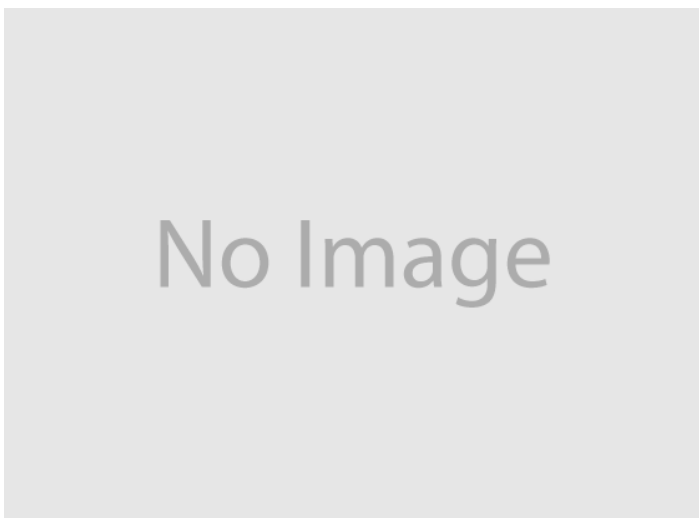

5: Door nsf
Scratched
Over 25mm Not Thru Paint



6: Qtr Panel nsr
Chipped
1 To 5

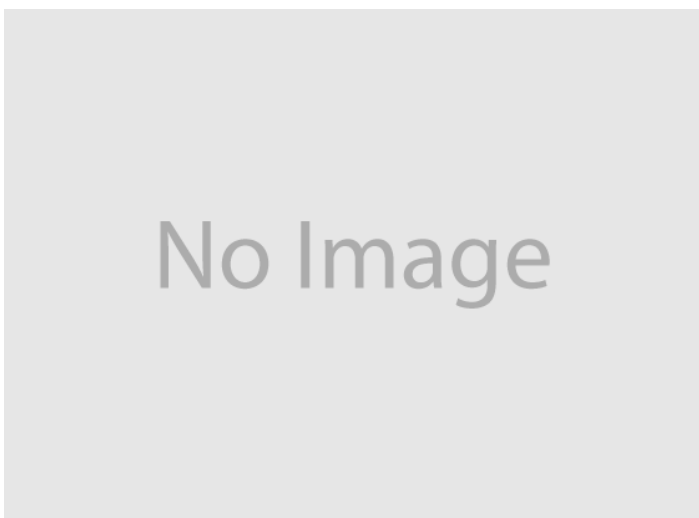

7: Qtr Panel nsr
Scratched
Over 25mm Not Thru Paint



8: Wheel nsr
Scratched
Over 50mm



9: Bumper Rear
Poor Previous Repair
Rippled Up To 30%



10: Boot Lid
Chipped
Multiple Chips




11: Qtr Panel osr
Poor Previous Repair
Paint Flake



12: Wheel osr
Scratched
Over 50mm



13: Door osf
Chipped
1 To 5

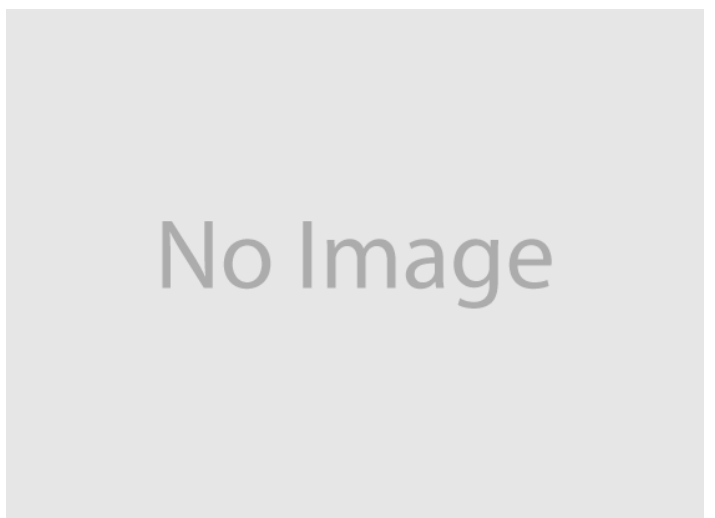

14: Door osf
Scratched
Over 25mm Not Thru Paint



15: Wing of
Poor Previous Repair
Paint Flake



16: Wheel of
Scratched
Over 50mm

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	Fault
		Steering	OK