



VEHICLE INSPECTION REPORT

WV14EWO

Fiat Panda 1.2 Easy 5dr

Inspection

Serious Damage? No

Vehicle

VAT Margin

V5 Present

nama
GRADE
4

Details

Reg. date 01/03/2014

Year 2014

Mileage 97,384 Miles
Warranted

Fuel Type Petrol

Colour RED

VIN ZFA31200003278357

Body Style Hatchback

Keys 1

Service history Yes

Service documents Service Book

Number of stamps 6

Last service date 19/04/2023

Last service miles 83,856

MOT Due 03/07/2026

CAP Clean £1,600.00

CAP Average £1,200.00

CAP Below £800.00

Gearbox MANUAL

Gears 5

Doors 5

Last service 19/04/2023 at 83,856 miles- 6 main dealer services

Tyres

NSF MATADOR 6.0mm

NSR TRIANGLE 6.0mm

OSF MATADOR 6.0mm

OSR PIRELLI 4.0mm

Spare

Features


- PAS
- Front fog lights
- Front head restraints
- ABS
- Side airbags
- Rear wiper
- Air conditioning
- Rear headrests
- Drivers airbag
- Central locking
- Radio/CD
- Folding rear seats
- Solid Paint
- Isofix child seat anchor points
- Cloth seat trim
- Body coloured bumpers
- Front electric windows
- 3x3 point rear seat belts
- Passenger airbag
- Steel wheels

Photos





Condition Check

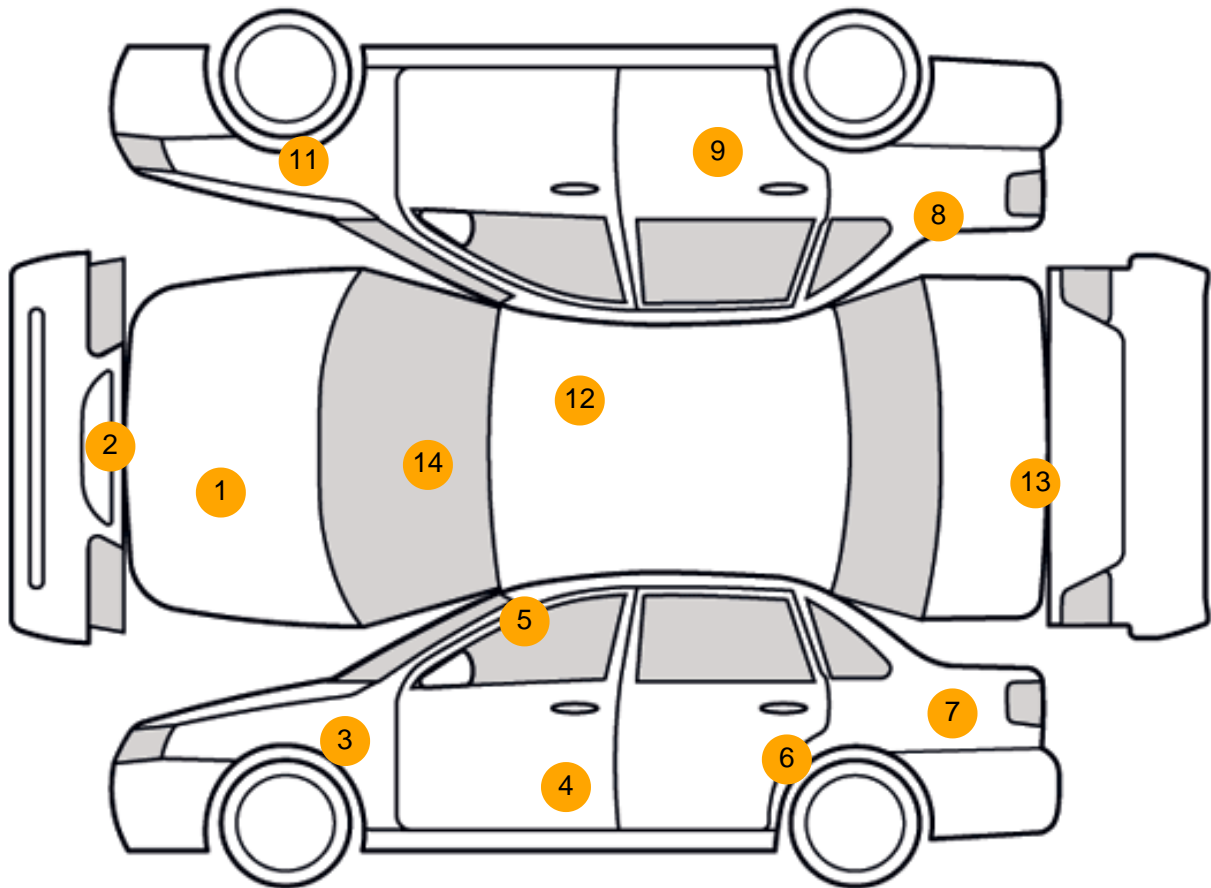

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Poor Previous Repair
Paint Flake



3: Wing nsf
Chipped
1 To 5




4: Door nsf
Scratched
Over 25mm Thru Paint



5: A Post ns
Chipped
1 To 5



6: Door nsr
Scratched
Over 25mm Thru Paint

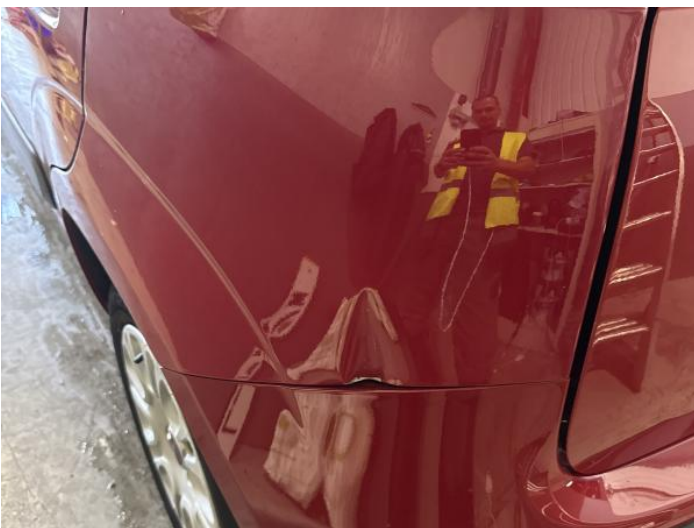

7: Qtr Panel nsr
Dented
Over 30mm



8: Qtr Panel osr
Dented
Between 10mm + 30mm



9: Door osr
Dented
Between 10mm + 30mm



10: Door osf
Dented
Over 30mm



11: Wing osf
Chipped
Multiple Chips



12: Roof
Chipped
1 To 5



13: Tailgate
Chipped
Edge Chip



14: Screen Front
Chipped
UpTo 10mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK