



VEHICLE INSPECTION REPORT

GY17APF

BMW 1 Series 116d Sport 3dr [Nav]

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	TBC



Details

Reg. date	28/03/2017	VIN	WBA2P320605B46747	CAP Average	£2,650.00
Year	2017	Body Style	Hatchback	CAP Below	£2,150.00
Mileage	122,380 Miles Warranted	Keys	2	Gearbox	MANUAL
Fuel Type	Diesel	MOT Due	27/03/2026	Gears	6
Colour	BLUE	CAP Clean	£3,175.00	Doors	3

£100 ADDITIONAL FEE Engine rattling


Tyres


NSF	DUNLOP	4.0mm
NSR	DUNLOP	5.0mm
OSF	DUNLOP	4.0mm
OSR	DUNLOP	5.0mm
Spare		

Features


- Bluetooth connection
- Rear parking sensor
- Body coloured bumpers
- Folding rear seats
- Height adjustable drivers seat
- ABS
- Passenger airbag
- Cloth seat trim
- Cruise control
- Rear wiper
- Electric door mirrors
- Front armrest
- Rear headrests
- Drivers airbag
- Side airbags
- Alloy wheels
- Navigation system
- Steering wheel mounted controls
- Front fog lights
- Front electric windows
- Metallic Paint
- ESP
- Central locking
- PAS
- Digital radio
- Air conditioning
- Front head restraints
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking

Photos

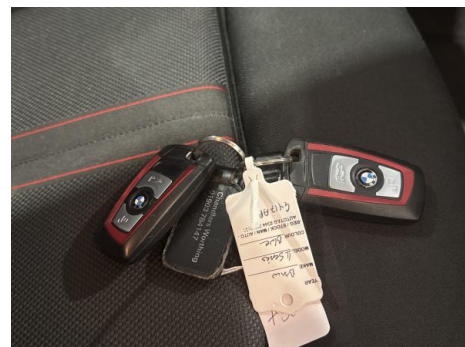

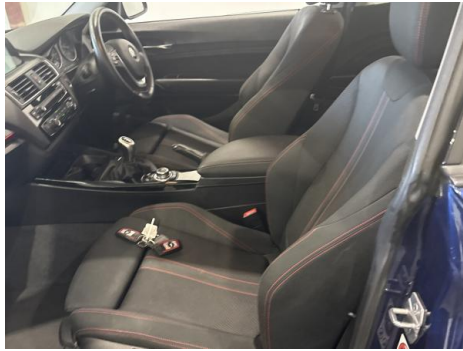

Condition Check

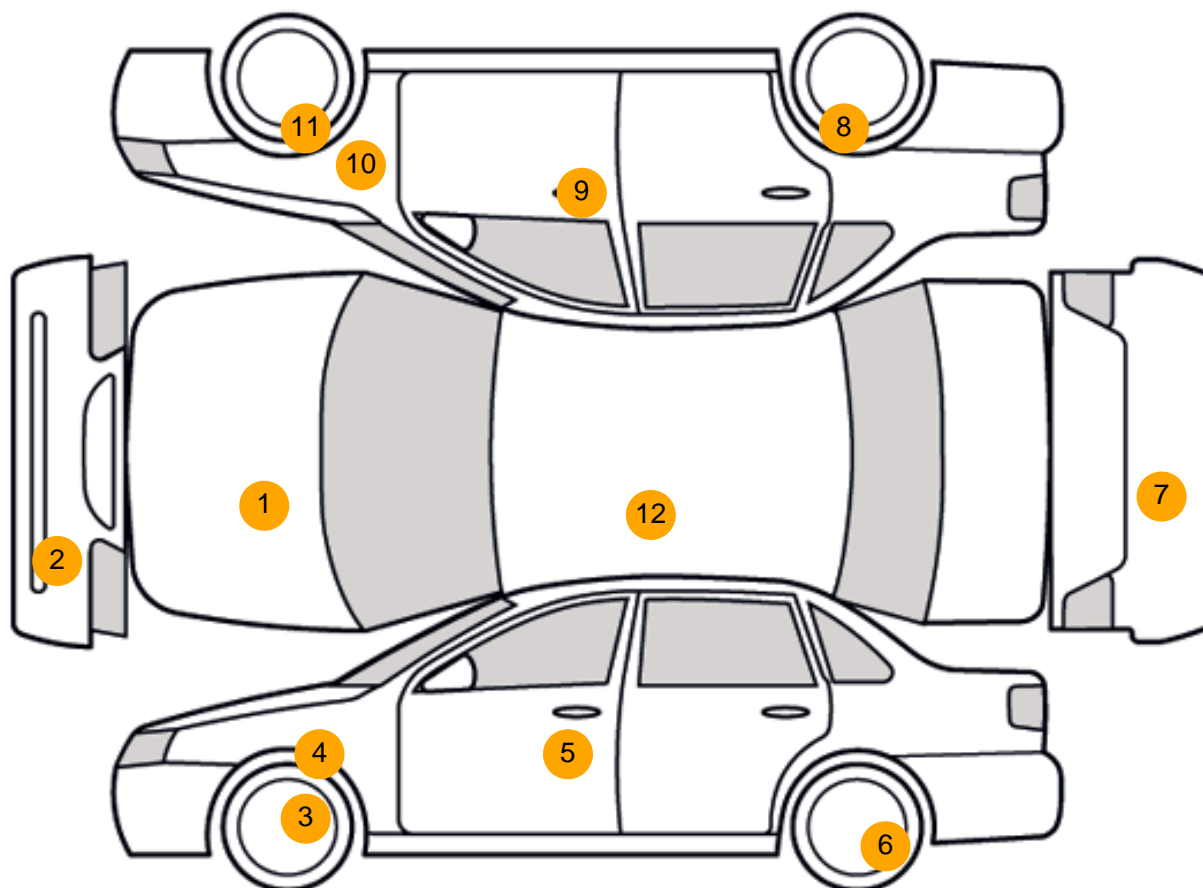

Damage Photos



1: Bonnet
Chipped
1 To 5



2: Bumper Front
Scratched
25 to 100mm Thru Paint



3: Wheel nsf
Scratched
Over 50mm



4: Wing nsf
Dented
Over 30mm



5: Door nsf
Chipped
Edge Chip



6: Wheel nsr
Scratched
Over 50mm



7: Bumper Rear
Scratched
25 to 100mm Thru Paint



8: Wheel osr
Scratched
Over 50mm




9: Door osf
Chipped
Edge Chip



10: Wing osf
Dented
Over 30mm



11: Wheel osf
Scratched
Over 50mm

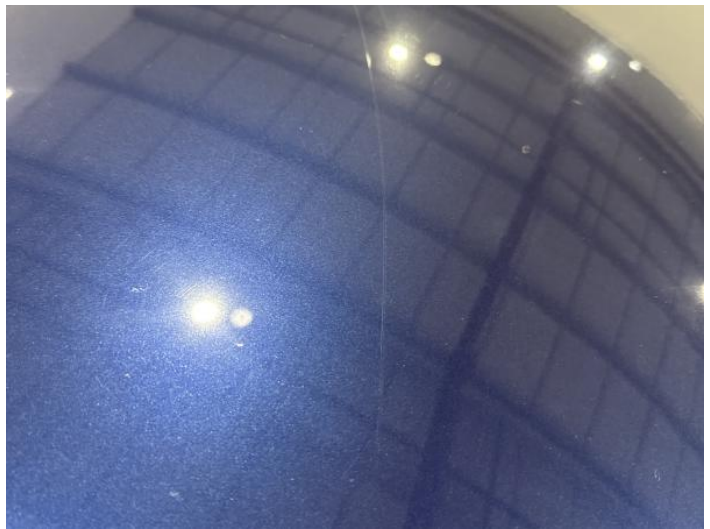

12: Roof
Scratched
Over 25mm Thru Paint

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK