



46 Brampton Road
Eastbourne
BN22 9BN

01323 520295 | no-reply@ebca.co.uk

VEHICLE INSPECTION REPORT

RJ21PUE

Kia Sportage 1.6 CRDi 48V ISG 2 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	10/06/2021	VIN	U5YPH812LML065737	Last service date	16/06/2025
Year	2021	Body Style	Estate	Last service miles	48,775
Mileage	48,926 Miles Warranted	Keys	2	MOT Due	09/06/2026
Fuel Type	Hybrid Electric	Service history	Yes	Gearbox	MANUAL
Colour	SILVER	Number of stamps	3	Gears	6

Last service 16/06/2025 at 48,775 miles- 3 main dealer services, confirmed by Donalds Kia Ipswich
Photocopy of V5 Engine tapping misfires
Under tray in boot

Tyres

NSF	MAXXIS	5.0mm
NSR	RAPID	5.0mm
OSF	MAXXIS	5.0mm
OSR	CONTINENTAL	5.0mm
Spare		

Features


- Bluetooth connection
- Park assist camera
- Steering wheel mounted controls
- Front fog lights
- Front armrest
- Rear electric windows
- Metallic Paint
- Isofix child seat anchor points
- Remote central locking
- Cruise control
- PAS
- Digital radio
- Roof rails
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Passenger airbag
- Cloth seat trim
- Heated front seat
- Rear parking sensor
- Body coloured bumpers
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- Drivers airbag
- Side airbags
- Alloy wheels
- Navigation system
- Rear wiper
- Electric door mirrors
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- ESP
- Central locking

Photos






Condition Check

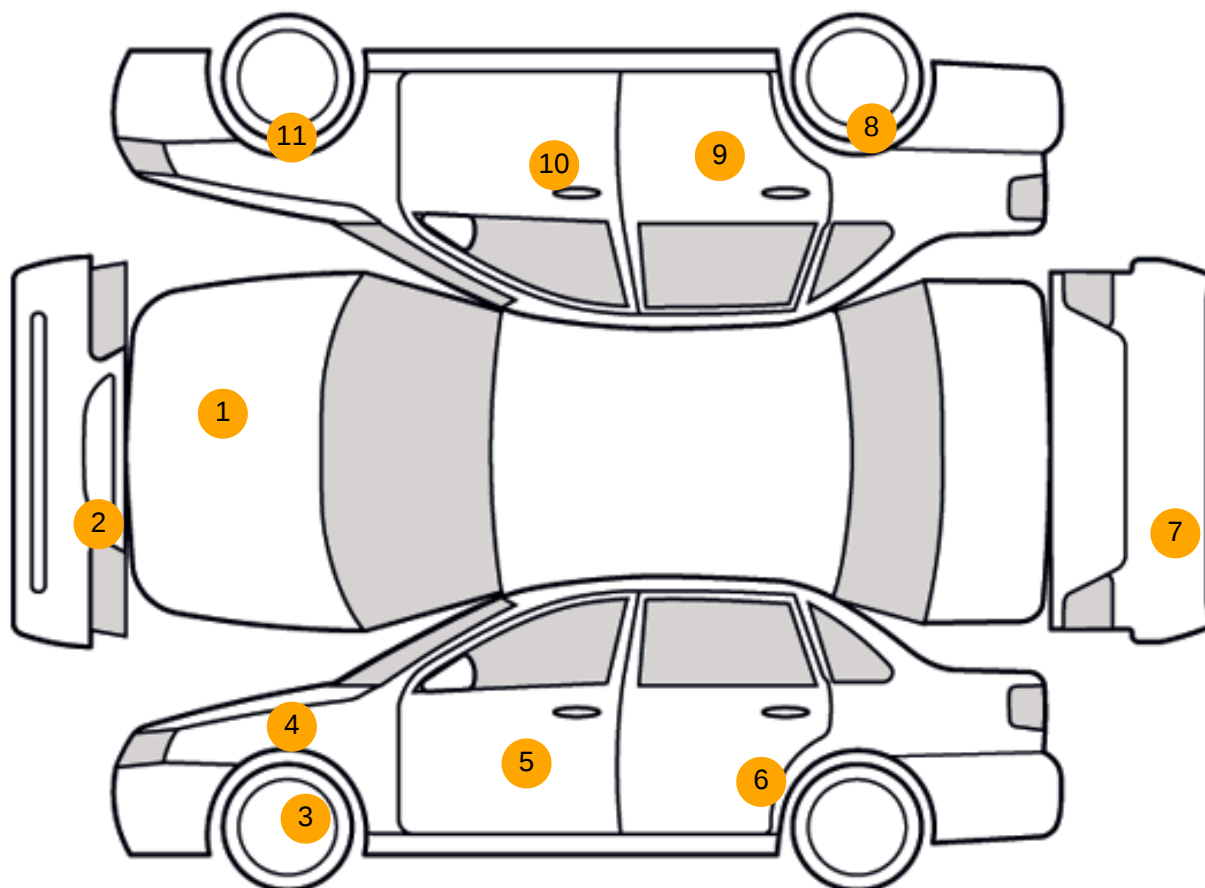

Damage Photos

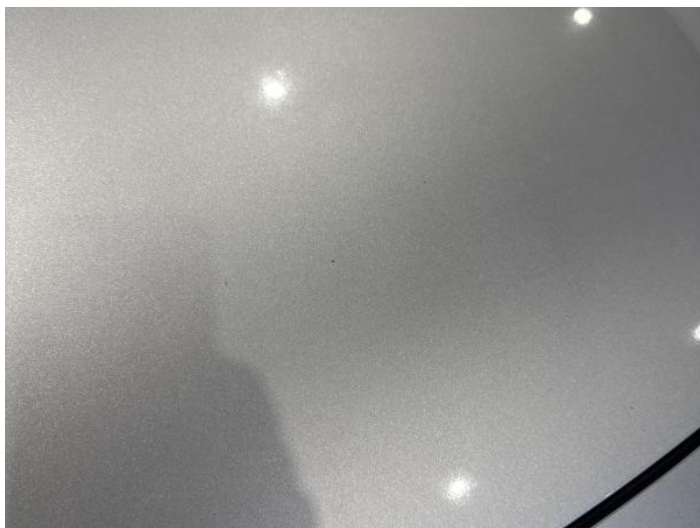

1: Bonnet
Chipped
1 To 5



2: Bumper Front
Chipped
Multiple Chips



3: Wheel nsf
Scratched
Up To 50mm



4: Wing nsf
Chipped
1 To 5



5: Door nsf
Scratched
Up To 25mm Thru Paint



6: Door nsr
Scratched
Over 25mm Thru Paint



7: Bumper Rear
Chipped
1 To 5



8: Wheel osr
Scratched
Over 50mm



9: Door osr
Chipped
Edge Chip



10: Door osf
Chipped
Edge Chip



11: Wheel osf
Scratched
Up To 50mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer
Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.
Additional fees may apply to some vendors.
Please note buyers rate increase from 01/01/2025

Engine Runs	Fault	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK