



VEHICLE INSPECTION REPORT

GV70BUE

Toyota Aygo 1.0 VVT-i X-Play TSS 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	VAT Qualifying
		V5	Present



Details

Reg. date	03/12/2020	VIN	JTDKGNCE80N574868	MOT Due	02/12/2025
Year	2020	Body Style	Hatchback	Gearbox	MANUAL
Mileage	80,055 Miles Warranted	Keys	3	Gears	5
Fuel Type	Petrol	Service history	Yes	Doors	5
Colour	WHITE	Service documents	Printout		

Last service 15/02/2025 at 74,040 miles- 6 services (3 main dealer) High clutch and rear wiper not working


Tyres

NSF	BUDGET	3.0mm
NSR	BUDGET	3.0mm
OSF	SUNNY	3.0mm
OSR	BUDGET	3.0mm
Spare		

Features


- Park assist camera
- Audio remote control
- Air conditioning
- Height adjustable drivers seat
- Drivers airbag
- Remote central locking
- PAS
- Digital radio
- Climate control
- Rear headrests
- Isofix child seat anchor points
- Cloth seat trim
- Rear wiper
- Body coloured bumpers
- Front electric windows
- Solid Paint
- Passenger airbag
- Steel wheels
- Steering wheel mounted controls
- Electric door mirrors
- Front head restraints
- ABS
- Central locking

Photos

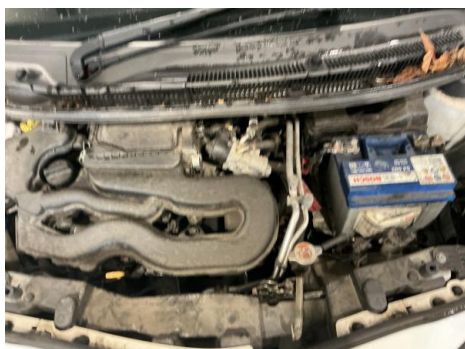



Condition Check

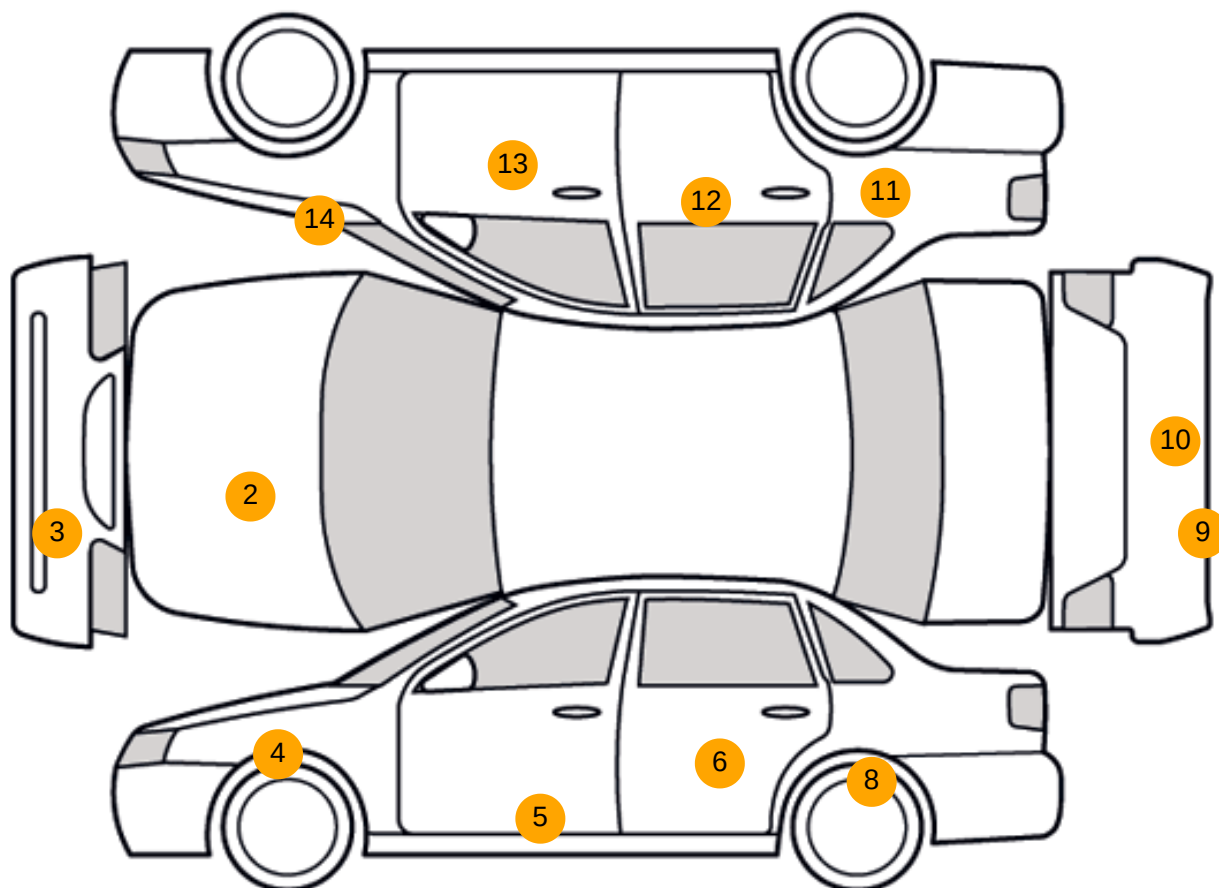

Damage Photos



1: Seat Base Cover osf
Torn
Over 3mm



2: Bonnet
Chipped
1 To 5



3: Bumper Front
Scratched
Over 100mm Thru Paint




4: Wing nsf
Dented
Over 2 UpTo 10mm



5: Door nsf
Dented
2 Or Less UpTo 10mm



6: Door nsr
Chipped
1 To 5

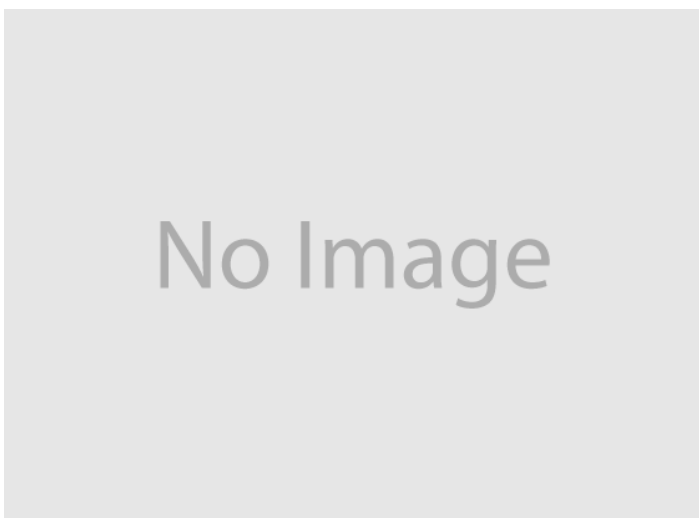

7: Door nsr
Scratched
Over 25mm Not Thru Paint



8: Qtr Panel nsr
Chipped
1 To 5



9: Bumper Rear
Scratched
Over 100mm Thru Paint



10: Bumper Rear
Insecure
Action Required



11: Qtr Panel osr
Poor Previous Repair
Poor Paint



12: Door osr
Poor Previous Repair
Poor Paint



13: Door osf
Poor Previous Repair
Poor Paint



14: Wing osf
Chipped
1 To 5

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	Fault
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK