



VEHICLE INSPECTION REPORT

HN57TYF

Vauxhall Astra 1.7 CDTi 16V Breeze [100] 5dr

Inspection		Vehicle	
Serious Damage?	No	VAT	Margin
		V5	Present



Details

Reg. date	31/10/2007	Body Style	Hatchback	MOT Due	22/02/2026
Year	2007	Keys	3	Gearbox	MANUAL
Mileage	74,679 Miles Warranted	Service history	Yes	Gears	5
Fuel Type	Diesel	Service documents	Service Book	Doors	5
Colour	BLUE	Number of stamps	2		
VIN	W0LOAHL4888015626	Last service date	05/06/2024		

£100 ADDITIONAL FEE

Last service 05/06/2024, mileage not recorded- 2 services, Book and print

Tyres

NSF	BUDGET	5.0mm
NSR	BUDGET	5.0mm
OSF	BUDGET	5.0mm
OSR	BUDGET	5.0mm
Spare		

Features


- PAS
- Body coloured bumpers
- Front electric windows
- Metallic Paint
- Drivers airbag
- Side airbags
- Steel wheels
- Rear wiper
- Electric door mirrors
- Front head restraints
- 3x3 point rear seat belts
- ESP
- Central locking
- Steering wheel mounted controls
- Air conditioning
- Height adjustable drivers seat
- ABS
- Isofix child seat anchor points
- Remote central locking
- Radio/CD
- Folding rear seats
- Rear headrests
- Curtain airbags
- Passenger airbag
- Cloth seat trim

Photos





Condition Check

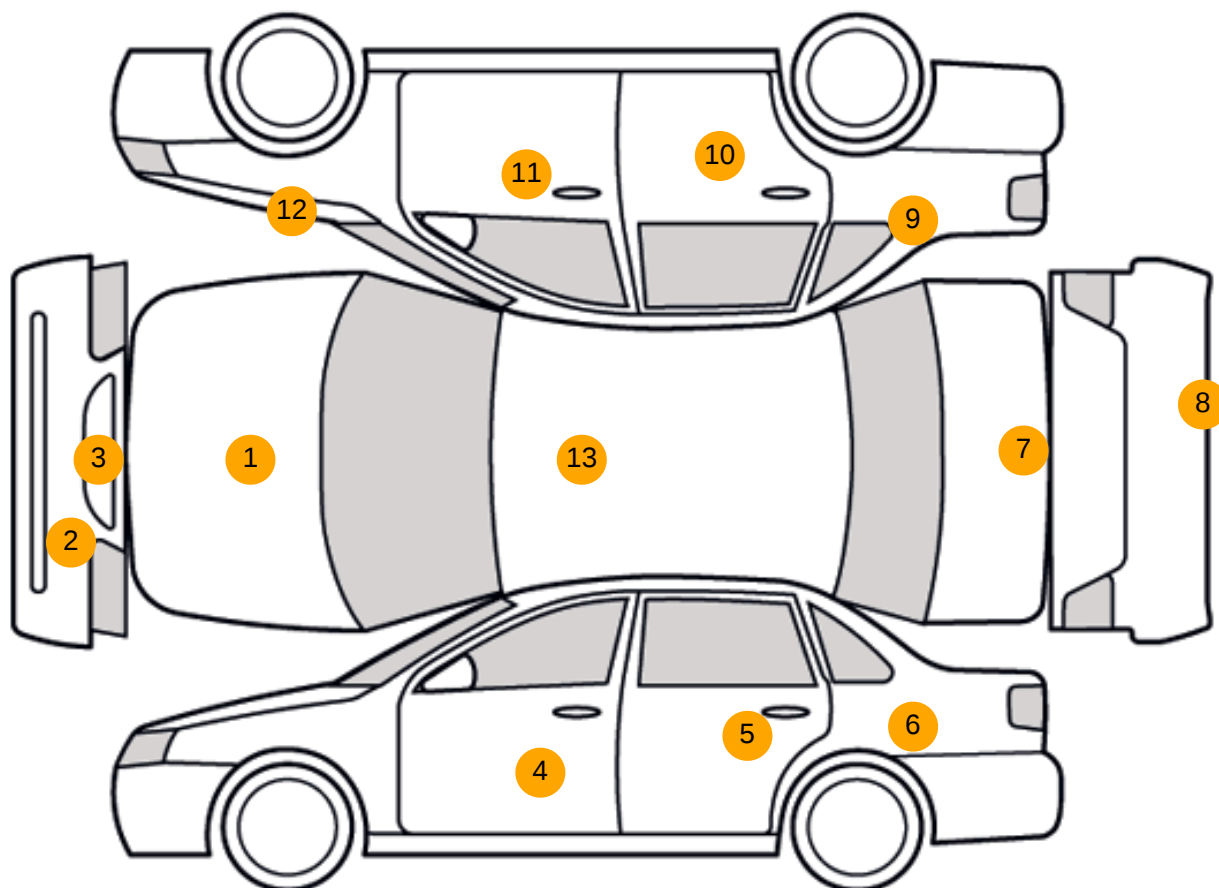

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Scratched
Over 100mm Thru Paint



3: Bumper Front Grill
Broken
Replace



4: Door nsf
Dented
With Paint Damage



5: Door nsr
Scratched
UpTo 25mm Thru Paint



6: Qtr Panel nsr
Scratched
UpTo 25mm Thru Paint



7: Tailgate
Dented
Over 30mm



8: Bumper Rear
Scratched
25 to 100mm Thru Paint



9: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



10: Door osr
Scratched
Over 25mm Thru Paint



11: Door osf
Scratched
Over 25mm Thru Paint



12: Wing osf
Scratched
Over 25mm Thru Paint



13: Roof
Chipped
1 To 5

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
		Steering	OK