

VEHICLE INSPECTION REPORT

YB15LFN

Ford Fiesta 1.5 TDCi Titanium 3dr

Inspection

Serious Damage? No

Vehicle

VAT	Margin
V5	TBC

nama
GRADE 3

Details

Reg. date	29/06/2015
Year	2015
Mileage	83,668 Miles Warranted
Fuel Type	Diesel

Colour	BLACK
VIN	WF0CXXGAKCFL59421
Body Style	Hatchback
Keys	2

MOT Due	16/08/2026
Gearbox	MANUAL
Gears	5
Doors	3

Tyres

NSF	BUDGET	2.0mm
NSR	BUDGET	4.0mm
OSF	BUDGET	2.0mm
OSR	BUDGET	5.0mm
Spare		

Features


- Bluetooth connection
- Body coloured bumpers
- Front armrest
- ABS
- Tyre pressure monitor
- Alloy wheels
- Rear wiper
- Electric door mirrors
- Front electric windows
- Drivers airbag
- Central locking
- Telephone
- Air conditioning
- Rear headrests
- Passenger airbag
- Remote central locking
- Radio/CD
- Climate control
- Metallic Paint
- Traction control
- Cloth seat trim

Photos





Condition Check

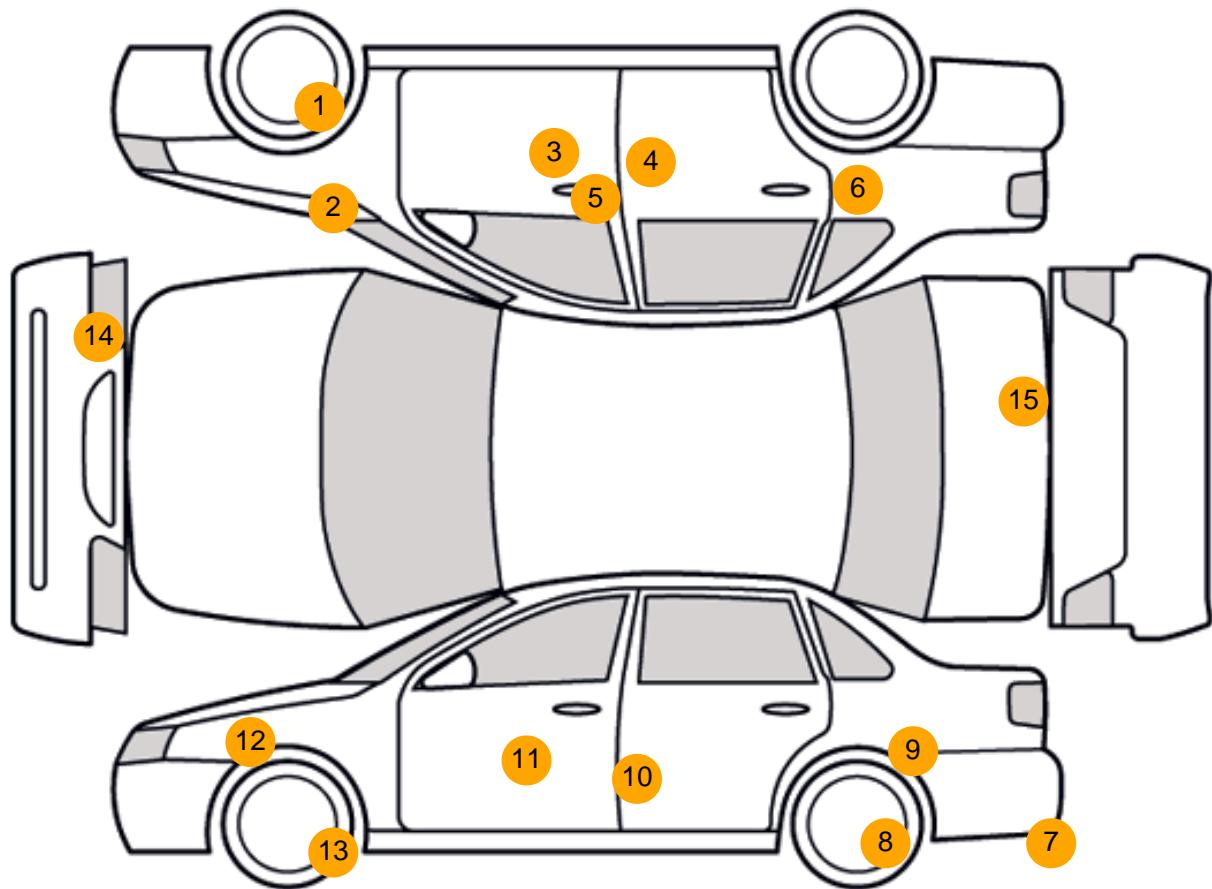

Damage Photos



1: Wheel osf
Scratched
Over 50mm



2: Wing osf
Scratched
Over 25mm Not Thru Paint




3: Door osf
Dented
Between 10mm + 30mm



4: Door osf
Chipped
Edge Chip



5: Door osf
Chipped
1 To 5

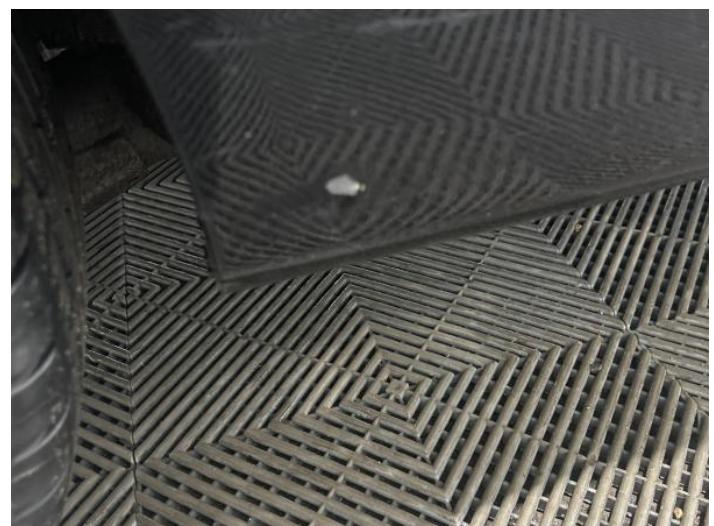

6: Qtr Panel osf
Chipped
1 To 5



7: Bumper Rear
Scratched
Over 25mm Not Thru Paint



8: Wheel nsr
Scratched
Over 50mm



9: Qtr Panel nsr
Scratched
Over 25mm Not Thru Paint



10: Door nsf
Dented
Between 10mm + 30mm



11: Door nsf
Chipped
1 To 5



12: Wing nsf
Chipped
1 To 5



13: Wheel nsf
Scratched
Up To 50mm



14: Bumper Front
Poor Previous Repair
Paint Flake



15: Boot Lid
Poor Previous Repair
Paint Flake

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	DPF light illuminated	OK
ABS light illuminated	OK	Service indicator light illuminated	OK
Windows	OK	Radio	OK
		Steering	OK