

VEHICLE INSPECTION REPORT

DV58KXJ

Vauxhall Corsa 1.2i 16V Club 3dr [AC]

Inspection	Vehicle		GRADE 5
Serious Damage?	VAT	Margin	
No	V5	Present	

Details

Reg. date	27/11/2008	Body Style	Hatchback	Last service miles	75,875
Year	2008	Keys	1	MOT Due	20/02/2026
Mileage	92,495 Miles Warranted	Service history	Yes	Gearbox	MANUAL
Fuel Type	Petrol	Service documents	Service Book	Gears	5
Colour	SILVER	Number of stamps	5	Doors	3
VIN	W0L0SDL0896024243	Last service date	24/12/2024		

£65 ADDITIONAL FEE

Last service 24/12/2024 at 75,875 miles- 5 services. Book and print Fan not working , electric problems
Smoking inside between front window and dash

Tyres

NSF	BUDGET	5.0mm
NSR	RAPID	5.0mm
OSF	BUDGET	5.0mm
OSR	COMFORSER	5.0mm
Spare		

Features


- PAS
- Body coloured bumpers
- Folding rear seats
- Rear headrests
- 3x3 point rear seat belts
- ESP
- Side airbags
- Steel wheels
- Rear wiper
- Electric door mirrors
- Front electric windows
- Steering wheel rake adjustment
- ABS
- Isofix child seat anchor points
- Central locking
- Steering wheel mounted controls
- Full size spare wheel
- Front head restraints
- Steering wheel reach adjustment
- Curtain airbags
- Passenger airbag
- Remote central locking
- Digital radio
- Air conditioning
- Height adjustable drivers seat
- Metallic Paint
- Drivers airbag
- Rear airbags
- Cloth seat trim

Photos





Condition Check

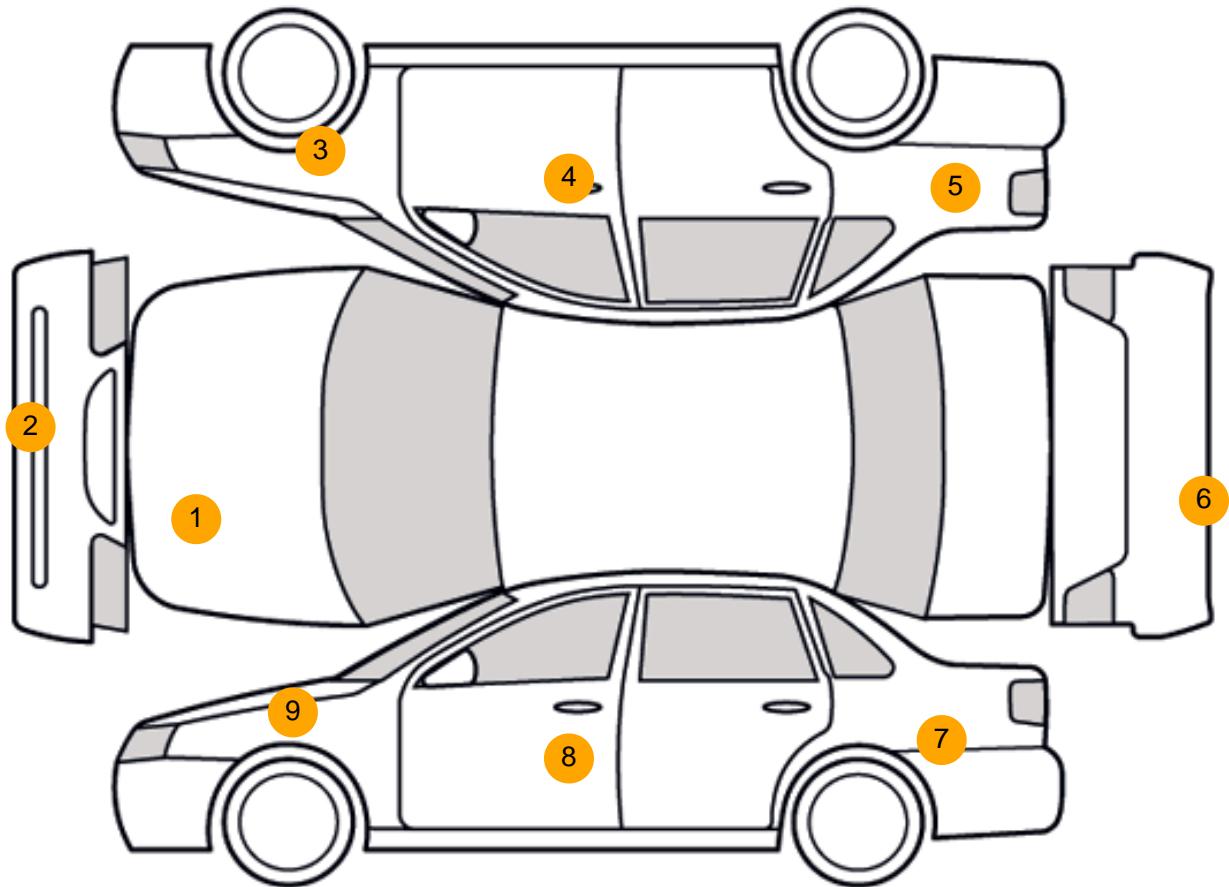

Damage Photos



1: Bonnet
Rusted
Over 5mm



2: Bumper Front
Scratched
Over 100mm Thru Paint



3: Wing osf
Poor Previous Repair
Poor Paint




4: Door osf
Scratched
Over 25mm Thru Paint



5: Qtr Panel osr
Scratched
Rusted



6: Bumper Rear
Cracked
Over 25mm

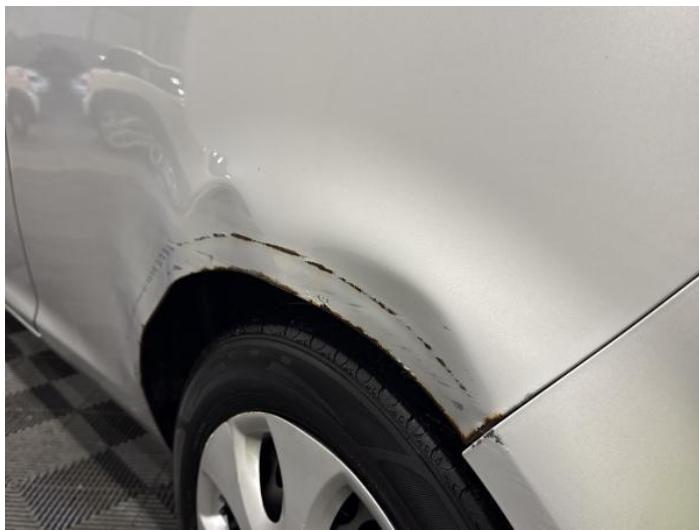

7: Qtr Panel nsr
Dented
With Paint Damage



8: Door nsf
Dented
Between 10mm + 30mm



9: Wing nsf
Chipped
1 To 5



10: Glove Box Lid
Broken
Replace

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK