

VEHICLE INSPECTION REPORT

BD70OHK

Volkswagen T-Roc 1.0 TSI 110 United 5dr

Inspection

Serious Damage? No

Vehicle

VAT	Margin
V5	Present

nama
GRADE 4

Details

Reg. date	18/01/2021
Year	2021
Mileage	40,922 Miles Warranted
Fuel Type	Petrol
Colour	GREY
VIN	WVGZZA1ZMV077141

Body Style	Hatchback
Keys	2
Service history	Yes
Service documents	Printout
Number of stamps	1
Last service date	12/05/2023

Last service miles	24,708
MOT Due	Expired
Gearbox	MANUAL
Gears	6
Doors	5

£65 ADDITIONAL FEE

Last service 12/05/2023 at 24,708 miles- 1 main dealer service. Print

MOT Expired

Tyres

NSF	BUDGET	3.0mm
NSR	WESTLAKE	5.0mm
OSF	FIREMAX	3.0mm
OSR	BUDGET	5.0mm
Spare		

Features


- Bluetooth connection
- PAS
- Digital radio
- Air conditioning
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Cloth seat trim
- Cruise control
- Rear parking sensor
- Body coloured bumpers
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Drivers airbag
- Side airbags
- Alloy wheels
- Front parking sensor
- Rear wiper
- Electric door mirrors
- Front armrest
- Rear electric windows
- Solid Paint
- ESP
- Central locking
- Heated front seat
- Steering wheel mounted controls
- Roof rails
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking

Photos





Condition Check

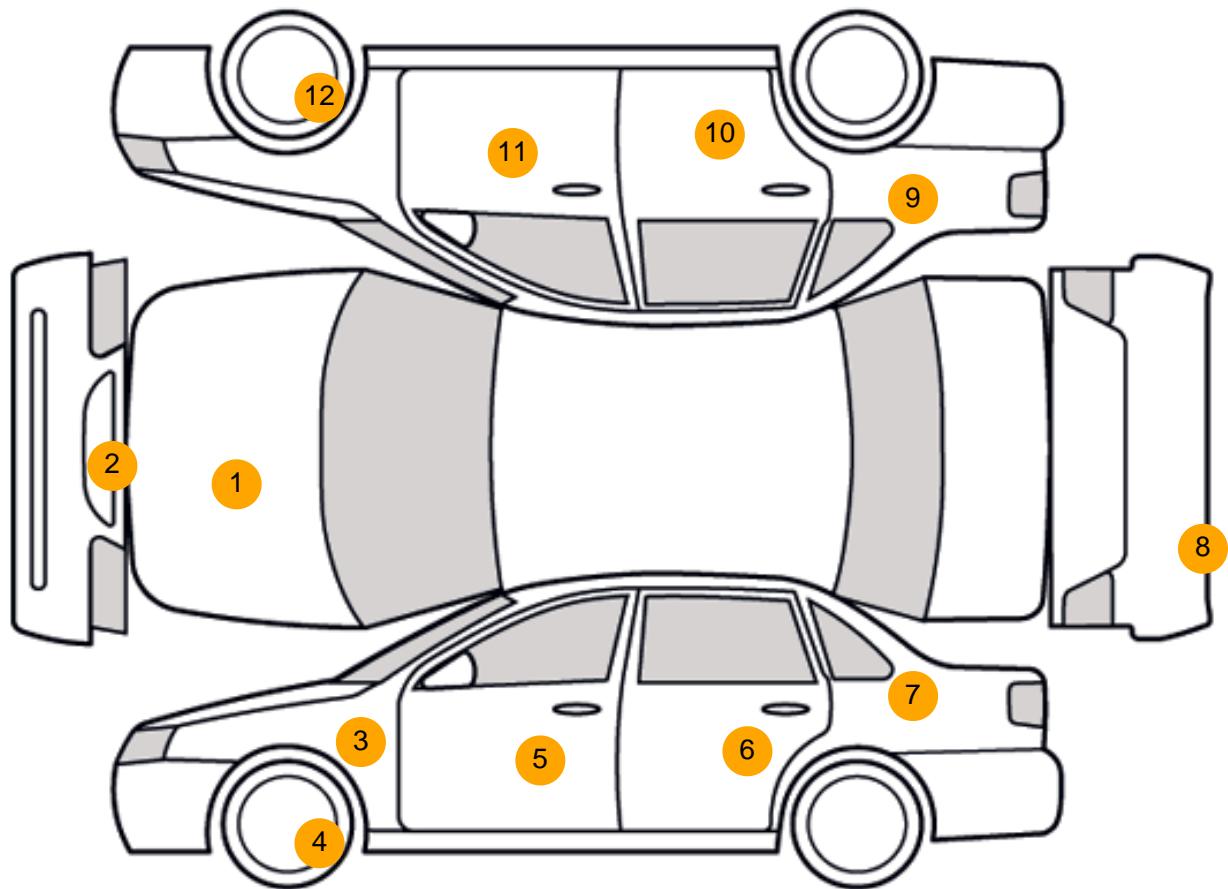

Damage Photos



1: Bonnet
Scratched
Over 25mm Thru Paint



2: Bumper Front
Poor Previous Repair
Poor Colour



3: Wing nsf
Scratched
Over 25mm Thru Paint



4: Wheel nsf
Scratched
Up To 50mm



5: Door nsf
Scratched
UpTo 25mm Thru Paint



6: Door nsr
Scratched
Over 25mm Thru Paint



7: Qtr Panel nsr
Dented
Between 10mm + 30mm



8: Bumper Rear
Scratched
25 to 100mm Thru Paint



9: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



10: Door osr
Scratched
Over 25mm Thru Paint



11: Door osf
Scratched
Over 25mm Thru Paint



12: Wheel osf
Scratched
Over 50mm

Interior

Carpet Condition	Average
Seat Condition	Average

Upholstery Condition	Average
Odour	No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
No Excessive Smoking			OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK