

VEHICLE INSPECTION REPORT

EX67XGL

Toyota RAV4 2.5 VVT-i Hybrid Business Ed Plus TSS 5dr CVT 2WD

Inspection

Serious Damage? No

Vehicle

VAT	Margin
V5	Present

nama
GRADE 4

Details

Reg. date	08/09/2017
Year	2017
Mileage	43,853 Miles Warranted
Fuel Type	Hybrid Electric
Colour	BLUE
VIN	JTMWRREV50D050300

Body Style	Estate
Keys	2
Service history	Yes
Service documents	Service Book
Number of stamps	8
Last service date	02/10/2025

Last service miles	43,144
MOT Due	31/10/2026
Gearbox	CVT
Gears	1

Last Service - 02.10.2025 at 43144 miles (8 main dealer services)

Tyres



NSF	YOKOHAMA	6.0mm
NSR	YOKOHAMA	6.0mm
OSF	YOKOHAMA	6.0mm
OSR	YOKOHAMA	6.0mm
Spare		

Features


• Bluetooth connection	• Cruise control	• Front parking sensor	• Navigation system
• Park assist camera	• PAS	• Rear parking sensor	• Rear wiper
• Steering wheel mounted controls	• Digital radio	• Body coloured bumpers	• Electric door mirrors
• Front fog lights	• Space saver spare wheel	• Air conditioning	• Folding rear seats
• Front armrest	• Front electric windows	• Front head restraints	• Height adjustable drivers seat
• Rear electric windows	• Rear headrests	• Steering wheel rake adjustment	• Steering wheel reach adjustment
• Metallic Paint	• 3x3 point rear seat belts	• ABS	• Curtain airbags
• Drivers airbag	• ESP	• Isofix child seat anchor points	• Rear airbags
• Side airbags	• Tyre pressure monitor	• Central locking	• Remote central locking
• Cloth seat trim	• Alloy wheels		

Photos



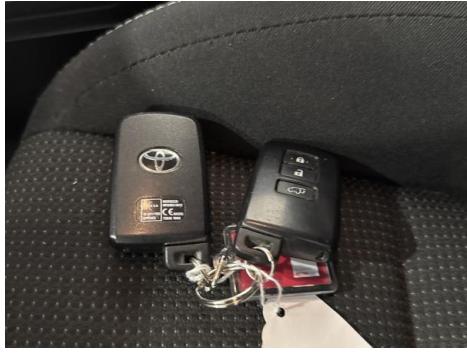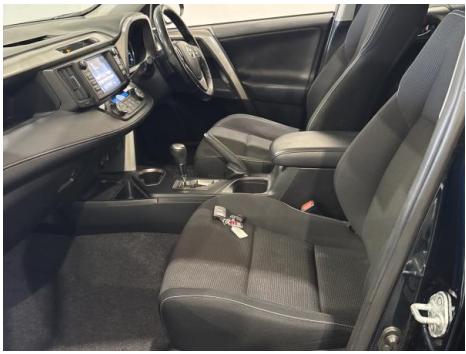

Condition Check

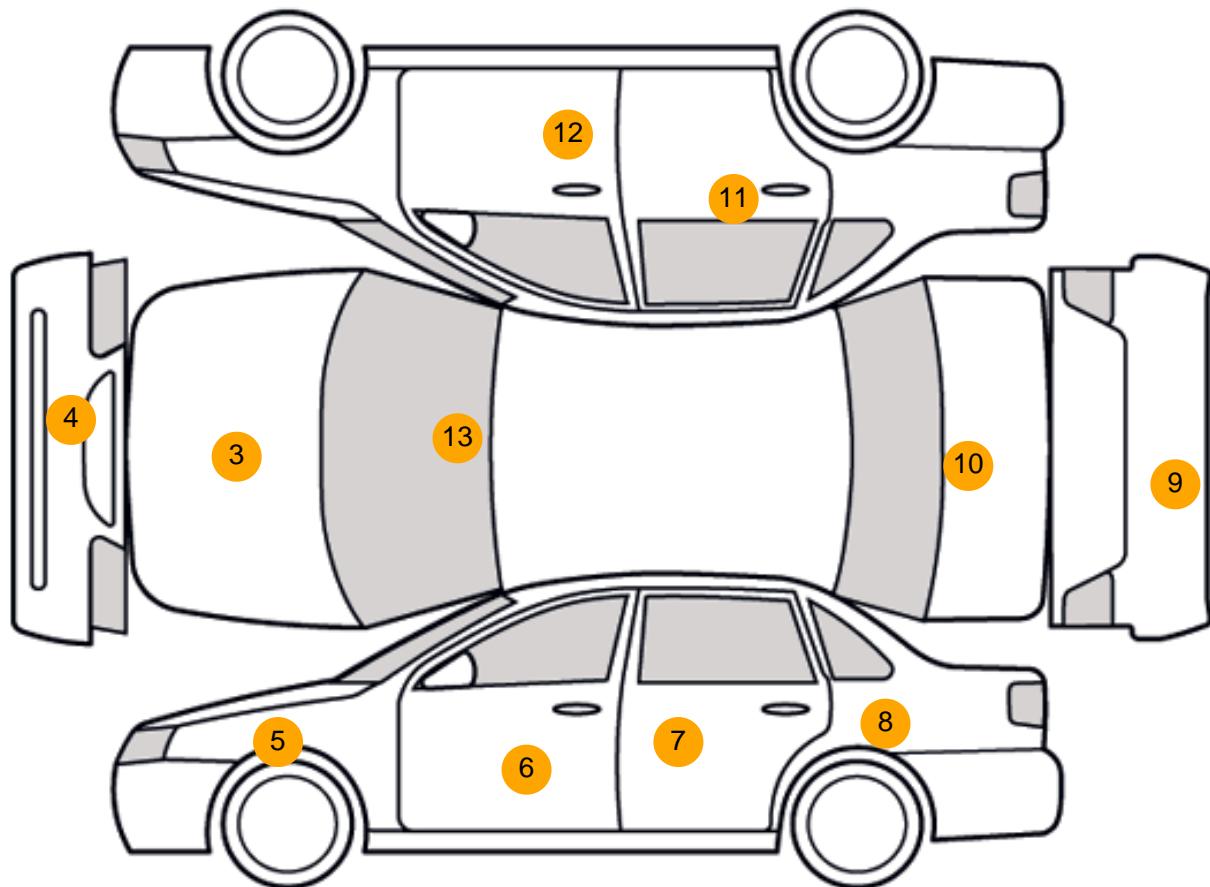

Damage Photos



1: Door Pad nsf
Scuffed
UpTo 25mm



2: Fascia Panel
Scuffed
Over 25mm



3: Bonnet
Scratched
Over 25mm Thru Paint



4: Bumper Front
Scratched
25 to 100mm Thru Paint



5: Wing nsf
Chipped
1 To 5



6: Door nsf
Scratched
Over 25mm Thru Paint



7: Door nsr
Chipped
1 To 5



8: Qtr Panel nsr
Dented
With Paint Damage



9: Bumper Rear
Scratched
Over 100mm Thru Paint



10: Tailgate
Scratched
Over 25mm Thru Paint



11: Door osr
Scratched
UpTo 25mm Thru Paint



12: Door osf
Chipped
Edge Chip



13: Screen Front
Chipped
UpTo 10mm

Interior

Carpet Condition
Seat Condition

Average
Average

Upholstery Condition
Odour

Average
No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK