

VEHICLE INSPECTION REPORT

LG70GBT

Ford Focus 1.5 EcoBlue 120 Active X 5dr

Inspection

Serious Damage? No

Vehicle

VAT	VAT Qualifying
V5	TBC

nama
GRADE 3

Details

Reg. date	02/09/2020
Year	2020
Mileage	110,852 Miles Warranted
Fuel Type	Diesel

Colour	BLACK
VIN	WF0NXXGCHNLC84746
Body Style	Hatchback
Keys	2

MOT Due	22/05/2026
Gearbox	MANUAL
Gears	6
Doors	5

Tyres




NSF	KUMHO	5.0mm
NSR	FALKEN	5.0mm
OSF	KUMHO	5.0mm
OSR	PIRELLI	5.0mm
Spare		

Features


- Bluetooth connection
- Navigation system
- Steering wheel mounted controls
- Front fog lights
- Electrically adjustable drivers seat
- Front head restraints
- Steering wheel rake adjustment
- ABS
- Passenger airbag
- Partial leather seat trim
- Cruise control
- PAS
- Digital radio
- Opening panoramic glass roof
- Folding rear seats
- Height adjustable drivers seat
- Steering wheel reach adjustment
- Drivers airbag
- Side airbags
- Alloy wheels
- Front parking sensor
- Rear parking sensor
- Body coloured bumpers
- Space saver spare wheel
- Front armrest
- Rear electric windows
- Metallic Paint
- ESP
- Central locking
- Heated front seat
- Rear wiper
- Electric door mirrors
- Air conditioning
- Front electric windows
- Rear headrests
- 3x3 point rear seat belts
- Isofix child seat anchor points
- Remote central locking

Photos



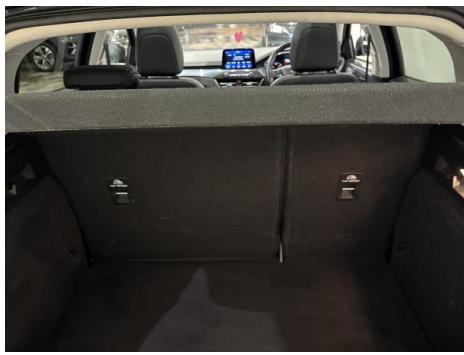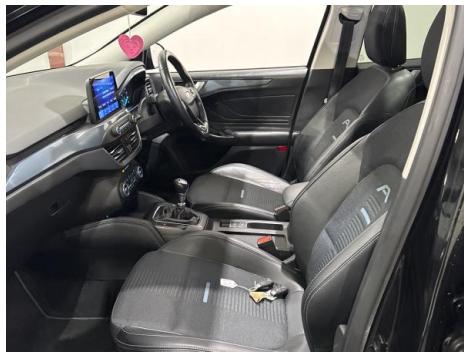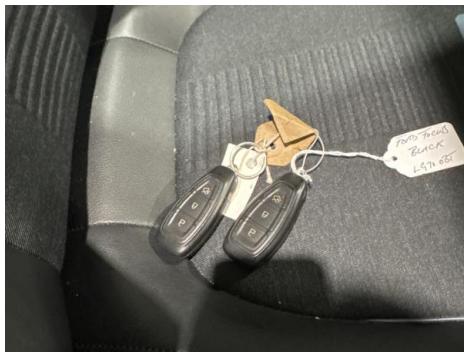

Condition Check

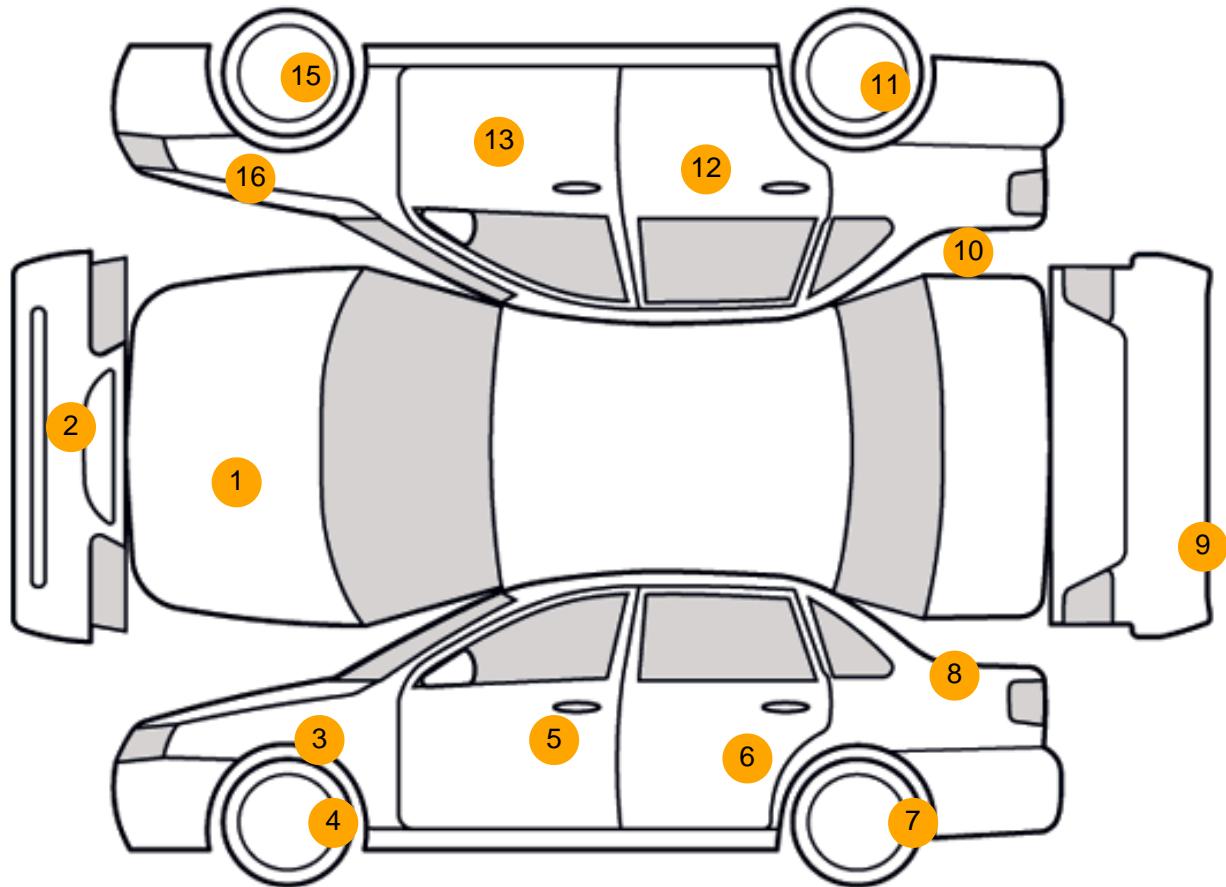

Damage Photos



1: Bonnet
Chipped
Multiple Chips



2: Bumper Front
Scratched
Over 100mm Thru Paint




3: Wing nsf
Chipped
1 To 5



4: Wheel nsf
Scratched
Over 50mm



5: Door nsf
Scratched
Over 25mm Thru Paint

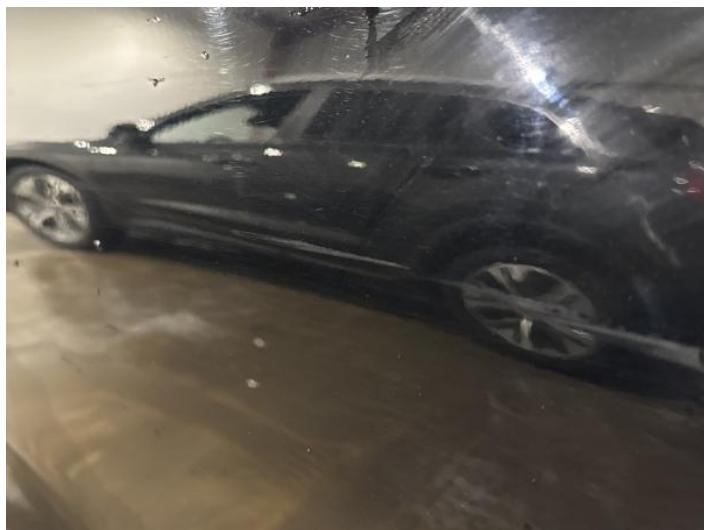

6: Door nsr
Scratched
Over 25mm Thru Paint



7: Wheel nsr
Scratched
Over 50mm



8: Qtr Panel nsr
Chipped
1 To 5



9: Bumper Rear
Scratched
Up To 25mm Thru Paint



10: Qtr Panel osr
Scratched
UpTo 25mm Thru Paint



11: Wheel osr
Scratched
Up To 50mm



12: Door osr
Chipped
1 To 5



13: Door osf
Dented
Between 10mm + 30mm



14: Door osf
Chipped
Edge Chip



15: Wheel osf
Scratched
Up To 50mm



16: Wing osf
Chipped
1 To 5

Interior

Carpet Condition Average
Seat Condition Average

Upholstery Condition Average
Odour No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Roof / sunroof	OK	Radio	OK
Windows	OK	Steering	OK
Sat nav	OK		