

VEHICLE INSPECTION REPORT

KY09ZTX

Hyundai i10 1.2 Classic 5dr

Inspection

Serious Damage? No

Vehicle

VAT	Margin
V5	Present

nama
GRADE 5

Details

Reg. date	13/03/2009
Year	2009
Mileage	97,349 Miles Warranted
Fuel Type	Petrol
Colour	BLACK
VIN	MALAM51CR9M226112

Body Style	Hatchback
Keys	2
Service history	Yes
Service documents	Service Book
Number of stamps	10
Last service date	05/03/2025

Last service miles	92,552
MOT Due	13/03/2026
Gearbox	MANUAL
Gears	5
Doors	5

Last Service -05.03.2025 at 92552 miles (10 services)

Tyres

NSF	BUDGET	3.0mm
NSR	BUDGET	4.0mm
OSF	BUDGET	4.0mm
OSR	BUDGET	3.0mm
Spare		

Features


- PAS
- Front electric windows
- Drivers airbag
- Cloth seat trim
- Rear wiper
- Front head restraints
- Passenger airbag
- Steel wheels
- Radio/CD
- Solid Paint
- Central locking
- Body coloured bumpers
- ABS
- Remote central locking

Photos





Condition Check

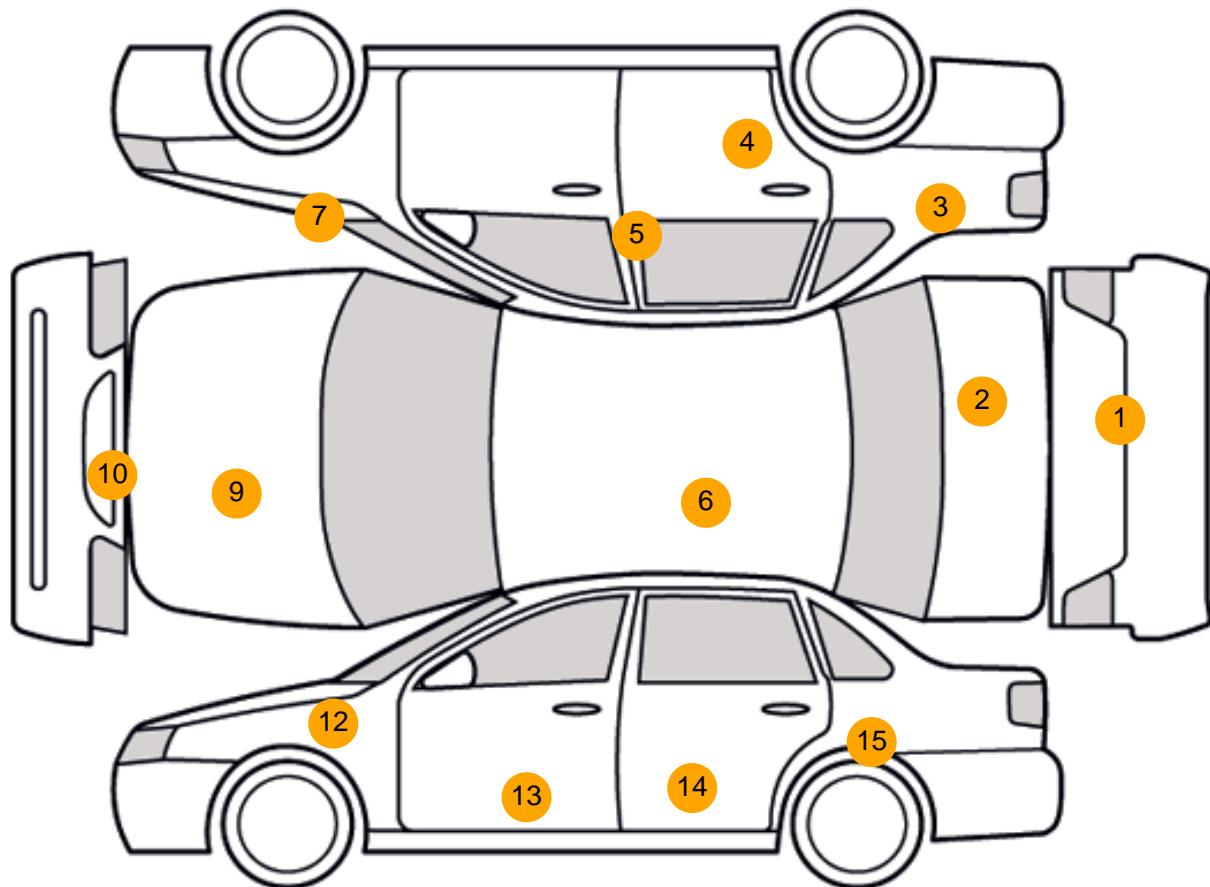

Damage Photos



1: Bumper Rear
Scratched
Over 100mm Thru Paint



2: Boot Lid
Chipped
Multiple Chips



3: Qtr Panel osr
Dented
With Paint Damage



4: Door osr
Dented
With Paint Damage



5: Door osf
Rusted
Over 5mm



6: Roof
Chipped
Multiple Chips



7: Wing osf
Chipped
1 To 5

No Image


8: Wing osf
Scratched
Over 25mm Not Thru Paint



9: Bonnet
Chipped
Multiple Chips



10: Bumper Front
Scratched
25 to 100mm Thru Paint

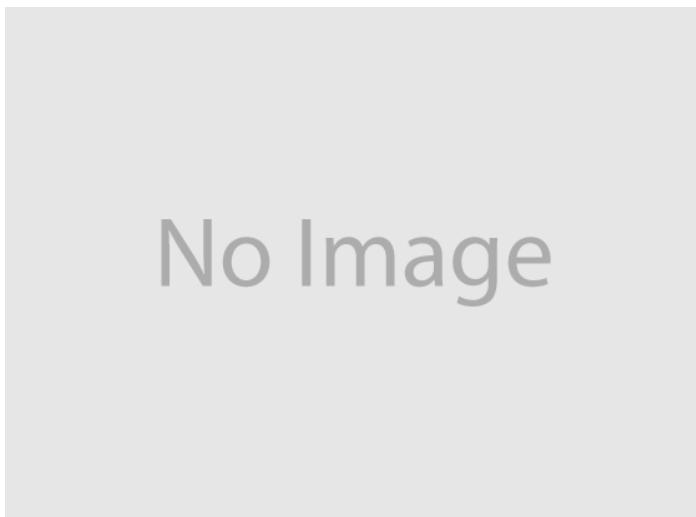

11: Bumper Front
Scratched
Over 25mm Not Thru Paint



12: Wing nsf
Dented
Over 30mm



13: Door nsf
Chipped
Multiple Chips



14: Door nsr
Rusted
Holed



15: Qtr Panel nsr
Dented
With Paint Damage



16: Seat Base Cover osr
Torn
Over 3mm

Interior

Carpet Condition	Average	Upholstery Condition	Average
Seat Condition	Average	Odour	No

Vehicle Inspection Report

Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Parking Brake	OK	Gearbox Static Gear Selection (engine running)	OK
		No Excessive Smoking	OK
EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
		Steering	OK