

## VEHICLE INSPECTION REPORT

GV69LVW

### Audi A5 40 TFSI Black Edition 5dr S Tronic

#### Inspection

Serious Damage? No

#### Vehicle

VAT Margin

V5 Present

nama  
GRADE 2

#### Details

Reg. date	31/01/2020
Year	2020
Mileage	96,078 Miles Warranted
Fuel Type	Petrol
Colour	BLACK
VIN	WAUZZZF50KA086974

Body Style	Hatchback
Keys	2
Service history	Yes
Service documents	Printout
Number of stamps	6
Last service date	16/07/2025

Last service miles	86,532
MOT Due	30/11/2026
Gearbox	SEMI AUTO
Gears	7
Doors	5

£65 ADDITIONAL FEE.

last service 16/7/25 @ 86,532 miles (6 main dealer) print

#### Tyres


NSF	CONTINENTAL	4.0mm
NSR	CONTINENTAL	4.0mm
OSF	CONTINENTAL	4.0mm
OSR	CONTINENTAL	4.0mm
Spare		

## Features


- Bluetooth connection
- Navigation system
- Audio remote control
- Air conditioning
- Front head restraints
- Metallic Paint
- Isofix child seat anchor points
- Central locking
- Cruise control
- PAS
- Digital radio
- Climate control
- Height adjustable drivers seat
- 3x3 point rear seat belts
- Passenger airbag
- Remote central locking
- Front parking sensor
- Rear parking sensor
- Body coloured bumpers
- Front armrest
- Rear electric windows
- ABS
- Side airbags
- Partial leather seat trim
- Heated front seat
- Steering wheel mounted controls
- Electric door mirrors
- Front electric windows
- Rear headrests
- Drivers airbag
- Traction control
- Alloy wheels

## Photos




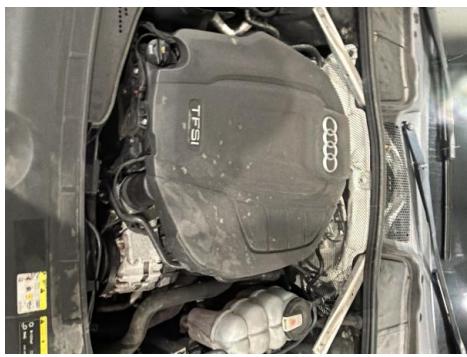

## Condition Check

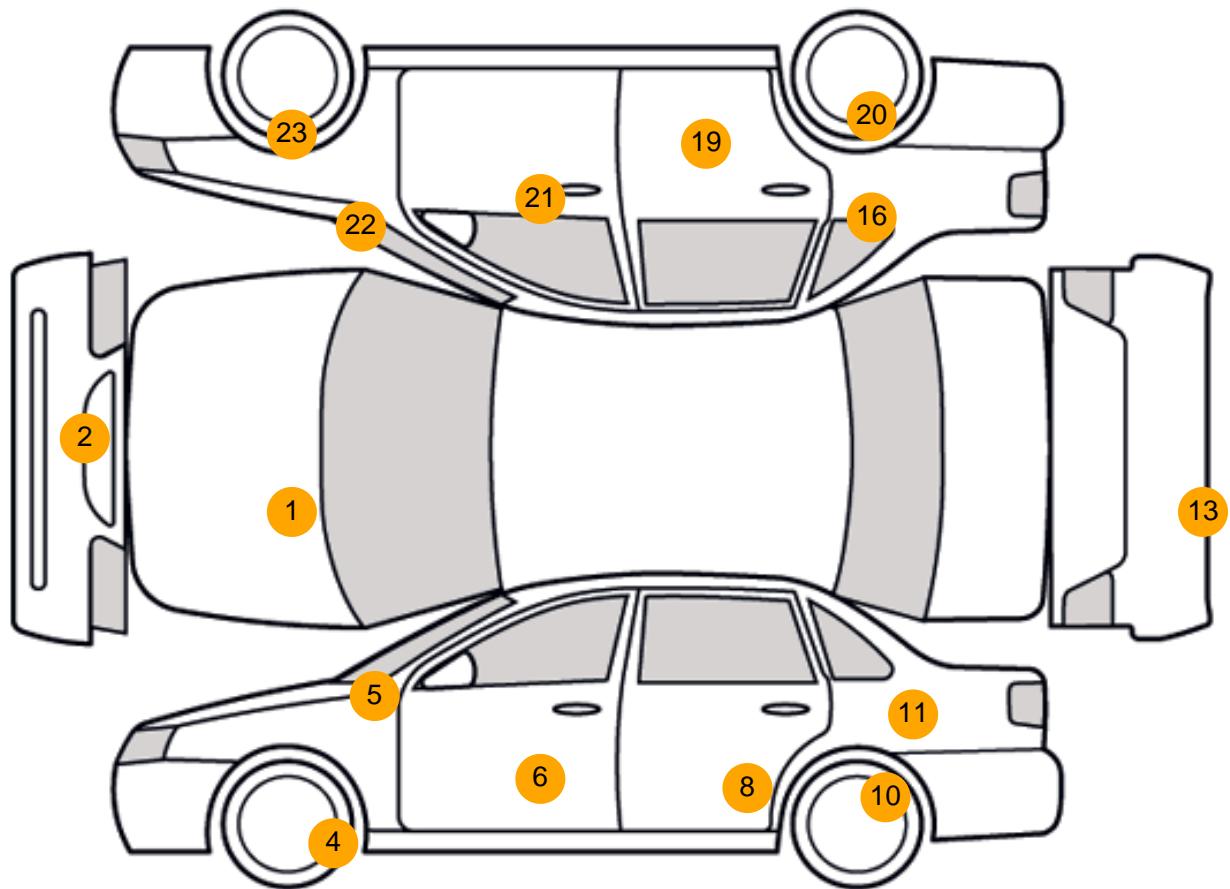

## Damage Photos

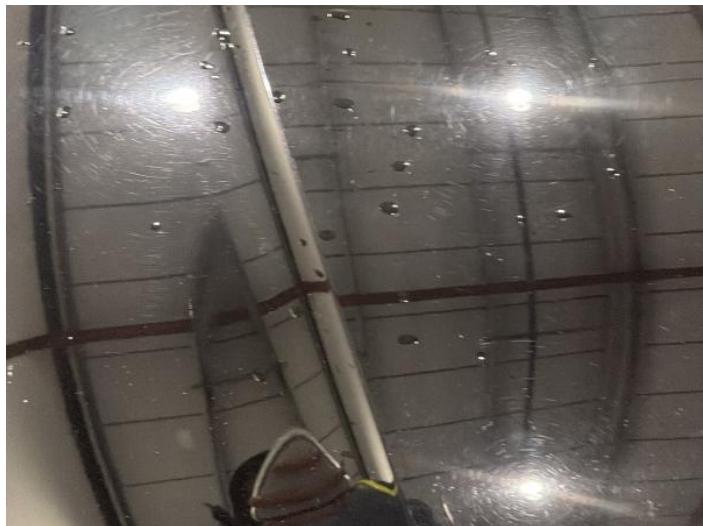

1: Bonnet  
Chipped  
1 To 5



2: Bumper Front  
Chipped  
Multiple Chips

# No Image


3: Bumper Front  
Scratched  
Over 25mm Not Thru Paint



4: Wheel nsf  
Scratched  
Over 50mm



5: Wing nsf  
Chipped  
1 To 5

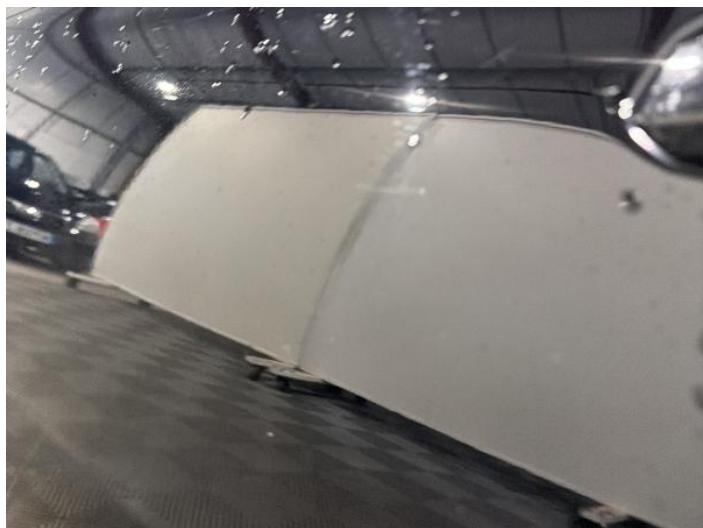

6: Door nsf  
Chipped  
1 To 5



7: Door nsf  
Scratched  
Over 25mm Not Thru Paint



8: Door nsr  
Chipped  
1 To 5

# No Image

9: Door nsr  
Scratched  
Over 25mm Not Thru Paint



10: Wheel nsr  
Scratched  
Over 50mm



11: Qtr Panel nsr  
Dented  
Over 2 UpTo 10mm

# No Image

12: Qtr Panel nsr  
Scratched  
Over 25mm Not Thru Paint



13: Bumper Rear  
Scratched  
25 to 100mm Thru Paint

# No Image

14: Bumper Rear  
Scratched  
Over 25mm Not Thru Paint

# No Image

15: Boot Lid  
Scratched  
Over 25mm Not Thru Paint



16: Qtr Panel osr  
Dented  
2 Or Less UpTo 10mm

# No Image

17: Qtr Panel osr  
Scratched  
Over 25mm Not Thru Paint

# No Image

18: Qtr Panel osr  
Scratched  
Over 25mm Not Thru Paint



19: Door osr  
Dented  
Over 2 UpTo 10mm



20: Wheel osr  
Scratched  
Over 50mm



21: Door osf  
Poor Previous Repair  
Poor Paint



22: Wing osf  
Chipped  
1 To 5



23: Wheel osf  
Scratched  
Over 50mm

## Interior

**Carpet Condition**  
**Seat Condition**

Average  
Average

**Upholstery Condition**  
**Odour**

Average  
No

## Vehicle Inspection Report

### Disclaimer

Photographs, inspection reports and other descriptions are primarily for the use of customers using our LiveBid facility who are not able to attend the sale in person. Those who bid in person must satisfy themselves as to the condition of the vehicle before they bid; we cannot address post-sale issues which rely solely on our reports, descriptions and/or photographs.

Additional fees may apply to some vendors.

Please note buyers rate increase from 01/01/2025

Engine Runs	OK	Gearbox 1st and Reverse Test	OK
Brakes	OK	Clutch Slip Test from Static	OK
Turbo Boosting	OK	Gearbox Static Gear Selection (engine running)	OK
Parking Brake	OK	No Excessive Smoking	OK

EML light illuminated	OK	Oil warning light illuminated	OK
Airbag light illuminated	OK	Service indicator light illuminated	OK
ABS light illuminated	OK		
Windows	OK	Radio	OK
Sat nav	OK	Steering	OK